

Rocky Mountain Resources
Border Hills # 1
Sec. 7-11-20 Ut. 0

Plugging Procedure

1. Spot a 40 sx. plug at 3090' woc and tag plug.
2. Pull out of hole with tbq.
3. Perforate at 580' ^{-900'}
4. Run in hole with tbq. to 894' and establish circulation.
5. Circulate cement ~~100~~ behind 4 1/2 csg. Close in surface valve on 4 1/2" csg and squeeze cement down behind pipe. Leave 4 1/2" csg. full.
6. Set P&A Marker.
7. Clean and level location.
8. Hole is to be loaded with mud between plugs @ 25 lbs per bbl of brine water.