

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form O-103
Revised 10-1-73

NO. OF EXPLORATION PERMITS	
CITY LOCATION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

AUG 20 1981

O. C. D.

APPROPRIATE OFFICE

1. Indicate Type of Lease	State ☒ Free ☐
2. State Oil & Gas Lease No.	LG 7545

SUNDY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR RE-DRILL OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PRODUCTION FROM C-101 FOR SUCH PROPOSALS.)

OIL WELL ☐	GAS WELL ☒	OTHER ☐
Name of Operator TERRA OF NEW MEXICO, INC./		
Address of Operator 7409 South Alton Court - Suite 210, Englewood, Colorado 80112		
Location of Well UNIT LETTER <u>N</u> <u>2452</u> FEET FROM THE <u>West</u> LINE AND <u>650</u> FEET FROM THE <u>South</u> LINE, SECTION <u>25</u> TOWNSHIP <u>10S</u> RANGE <u>19E</u> N.M.P.M.		

3. Unit Agreement Name
4. Farm or Lease Name Riley State
5. Well No. 1
6. Field and Pool, or Wildcat Wildcat
7. County Lincoln

15. Elevation (Show whether DF, RT, GR, etc.)

4776 Q

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

INFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPER. ☐	PLUG AND ABANDONMENT ☒
WILL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Cement plug & abandon after losing 13 drill collars & 10 joints drill pipe in hole at 2687' 7-10-81 Back drill pipe off at 1838' - run drill pipe to 1761 - unable to get deeper - pump 50 sx class c plug at 1761 - WOC 6 hrs. - Tag cement plug at 1637 - Pull drill pipe to 804 Pump 75 sx class C plug - WOC 6 hrs - Tag cement plug at 754' - Pull drill pipe to 450' no circulation - Pump 20 bbls gel water & 2 sx hulls & 5000# 20-40 sand - Wait 30 minutes Tag sand plug at 554' - Pull drill pipe to 450' - mix 10 bbls gel water & 1 sx hulls & 3500# 20-40 sand - Wait 30 minutes no fill up - mix 10 bbl gel water & 1 sx hulls & 1500# 20-40 sand - Wait 30 minutes - no fill up - order gravel truck 7-12-81 Dump approx. 1.5 yards pea gravel in hole - pea gravel bridged at 110' - unable to return to bottom to set final plug consult with state man - run drill pipe down to bridge - set cement plug back to surface using 60 sx class c & 3% C.C.

8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Field Engineer DATE August 10, 1981

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: