

Nov. 1940

1 1050 - 1075 Lime and Shale breaks
2 1075 - 1100 Lime and Shale breaks
3 1100 - 1130 Gray Lime
11 1130 - 1145 Blue Shale
4 Mudding hole
5 Finished Mudding and lowered casing.
6-7 Layed off
8-9 Drilling out plug, gathering tools
10 Pulled 8" casing
11-13 Reamed and cleaned out
18 Set 8" Casing
19 Finished setting 8" casing
20 Bit underreamer thin.
21 Pulled 8" casing
22 String tools getting ready to underream
23-28 Underreaming and cleaning out
29 Layed off
30 Run 8" casing to 1146

Dec.

1 1145 to 1150 Gray Lime
2 1150-1155 Lime and Blue Shale breaks
1165-1165, 1165 - 1175, Gray Lime
3 1175 - 1185 Gray Lime, 1185-1200 Lime and Shale breaks
4 1200 - 1210 Lime and Shale breaks, 1210 - 1220 Blk Lime & Lime brks.
5 1220 - 1225 Broken Lime, 1225-1230 Blue Shale
6 1230 - 1240 Black Lime
7-8 Mudding
9 Finished mudding and lowered 8" casing
10 Drilled out plug and bailed hole water not shut off.
11 Underreamer started
12-16 Finished underreaming and cleaning out, set 8" casing
17-18 Layed off
19 1240 - 1245 Black Clay, 1245 - 1270 Dark Lime, 1270-1290 Lght Lime
1290 - 1300 Sandy shale, 1300-1304 Earthy Lime, 1304-1320 Dk Shale
1320 (Conglomerate)

Jan. 1941

Layed off
2 Put in Crankshaft
3-7 Underreaming and cleaning out
7 Running 8" casing set pipe at 1325
8 Cleaning out hole 1325 - 1348 Brown Lime
9 Started Reaming
10 Underreamed and lowered casing to 1336
11 1348-1350 Broken Lime, 1350-1360 Broken Lime, 1360-1365 Gray Lime
No At 1320 Water to within 200' of surface
Dates 1320-45 Dark Lime, 45-50 Blue Shale, 50-66 Brown Lime,
66-75 Dark Lime, -90 -1500 Dark Lime
1500-10 Gray Lime, 15 Light Lime, 15-20 Dark Lime
1520-25 Sandy Shale, 25-29 Shale and Lime