Submit 3 Copies to Appropriate District Office

1. Type of Well:

OF X

2. Name of Operator

Well Location

Address of Operator

Section

Unit Letter _

PERFORM REMEDIAL WORK

TEMPORARILY ABANDON

PULL OR ALTER CASING

work) SEE RULE 1103.

5/23/91

5/24/91

SIGNATURE

TYPE OR PRINT NAME

(This space for State Use)

 
CONDITIONS OF APPROVAL, IF ANY:

MIRU DDPU.

SDON.

OTHER:

State of New Mexico Energy, Minerals and Natural Resources Department



DISTRICT P.O. Box 1980, Hobbs, NM 88240

DISTRICT II P.O. Drawer DD, Artesia, NM 88210

DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410

ARCO OIL AND GAS COMPANY

34

OIL CONSERVATION DIVISION
P.O. Box 2088 WELL API NO. P.O. Box 2088 30-015-22418 Santa Fe, New Mexico 87504-2088 5. Indicate Type of Lease STATE FEE L O. C. D. 6. State Oil & Gas Lease No. ARTESIA CEFIC SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) EMPIRE ABO UNIT "H" 8. Well No. 9. Pool same or Wildcat EMPIRE ABO BOX 1710, HOBBS, NEW MEXICO 88240 WEST 1200 SOUTH Line Feet From The M · 1000 Feet From The Line and **EDDY** 28E thip 17S Range 28E 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 17S **NMPM** County Township 3658.4' GR Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data SUBSEQUENT REPORT OF: NOTICE OF INTENTION TO: **ALTERING CASING** PLUG AND ABANDON REMEDIAL WORK PLUG AND ABANDONMENT COMMENCE DRILLING OPNS. **CHANGE PLANS** CASING TEST AND CEMENT JOB TEMPORARILY ABANDON OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed TA & HOLD WELL BORE FOR FIELD BLOW DOWN TD 6370'; PERFS: 6236-6246' NU BOP. POH w/TBG, SN, PN AND MUD JOINT. TALLY OUT OF HOLE. RIH w/4-3/4" BIT, 5-1/2" CSG SCRAPPER, AND TBG. POH w/TBG, SCRAPPER, AND BIT. RIH w/5-1/2" CIBP., RUNNING TOOL AND TBG. SET CIBP. POH w/6' TBG SUB. RU KILL TRUCK. CIRC WELL w/8.6# BRINE w/WT-675 CHEMICAL. CLOSE WELL IN. PRESS UP TO 600#. HELD FOR 15 MINS. RD KILL TRUCK. POH w/TBG AND CIBP RUNNING TOOL. LAYER TBG DOWN IN SINGLES. LEFT 1 JT 2-3/8" EUE 8rd TBG ON W/H FLANGE. CIBP SET @ 6213.86'. PRESSURE TEST CHART ATTACHED. TEST WITNESSED BY GARY WILLIAMS, NMOCD. I hereby certify that the information above is true and complete to the best of my knowledge and belief. Administrative Supervisor TELEPHONE NO. Cogburn

This Approval of Temporary

Abandonment Expires

