

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

5. Lease Designation and Serial No.

N.M. 15867

6. If Indian, Allottee or Tribe Name

N.A.

7. If Unit or CA, Agreement Designation

N.A.

8. Well Name and No.

Hagen Federal No. 1

9. API Well No.

30-015-23053

10. Field and Pool, or Exploratory Area

Logan Draw SA

11. County or Parish, State

Eddy Co. New Mexico

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Collier Petroleum Corporation

3. Address and Telephone No.

18 East Atoka Rd. Artesia, New Mexico 88210 505-748-9886

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660 F.N.L. 6660 F.E.L.

Sec. 19-T-17 S -R 27 E

CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent

☒ Subsequent Report

☒ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Run tubing in well to 1836 feet. Shut down Rig for night of 6-6-95.
6-7-95 Pull tubing out and Perforate Casing at 175 Ft. from surface. Run tubing back in well and shut down.
6-8-95 Add 1 joint tubing and tag bottom. Circulate well off into pit. Pump cement from 1845 to 1600 wait 3 hours call B.L.M. talked to Mr. Shaw. Tag cement pump more mud. Cement was tagged at 1630 depth was 1570. Run cement plug from 1260 to 1150 let cement set and tagged cement at 1135. pump more mud and pull tubing. Pump cement down 4" casing and circulate between 4" casing and 10" casing. Cement circulated from 175" to surface annulus.
Dig out around 10" casing and fill with cement.
cut casing off and place dry hole marker, on well.

Approved as to plugging of the well bottom.
Liability under bond is retained until
surface restoration is completed.

14. I hereby certify that the foregoing is true and correct

Signed

Title

Date

(This space for Federal or State office use)

Orig. Signed by Shannon J. Shaw

Title

PETROLEUM ENGINEER

Date

Approved by

Conditions of approval, if any: