

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instruct on re-
verse side)

Budget Bureau No. 1004-0135
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.
NM-0916
6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/> P & A	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR McClellan Oil Corporation	8. FARM OR LEASE NAME Golden Bear Fed.
3. ADDRESS OF OPERATOR P.O. Drawer 730, Roswell, N.M. 88202	9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 660' FSL & 1980' FWL	10. FIELD AND POOL, OR WILDCAT Wildcat/U Penn
14. PERMIT NO. 30-015-25589	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 24-T16S-R29E
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3727 KB	12. COUNTY OR PARISH Eddy
	13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Plugged well as per verbal with Shannon Shaw, witnessed by Don Erley.

7-28-92 Plugged well as follows:

1. Pulled rods, tbg. & tbg. anchor out of hole.
2. Ran C.I.B.P. and set at 9240' & dumped 50' cmt. on top.
3. Ran C.I.B.P. and set at 8650' & dumped 50' cmt. on top.
4. Cut off 5 1/2" csg. at 8500' & pulled out of hole.
5. Ran tbg. to 8560' & circulated hole w/heavy get H2O.
6. 1st plug 8560'-8390', 40 sx plug tagged at 8390'.
7. 2nd plug 7100'-7000', 35 sx plug.
8. 3rd plug 4100'-4000', 35 sx plug.
9. 4th plug 2650'-2500', 40 sx plug, tagged at 2530'.
10. 5th plug 550'-450', 35 sx plug.
11. 6th plug 60'- to surface 20 sx plug- circulated cmt.
12. Install dry hole marker & prep for finalization.

Approved by _____
Location of well _____
Signed by _____

RECEIVED
Aug 4 11 00 AM '92
CARLISLE
AREA HEADQUARTERS

Post ID-2
8-21-92
P&A

18. I hereby certify that the foregoing is true and correct

SIGNED Walter Lee

TITLE Dr lg. & Comp. Eng.

DATE 8-3-92

(This space for Federal or State office use)

APPROVED BY _____

TITLE _____

DATE 8/5/92

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

30-015-25589

1
u

Oxford[®]

✱ ESSELTE

MADE IN U.S.A.

NO. R753 1/3

• • • •

5-99-84

OK - M-3PL

2478-10/11/12

CN - L.O

Sing - 12/1/12

Boothole - 10/11/12

NC Tops DGM 9/25/90

Yates	1116
Seven Rivers	1368
Queen	1917
San Andres	2682
Glorieta	4105
Tubb	5434
Abo	6158
Wetmore	7490
Penn	8610