DISTRIBUTION		RECEIVED	Form C-103 Supersedes Old
SANTAFE	NEW MEXICO OIL	CONSERVATION COMMISSION	C-102 and C-103 Effective 1-1-65
FILE		00T 0 0 407F	
U.S.G.S.	<u></u>	OCT 20 1975	5a. Indicate Type of Lease
LAND OFFICE			State Fee
OPERATOR 3	1	O. C. C.	5. State Oil & Gas Lease No. <b>B - 11083</b>
	UNDRY NOTICES AND REPOR		
1. OIL GAS WELL	OTHER-	<u> </u>	7. Unit Agreement Name Artesia State Ur.
2. Name of Operator Anadarko Produc	tion Company		8. Farm or Lease Name Tract No. 7
3. Address of Operator P. O. Box 67, L	oco Hills, New Mexic	so 88255	9. Well No. 2
4. Location of Well		North LINE AND 1650 FEET FROM	10. Field and Pool, or Wildcat Artesia
	SECTION 23 TOWNSHIP	185 RANGE 275 NMPM.	
15. Elevation (Show whether DF, RT, GR, etc.) 34991			12. County
			Eddy
OTHER 17, Describe Proposed or Complework) SEE RULE 1103.	eted Operations (Clearly state all pertin	ent details, and give pertinent dates, including	estimated date of starting any pro-
2. Pumped 75 s	x cement plug @ 1876	mt; tagged top of plug (	0. <b>10</b> -0.
<ul> <li>4. Pumped 65 si</li> <li>5. Shut down 1</li> <li>6. Shot 7" casi</li> <li>7. Pumped 10 si</li> <li>8. Spotted 35</li> <li>9. Shot 7" casi</li> <li>10. Spotted 35</li> <li>11. Shot 7" casi</li> <li>12. Spotted 50</li> <li>13. Pumped 40 si</li> </ul>	x cement plug @ 1820 7 hours; wait on cem ing @ 1430'; could n x mud. sx cement plug from ing @ 923'; could no sx cement plug from ing @ 325'; recovere sx cement plug from x cement plug @ surf	ent; tagged plug @ 1451 not pull. 1451' to 1300'. of pull. 950' to 800'. ed 10 joints of very rag: 360' to 260'.	ged casing. Lon on 8-27-75.
4. Pumped 65 s: 5. Shut down 1 6. Shot 7" cas 7. Pumped 10 s: 8. Spotted 35 9. Shot 7" cas 10. Spotted 35 11. Shot 7" cas 12. Spotted 50 13. Pumped 40 s: 14. Erected dry	x cement plug @ 1820 7 hours; wait on cem ing @ 1430'; could n x mud. sx cement plug from ing @ 923'; could no sx cement plug from ing @ 325'; recovere sx cement plug from x cement plug @ surf hole marker, closed	ent; tagged plug @ 1451 hot pull. 1451' to 1300'. of pull. 950' to 800'. ed 10 joints of very rag 360' to 260'. ace. i pits and cleaned locat	'. ged casing.
<ul> <li>4. Pumped 65 s:</li> <li>5. Shut down 1</li> <li>6. Shot 7" cas:</li> <li>7. Pumped 10 s:</li> <li>8. Spotted 35</li> <li>9. Shot 7" cas:</li> <li>10. Spotted 35</li> <li>11. Shot 7" cas:</li> <li>12. Spotted 50</li> <li>13. Pumped 40 s:</li> <li>14. Erected dry</li> </ul>	x cement plug @ 1820 7 hours; wait on cem ing @ 1430'; could n x mud. sx cement plug from ing @ 923'; could no sx cement plug from ing @ 325'; recovere sx cement plug from x cement plug @ surf	e best of my knowledge and belief.	ged casing. Lon on 8-27-75.