

N	OF COPIES RECEIVED	4
DISTRIBUTION		
SAN TA FE	1	
FILE	1	✓
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

JUL 8 1975

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
B - 10568	
7. Unit Agreement Name	
Artesia State Unit	
8. Farm or Lease Name	
Tract No. 9	
9. Well No.	
3	
10. Field and Pool, or Wildcat	
12. County	
Eddy	

**SUNDRY NOTICES AND REPORTS ON WELLS** **ARTESIA, OFFICE**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator
	Anadarko Production Company
3. Address of Operator	
	P. O. Box 67, Loco Hills, New Mexico
4. Location of Well	
UNIT LETTER <b>A</b> , <b>330</b> FEET FROM THE <b>North</b> LINE AND <b>990</b> FEET FROM	
THE <b>East</b> LINE, SECTION <b>23</b> TOWNSHIP <b>18 S</b> RANGE <b>27 E</b> NMPM.	
15. Elevation (Show whether DF, RT, GR, etc.)	
	3514

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Spot 100 sx cement plug in open hole from TD 1907' to bottom of 7" casing @ 1752' and 100' into 7" casing @ 1652'.
- Shut in 4 hours; wait on cement; tag plug.
- Shoot 7" casing off @ 1525'.
- Pull 7" casing.
- Spot 35 sx cement plug through Queen Section 1525' to 1425'.
- Spot 6 sx mud.
- Spot 35 sx cement plug through Seven Rivers Section 1000' to 900'.
- Spot 8 sx mud.
- Spot 35 sx cement plug 50' in and 50' out of 8" casing @ 340'.
- Spot 10 sx cement plug at surface.
- Erect dry hole marker, close pits and clean location.

8 1/4" - 350 -  
7" - 1750-50

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Original Signed by **Jerry E. Buckles** Area Supervisor **July 3, 1975**  
SIGNED TITLE DATE

APPROVED BY **W. A. Gressett** TITLE **SUPERVISOR, DISTRICT II** DATE **JUL 9 1975**  
CONDITIONS OF APPROVAL, IF ANY: Notify N.M.O.C.C. in sufficient time to witness

*Plugging*