

# **PLUGGING REPORT**

**Shugart State Com. #1, Eddy County, N.M.  
Marathon Oil Company**

**Plugging Contractor: Star Well Service, Inc.-Box 1064-Eastland, Texas 76448  
Phone: 817-629-8563**

**11/20/92      Move rig and equipment to location. Rig up. Notify OCC in  
Artesia of intent to P/A the well and discussed plugging procedures.**

**11/23/92      Install BOP. Run 2 3/8 work string to 9000' SDF**

**11/24/92      Finish running tubing to T. D. at 10,271'. Rig up Halliburton and  
dump a 100 sx plug at 10,271'. Pull tubing to 8250' and pump 50 sx. POOH with  
tubing. Nipple down tubing head and weld pull nipple on casing. Rig up jacks.  
SDFN**

**11/25/92      Tag plug at 7380' with wireline. Work casing. SDFN**

**11/30/92      Work Casing. Cut casing at 4800' with jet cutter. Start laying  
down casing. SDFN**

**12/1/92      Finish laying down casing. Run tubing in hole to 4850'. SDFN**

**12/2/92      Pump 45 sx Cl. A cement at 4850'. Mix and circulate mud. WOC.  
Tag plug at 4730' with tubing. Pull tubing to 4600' and pump 75 sx Cl. A cement.  
Pull 25 jts. tubing. SDFN**

**12/3/92      Tag plug with tubing at 4372'. Pull tubing to 3290'. Pump 45 sx Cl.  
A cement. Pull tubing to 1690' and pump 45 sx Cl. A cement. Pull tubing to 785'.  
Pump 90 sx Cl. A cement WOC. Tag plug at 533'. Pull to 50'. Pump 10 sx Cl. A  
cement. POOH. Rig down. Cut casing and head off 3' below GL. Weld on cap  
and plugged well marker. Fill cellar and pit. Clean location for abandonment**