

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals & Natural Resources Department

Form C-103  
Revised 1-1-89

**OIL CONSERVATION DIVISION**  
P. O. Box 2088  
Santa Fe, NM 7504-2088

**DISTRICT I**  
1625 French Drive Hobbs, NM 88240  
**DISTRICT II**  
P. O. Drawer DD, Artesia, NM 88210  
**DISTRICT III**  
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 30-025-10044
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1 Type of Well: OIL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	7. Lease Name or Unit Agreement Name <b>Rinewalt B</b>
2. Name of Operator <b>The Wiser Oil Company</b>	8. Well No. <b>1</b>
3. Address of Operator <b>P.O. Box 2568 Hobbs, New Mexico (505) 392-9797</b>	9. Pool name or Wildcat <b>Blinebry Oil &amp; Gas</b>
4. Well Location Unit Letter <b>D</b> : <b>660</b> Feet From The <b>North</b> Line and <b>990</b> Feet From The <b>West</b> Line Section <b>4</b> Township <b>22S</b> Range <b>37E</b> NMPM <b>Lea</b> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) <b>3453' GL</b>	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

<b>NOTICE OF INTENTION TO</b>		<b>SUBSEQUENT REPORT OF:</b>	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: _____ <input type="checkbox"/>		OTHER: <u>Clean out &amp; acidize</u> <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1/19/04 MIRU Eunice Well Service. POH w/2-3/8" tbg. RU reverse unit. RIH w/cutrite shoe, wash pipe, Johnson jars, & DC's on 183 jts. 2-7/8" work string. Tag @ 5907'.


1/20/04 Tag @ 5907'. Wash & tag Model "D" pkr. @ 6015'. Wash to 6018.5'

1/21/04 POH w/2-7/8" tbg. & tools. LD shoe. RIH w/new cutrite shoe, wash pipe, Johnson jars & DC's.

1/22/04 Tag @ 6015'. Wash to 6025'. Push bottom of fish to 6265'. Top off fish @ 6160'. POH w/2-7/8" work string & tools.

1/23/04 POH w/2-7/8" work string & tools. LD shoe. RIH w/new shoe, wash pipe, bumper sub, jars & DC's on 2-7/8" tbg. Tag top of fish @ 6160'. Work to 6265'. Work shoe over bottom of fish. Caught fish. POH w/2-7/8" tbg. LD all tools & fish.

1/27/04 RIH w/7" RBP & pkr. on 2-7/8" tbg. Set RBP @ 6167'. Test plug & tbg. to 4000#. Set pkr. @ 6002'. RU Cudd Pressure Service. Acidize Tubb 6060'-6150' w/2000 gals. 15% HCL acid w/anti-sludge & iron control using 2500# rock salt. Best block 2500#. Best break 2500#. ATP 1850# @ 5.0 bpm. MTP 4000# @ 0.7 bpm. ISIP vac. Move RBP to 6002'. Pkr. @ 5605'. Acidize Blinebry 5661'-5903' w/2000 gals. 15% HCL acid w/anti-sludge & iron control using 3500# rock salt. Best block 40#. Best break 40#. ATP 110# @ 5.5 bpm. MTP 150# @ 5.5 bpm. ISIP vac. RD Cudd. Pick up RBP & POH. LD 2-7/8" work string & tools.

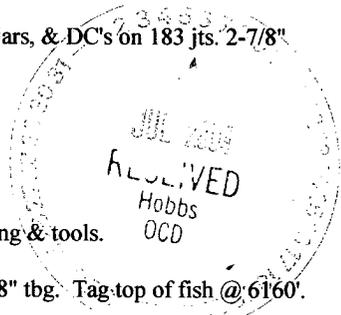

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mary Jo Turner TITLE Production Tech II DATE March 30, 2004  
 TYPE OR PRINT NAME Mary Jo Turner TELEPHONE NO. (505) 392-9797

(This space for State Use)

APPROVED BY Gary W. Wink ORIGINAL SIGNED BY GARY W. WINK TITLE OG FIELD REPRESENTATIVE II/STAFF MANAGER DATE JUL 07 2004  
 CONDITIONS OF APPROVAL, IF ANY:

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals & Natural Resources Department

Form C-103  
Revised 1-1-89

**OIL CONSERVATION DIVISION**

P. O. Box 2088  
Santa Fe, NM 7504-2088

**DISTRICT I**  
1625 French Drive Hobbs, NM 88240  
**DISTRICT II**  
P. O. Drawer DD, Artesia, NM 88210  
**DISTRICT III**  
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 30-025-10044
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1 Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	7. Lease Name or Unit Agreement Name Rinewalt B
2. Name of Operator The Wiser Oil Company	8. Well No. 1
3. Address of Operator P.O. Box 2568 Hobbs, New Mexico (505) 392-9797	9. Pool name or Wildcat Blinbry Oil & Gas
4. Well Location Unit Letter <u>D</u> : <u>660</u> Feet From The <u>North</u> Line and <u>990</u> Feet From The <u>West</u> Line Section <u>4</u> Township <u>22S</u> Range <u>37E</u> NMPM <u>Lea</u> County	10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3453' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

<b>NOTICE OF INTENTION TO</b>	<b>SUBSEQUENT REPORT OF:</b>
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: _____ <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <u>Clean out &amp; acidize</u> <input checked="" type="checkbox"/>


12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1/28/04 RIH w/2-3/8" tbg. Tbg. @ 6035'. SN @ 6000'. RD BOP. NU WH. RDMO. RU swab unit. IFL @ 5400'. FFL @ 5600'.

1/30/04 RD swab unit.

2/02/04 MIRU Eunice Well Service. Tried to fish bumper spring. NU BOP. POH w/tbg.

2/03/04 RIH w/2-7/8" tbg. Tbg. @ 6190'. SN @ 6160'. RD BOP. NU WH. RIH w/rods & 1-1/2" x 16' pump. Left well pumping to Battery. RDMO.

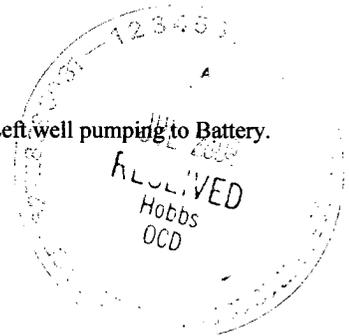

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mary Jo Turner TITLE Production Tech II DATE March 30, 2004  
 TYPE OR PRINT NAME Mary Jo Turner TELEPHONE NO. (505) 392-9797

(This space for State Use)

APPROVED BY \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

**ORIGINAL SIGNED BY**  
**GARY W. WINK** **OC FIELD REPRESENTATIVE II/STAFF MANAGER** DATE JUL 07 2004