## New Mexico Oil Conservation Division, District I

Gorm 3160-5 June 1990)

**UNITED STATES 1625 N. French Drive** DEPARTMENT OF THE INTERIORS, NM 88240 **BUREAU OF LAND MANAGEMENT** 

FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993

5. Lease Designation and Serial No. NMNM015072

## SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

14151617787

retch approx

1 Type of Well		
Si   Gas   Other		8. Well Name and No. Stoltz Federal No. 1
3. Address and Telephone No.		30-025-21686
303 W. Wall, Suite 1800, Midla	and, TX 79701 (432) 687-1777_	10. Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)		Morton, Wolfcamp
2130' FSL, 1980' FEL Unit J, Sec. 12, T15S, R34E		11. County or Parish, State
		Lea, NM
CHECK APPROPRIATE BOX(s	TO INDICATE NATURE OF NOTICE, REP	ORT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTIO	ON .
Notice of Intent	Abandonment	Change of Plans
	Recompletion	New Construction
Subsequent Report .	Plugging Back	Non-Routine Fracturing
<b>15</b> -1	Casing Repair	Water Shut-Off
Final Abandonment Notice	Altering Casing	Conversion to Injection
	Other	Dispose Water
		(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)
	pertinent details, and give pertinent dates, including estimated date of star	rting any proposed work. If well is directionally drilled
Price agoagnitace receptions and measured and rine Activati	depths for all markers and zones pertinent to this work.)*	

6-16-04 MIRU, ND WH, start out of hole laying down rods.

POOH w/ rods. NU BOP, POOH w/ tbg. 6-17-04

RIH w/ gauge ring to TD 10,350', RIH w/ CIBP set @ 10,200'. cap 6-18-04

sx cmt. RIH set CIBP @ 8000', cap w/ 3 sx H cmt. RIH w/ CIBP @ 6000', cap w/ 6-21-04 sx//cmt. Still has water flow. RIH w/ pkr. to find hole, test coming out

6-22-04 Isolate holes 5433' to 5726', set CIBP @ 5000', cap w/ 3 sx cmt or RIH to 4950', circ. hole w/ MLF, cut csg. 4059', not free.

6-23-04

6-24-04 RIH w/ tbg. to 4380', spot 30 sx cmt. TOC @ 3946', POOH w/ tbg. 2500' free.


6-25-04 Cut & POOH w/ 2500' of 4-1/2" csg.

6-28-04 Spot 50 sx cmt. 50' inside of stub @ 2550', WOC & tag @ 2329'.

6-29-04 Perf. @ 1900', sqz. 50 sx cmt. WOC & tag @ 1767'. Perf. @ 370'.

6-30-04 Sqz. & circ. cmt. to surface w/ 246 sx cmt.

6-30-04 RDMO. Cut off wellhead, install dry hole marker, & clean location.

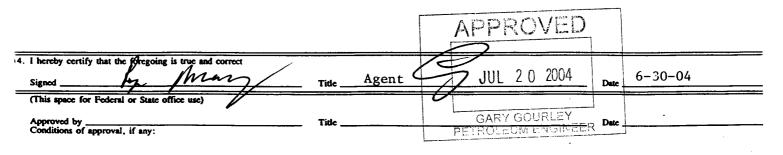

Fitte 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

