

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I

1625 N. French Drive, Hobbs, NM 88240

OIL CONSERVATION DIVISION

310 Old Santa Fe Trail, Room 206  
Santa Fe, New Mexico 87503

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101 FOR SUCH PROPOSALS.)		WELL API NO. 30-025-29444
		5. Indicate Type of Lease FED <input type="checkbox"/> STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		6. State Oil & Gas Lease No.
2. Name of Operator OCCIDENTAL PERMIAN, LTD.		7. Lease Name or Unit Agreement Name SOUTH HOBBS (G/SA) UNIT
3. Address of Operator 1017 W STANOLIND RD.		8. Well No. 197
4. Well Location Unit Letter <u>L</u> : <u>2030</u> Feet From The <u>SOUTH</u> Line and <u>860</u> Feet From The <u>WEST</u> Line Section <u>34</u> Township <u>18-S</u> Range <u>38-E</u> NMPM <u>LEA</u> County		9. Pool name or Wildcat HOBBS (G/SA)
10. Elevation (Show whether DF, RKB, RT GR, etc.) 3625' GL		

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG & ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Pull production equipment.  
Plug back w/gravel and cap w/cmt from 4355' to 4236'. Spot sand from 4236' to 4140'.  
Sqz grayburg perfs @3990-4004 and 4012-25 using 575 sxs Prem Plus cmt w/3% CaCl.  
Drill out and tst sqz to 1000 psi. Clean out to PBTB @4240.  
Perforate the following intervals; 4138-53 using 2 jsp, 120 deg ph.  
Stimulate new perfs w/1000 g 15% NEFE HCL acid.  
Stimulate perfs below 4120' w/3000 g 15% NEFE HCL acid.  
RUN Reda ESP equipment on 130 jts 2-7/8" tbg w/drain valve. Intake set @3985'.  
RDPU. Clean Location.

Rig Up Date: 07/20/2004  
Rig Down Date: 08/04/2004

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Robert Gilbert TITLE Workover Compl Specialist DATE 08/05/2004  
TYPE OR PRINT NAME Robert Gilbert PHONE NO. 505/397-8206

(This space for State Use)

APPROVED BY Hayden W. Wink TITLE FIELD REPRESENTATIVE II/STAFF MANAGER DATE AUG 12 2004  
CONDITIONS OF APPROVAL IF ANY: