State of New Mexico

NSTRICT !		esources Department	Revised 1-1-89
DISTRICT I	OIL CONSERVATION	ON DIVISION	WELL API NO.
P.O. Box 1980, Hobbs, NM 88240	P.O. Box 2088		30-025-32807
STRICT II	Santa En Nove Maying		5. Indicate Type of Lease
O. Box Drawer DD, Artesia, NM 88210	,	3.00.200	STATE FEE
000 Rio Brazos Rd., Aztec, NM 87410			6. State Oil / Gas Lease No. B-1113-1
	TICES AND REPORTS ON WEL	LS	B-1113-1
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI (FORM C-101) FOR SUCH PROPOSALS.		7. Lease Name or Unit Agreement Name CENTRAL VACUUM UNIT	
Type of Well: OIL GAS WELL WE		·	
Name of Operator CHEVRON	USA INC		8. Well No. 203
3. Address of Operator 15 SMITH ROAD, MIDLAND, TX 79705			9. Pool Name or Wildcat VACUUM GRAYBURG SAN ANDRES
. Well Location			
Unit Letter F :	1913 Feet From The NORT	H Line and 2476	Feet From TheWESTLine
Section 6	Township18-SR	ange <u>35-E</u> NM	IPMLEA_ COUNTY
	10. Elevation (Show whether DF, RKB,	RT,GR, etc.) 3977' GR	
Check A	Appropriate Box to Indicate Nat	ure of Notice, Report,	
NOTICE OF INTENTION	ON TO:	SU	JBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	✓ ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING OPE	<u> </u>
PULL OR ALTER CASING		CASING TEST AND CEMEN	
OTHER:		OTHER:	FISH JUNK IN HOLE
Describe Proposed or Completed Operation of Proposed work) SEE RULE 1103.	perations (Clearly state all pertinent de	etails, and give pertinent da	ates, including estimated date of starting any
proposed work) SEE RULE 1103. -12-04:: MIRU. -13-04: REL TAC. RU SWAB. -16-04: SWAB TBG DN. TIH W/SHOI -17-04: MIRU REV UNIT. TIH W/2 7/8 1ADE 1'TO 4830. PLUGGED OFF. RI -18-04: TIH W/BHA & PROD TBG: 2	E, 1 JT WP ON 136 JTS 2 7/8" TBG. 9 B" PROG TBG & TAG FISH @ 4815. F J SWAB & SWAB TBG DN. TIH W/60 7/8" BULL PLUG, TBG SUB. SN. TBG	SET TBG ABOVE PERFF PUMP 250 BBLS FW. COI JTS 2 7/8" TBG TO 1800 G. TAC. SET TAC W/12" S	@ 4196. ULDN NOT GET CIRC. DRY DRILLED TO 4829.
proposed work) SEE RULE 1103. 8-12-04:: MIRU. 8-13-04: REL TAC. RU SWAB. 8-16-04: SWAB TBG DN. TIH W/SHOI 8-17-04: MIRU REV UNIT. TIH W/2 7/8 MADE 1' TO 4830. PLUGGED OFF. RU	E, 1 JT WP ON 136 JTS 2 7/8" TBG. 9 B" PROG TBG & TAG FISH @ 4815. F J SWAB & SWAB TBG DN. TIH W/60 7/8" BULL PLUG, TBG SUB. SN. TBG	SET TBG ABOVE PERFF PUMP 250 BBLS FW. COI JTS 2 7/8" TBG TO 1800 G. TAC. SET TAC W/12" S	@ 4196. ULDN NOT GET CIRC. DRY DRILLED TO 4829.
proposed work) SEE RULE 1103. 8-12-04:: MIRU. 8-13-04: REL TAC. RU SWAB. 8-16-04: SWAB TBG DN. TIH W/SHOI 8-17-04: MIRU REV UNIT. TIH W/2 7/8 MADE 1' TO 4830. PLUGGED OFF. RU 8-18-04: TIH W/BHA & PROD TBG: 2 RUN RODS. PU 2 1/2"X1 3/4"X20' PUN	E, 1 JT WP ON 136 JTS 2 7/8" TBG. 9 B" PROG TBG & TAG FISH @ 4815. F J SWAB & SWAB TBG DN. TIH W/60 7/8" BULL PLUG, TBG SUB. SN. TBG	SET TBG ABOVE PERFF PUMP 250 BBLS FW. COI JTS 2 7/8" TBG TO 1800 G. TAC. SET TAC W/12" S	@ 4196. ULDN NOT GET CIRC. DRY DRILLED TO 4829.
proposed work) SEE RULE 1103. 8-12-04:: MIRU. 8-13-04: REL TAC. RU SWAB. 8-16-04: SWAB TBG DN. TIH W/SHOI 8-17-04: MIRU REV UNIT. TIH W/2 7/8 MADE 1' TO 4830. PLUGGED OFF. RU 8-18-04: TIH W/BHA & PROD TBG: 2 RUN RODS. PU 2 1/2"X1 3/4"X20' PUN FINAL REPORT	E, 1 JT WP ON 136 JTS 2 7/8" TBG. S B" PROG TBG & TAG FISH @ 4815. F J SWAB & SWAB TBG DN. TIH W/60 7/8" BULL PLUG, TBG SUB, SN, TBG AP & RODS. SPACE WELL OUT. LOA	SET TBG ABOVE PERFF PUMP 250 BBLS FW. COI JTS 2 7/8" TBG TO 1800 G. TAC. SET TAC W/12" S	@ 4196. ULDN NOT GET CIRC. DRY DRILLED TO 4829. STRETCH 1200#. FLANGE WELL HEAD UP TO RIG DOWN.
proposed work) SEE RULE 1103. 8-12-04:: MIRU. 8-13-04: REL TAC. RU SWAB. 8-16-04: SWAB TBG DN. TIH W/SHOI 8-17-04: MIRU REV UNIT. TIH W/2 7/8 MADE 1' TO 4830. PLUGGED OFF. RU 8-18-04: TIH W/BHA & PROD TBG: 2 RUN RODS. PU 2 1/2"X1 3/4"X20' PUN	E, 1 JT WP ON 136 JTS 2 7/8" TBG. SP" PROG TBG & TAG FISH @ 4815. FJ SWAB & SWAB TBG DN. TIH W/60 7/8" BULL PLUG, TBG SUB, SN, TBG AP & RODS. SPACE WELL OUT. LOW	SET TBG ABOVE PERFF PUMP 250 BBLS FW. COI JTS 2 7/8" TBG TO 1800 G. TAC. SET TAC W/12" S	@ 4196. ULDN NOT GET CIRC. DRY DRILLED TO 4829. STRETCH 1200#. FLANGE WELL HEAD UP TO RIG DOWN.
proposed work) SEE RULE 1103. 3-12-04:: MIRU. 3-13-04: REL TAC. RU SWAB. 3-16-04: SWAB TBG DN. TIH W/SHOI 3-17-04: MIRU REV UNIT. TIH W/2 7/8 MADE 1' TO 4830. PLUGGED OFF. RU 3-18-04: TIH W/BHA & PROD TBG: 2 RUN RODS. PU 2 1/2"X1 3/4"X20' PUN FINAL REPORT	E, 1 JT WP ON 136 JTS 2 7/8" TBG. SB" PROG TBG & TAG FISH @ 4815. FJ SWAB & SWAB TBG DN. TIH W/60 7/8" BULL PLUG, TBG SUB, SN, TBG AP & RODS. SPACE WELL OUT. LOW	SET TBG ABOVE PERFF PUMP 250 BBLS FW. COI JTS 2 7/8" TBG TO 1800 G, TAC. SET TAC W/12" S AD & TEST 500#. GOOD.	@ 4196. ULDN NOT GET CIRC. DRY DRILLED TO 4829. STRETCH 1200#. FLANGE WELL HEAD UP TO RIG DOWN.

APPROVED A QUILLE TO FIELD REPRESENTATIVE INSTAFF MAN

DATEAUG 2 7 2004