

Submit 3 Copies To Appropriate District  
Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM  
87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised May 08, 2003

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-025-23691
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Greenwood
8. Well Number 18
9. OGRID Number 025616
10. Pool name or Wildcat Eunice San Andes

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other	
2. Name of Operator Zia Energy, Inc.	
3. Address of Operator 2203 Timberloch Place, Suite 229 The Woodlands, TX 77380	
4. Well Location Unit Letter <u>M</u> : <u>330'</u> feet from the <u>South</u> line and <u>500</u> feet from the <u>West</u> line Section <u>9</u> Township <u>22S</u> Range <u>37E</u> NMPM <u>Lea</u> County	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3403' GR	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/> OTHER: <input type="checkbox"/>	SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: Perf, stim & complete <input checked="" type="checkbox"/>

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

8-12-04 thru 9-10-04

MIRU Mesa Well Service workover rig. NU & test BOP to 3000 psi. Test csg to 2500 psi. TIH w/ 4 3/4" bit to PBTD--5085'. Circ hole w/ KCL water. TOH w/ tbg. RU electric line. Perf 4945'--4962' w/ 17 holes, .41" EHD. Swab test -- no shows, all water. Set CIBP @ 4930'. Perf 4817--4914' w/ 30 holes, .41" EHD. Swab w/ no shows. Set CIBP @ 4700' w/ 35' cmt. Perf 4372'--4398' w/ 26 holes, 0.41" EHD. Swab w/ no shows., Set CIBP @ 4364'. Perf 4297--4300 & 4338;--4342' w/ 36 holes, .41" EHD. Acidize w/ 1500 gal. Swab test w/ no shows. Set CIBP @ 4282'. Perf 4202-4235 w/ 30 holes, 0.41" EHD. Swab water w/ no shows. Set CIBP @ 4185'. Test to 1500 Psi--OK. Perf 4097'--4140' w/ 34 holes, 0.41" EHD. Swab w/ no shows. Set CIBP @ 4092'. Perforate 3976'--4072'. Acidize w/ 4000 gal 15% NEFE + 150 ball sealers. Swab w/ good gas & trace of oil. Set RBP at 3970' and perf 3870--3950. Acidize w/ 7000 gal 15% NEFE + 250 ball sealers. Swab gas w/ trace oil. Pull RBP and run 2 7/8" production tbg. EOT -- 4170', SN--4134'. Run rods and pump. Placed well on production.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Gene Lee TITLE Agent DATE 9/12/04

Type or print name Gene Lee Telephone No. (505) 626-4292

(This space for State use)

APPROVED BY Gayle W. Winkler TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER  
Conditions of approval, if any: SEP 21 2004