Submit 3 Copies To Appropriate District Office District 1 1625 N. French Dr., Hobbs, NM 88240 State of New Mexico Energy, Minerals and Natural Resources	Form C-103 March 4, 2004 WELL API NO.
District II 1301 W. Grand Ave., Artesia, NM 88210 OIL CONSERVATION DIVISION	30-025-36234 5. Indicate Type of Lease
District III 1000 Rio Brazos Rd., Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505 1220 South St. Francis Dr. Santa Fe, NM 87505	STATE FEE 6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name Blue Baer Dunn 32 8. Well Number
1. Type of Well: Oil Well ☐ Gas Well ☑ Other	a. Well Number
2. Name of Operator	9. OGRID Number
EOG Resources, Inc 3. Address of Operator	10. D. I.
P.O. Box 2267, Midland, TX, 79702 4. Well Location	10. Pool name or Wildcat Eidson, Morrow North Gas
Unit Letter N : 676 feet from the South line and 1980 feet from the West line	
Section 32 Township 15-S Range 35-E	NMPM Lea County
11. Elevation (Show whether DR, RKB, RT, GR, etc.	
Pit or Below-grade Tank Application (For pit or below-grade tank closures, a form C-144 must be attached)	
Pit Location: UL N Sect 32 Twp 15S Rng 35E Pit type Steel Depth to Groundwater_ Distance from nearest surface water Below-grade Tank Location UL Sect Twp	
676 feet from the South line and 1980 feet from the West line (Steel Tank)	pRng;
12. Check Appropriate Box to Indicate Nature of Notice, NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐ REMEDIAL WOR	SEQUENT REPORT OF SECOND
TEMPORARILY ABANDON	ILLING OPNS. PLOS AND
PULL OR ALTER CASING MULTIPLE CASING TEST AI CEMENT JOB	ND ABAMOQUMENT CEL
OTHER: OTHER:	П
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 8. Spot 25sx, plug from 7450-7250 (Tubb).	
1. Notified OCD 24 hrs prior to MI & RU. 2. NU BOP, pull out of hole with tbg and seal assembly. 3. Set 4 1/2" CIBP at 12340. 4. Displace hole w/MLF, 9.5# Brine w/25# salt gel P/BBL. 5. Spot 50sx, plug from 12340-11900, WOC Tag at 11700 (Morrow, Atoka). 6. Spot 25sx, plug from 11600-11400 (Strawn). 7. Spot 25sx, plug from 10100-9900 (Wolfcamp). 9. Spot	t 60sx, plug from 4850-4100, WOC Tag at 4050 Andres, Grayburg, 8 5/8 Shoe). t 25sx, plug from 3100-2900 (Yates). 4 1/2" csg at 1800, L/D csg, spot 40sx, plug from 570-7700 (Stub) WOC Tag at 1696. t 60sx, plug 525-325 (11 3/4 Shoe) WOC Tag @ 320. t 10sx Surf.install dry hole marker P&A complete 9-29-04
I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative OCD-approved plan.	
SIGNATURE TITLE Consultar	nt DATE 9-29-04
Type or print name #mntby Bagley/ E-mail address: sunsetwellser	vice@yahoo.com Telephone No. 432-561-8600
(This space for State use) OC FIELD REPRESENTATIVE IL/STAFF MANAGER OCT 1 2 2004	
APPPROVED BY LOUIS, TITLE	<u>UCI 1 ≈ 2004</u> DATE
Conditions of approval, if and	ability under bond is retained until reface restoration is completed.