

New Mexico Oil Conservation Division, District I
1625 N. French Drive

Form 3160-5
(JUNE 1990)

UNITED STATES ^{Hobbs, NM 88240}
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

Oil Gas
☐ Well ☒ Well ☐ Other

2. Name of Operator

STRATA PRODUCTION COMPANY

3. Address and Telephone No.

P. O. Box 1030
Roswell, New Mexico 88202-1030 505-622-1127

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Section 15, T22S-R32E
1980' FSL & 1980' FEL

5. Lease Designation and Serial No.

NM 27805

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Connally Federal #1

9. API Well No.

30-025-27772

10. Field and Pool, or Exploratory Area

Red Tank Cisco Canyon East

11. County or Parish, State

Lea County

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other Workover

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion, Report and Log Form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measures and true vertical depths for all markers and zones pertinent to this work.)

08/19/04: Prep location. MIRU. SD.

08/23/04: Flow well dwn. NUBOP. Prep to PU pipe & tools. Leave well open to tanks. SD.

08/24/04: TIH w/tools. PU 81 jnts. Did not tag fish. Leave well open to tanks. SD.

08/26/04: PU pipe. TIH w/mill. PU. TIH w/external cutter. SOH w/stub. SD.

08/27/04: PU, GIH w/over-shot. Latch on to fish. TOH. LD 59 jnts 2-7/8" tbg. PU, GIH w/mill. Wash pipe. Tag up on top of fish. SOH w/cutters. SD.

08/28/04: Cont. out of hole. Recovered closed cutters. SD.

08/30/04: PU, GIH w/4" millshoe. Tag top of fish. Clean dwn to top of wash pipe to 4682'. TOH w/workstring. LD mill. PU, GIH w/external cutters, work knife over fish. Cut pipe. TOH w/fish. LD wash pipe & cutters. Have good stub looking up. RU. SIH w/over-shot. SD.

08/31/04: Cont. in hole w/over-shot. Latch on to stub at 4652'. Pull into fish. RU rotary wireline. TIH to run free pnt. TOH w/wireline. RD rotary. SD.

09/01/04: TOH w/fish. PU shoe. TIH, PU tbg & tag to top of stub at 5372'. Prep to RU swivel. SD

09/02/04: RU swivel. Tag top of stub at 5372'. Work dwn and clean out to a depth of 5432'. Circ hole clean. LD swivel. TOH w/mill. RU, TIH w/external cutters. Work pipe over stub. Cut fish at 5408'. SD.

09/03/04: TOH w/cutters. PU, GIH w/over-shot, jars & bumper stub. Latch on to fish at 5408'. Jar & work pipe. Could not free pipe. SD.

09/04/04: RU rotary wireline. TIH w/free pt. Tag up to 9265'. TOH w/free pt. PU, GIH w/wireline to back off tbg at 9204'. Back off tbg. TOH w/wireline. POOH & LD 122 jts 2-7/8" tbg. PU & GIH w/over-shot. SD.

14. I hereby certify that the foregoing is true and correct

Signed David R. Glass Title Production Records Date 09/22/2004

(This space for Federal or State office use)

Approved by ORIG SGD DAVID R. GLASS Title

Conditions of approval, if any: OCT 12 2004 Date

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

DAVID R. GLASS
PETROLEUM ENGINEER

* See Instruction on Reverse Side