Submit 3 Copies To Appropriate District Office State of New Mexico	Form C-103
<u>District I</u> Energy, Minerals and Natural Resources	Revised May 08, 2003
1625 N. French Dr., Hobbs, NM 88240 District II	WELL API NO. 30-025-36759
1301 W. Grand Ave., Artesia, NM 88210 OIL CONSERVATION DIVISION District III 1220 South St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd Aztec NM 87410	STATE FEE
District IV Santa Fe, NM 8/505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	Greenwood
PROPOSALS.)	
1. Type of Well:	8. Well Number
Oil Well Gas Well Other	#19
2. Name of Operator Zia Energy, Inc.	9. OGRID Number 25616
3. Address of Operator 2203 Timberloch Place, Suite 229, The Woodlands, TX 77380	10. Pool name or Wildcat Eunice San Andres; SW
4. Well Location	Edinos San Andres, SW
Unit Letter L : 2310 feet from the South line and 430 feet from the West line	
Section 9 Township 22S Range 37E	NMPM Lea County
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	
3409' GR	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
	JBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL W	ORK ALTERING CASING
TEMPORARILY ABANDON	DRILLING OPNS PLUG AND
PULL OR ALTER CASING MULTIPLE CASING TEST	ABANDONMENT —
COMPLETION CEMENT JOB	
OTHER: Per	f, Test, Complete well.
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date	
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion	
or recompletion.	
10-4-04 through 10-19-04	
MIRU Computalog. Run GR/CBL/CCL log. PBTD4285. TOC by C	BL @ 1570'. RU Baker Atlas & Perf San
Andres f/ 39634172' w/ 2 JSPF, 60 Deg Phasing, 62 Holes, .41" EHD. Acidize w/ 2500 gal 15% NEFE Acid. Swab test w/ no show. Set CIBP @ 3955'. Test to 1500 psiOK. Perf 3805'3936' w/ 76 holes, .41" EHD.	
Acidize w/ 3000 gal 15% NEFE. ISIPVac. Swab test w/ show of gas. TOH and Make up pumping config. TIH	
w/ 2 7/8" BPMJ, PS, SN, 6 its, TAC, 119 its 2 7/8" tbg. RIH w/ 2.5 x 1.5 x 20' RHBC and rod string. Space out	
and hand well on I eave well numping. Big down and release Mass Well Consider. Turn well over to wind 31 - 3	
	ell Service. Turn well over to the top the service.
	/ŷ¹
	150
	25 July 1990
	12 -
I hereby certify that the information above is true and complete to the best of my knowledge and belief.	
SIGNATURE Will X 49 TITLE Agent	DATE 10/25/04
(This space for State use) APPPROVED BY LOUIS DATE DATE DATE OF THE PRESENTATIVE IN STAFF MANAGER	
APPPROVED BY LOUW. Wan POOTFIELD REPRESENTATIVE	DATE OO
Conditions of approval, if any:	OCT 2 7 2004