

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. <u>30-025-21770</u>
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER ☒ <u>SWD</u>	7. Lease Name or Unit Agreement Name New Mexico "CW" State NCT-1
2. Name of Operator Texaco Inc.	8. Well No. 2
3. Address of Operator P.O. Box 730, Hobbs, NM 88240	9. Pool name or Wildcat Midway Abo
4. Well Location Unit Letter <u>L</u> : <u>1980</u> Feet From The <u>South</u> Line and <u>624</u> Feet From The <u>West</u> Line Section <u>18</u> Township <u>17S</u> Range <u>37E</u> NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3810' GL KB	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

SEE ATTACHMENT

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Richard DeSoto TITLE Engineering Technician DATE 06/29/90
TYPE OR PRINT NAME R. B. DeSoto TELEPHONE NO. 393-7191

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE JUL 02 1990

CONDITIONS OF APPROVAL, IF ANY:

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

R A

RECOMMENDATION FOR ABANDONMENT
NEW MEXICO "CW" STATE NCT-1 NO. 2
MIDWAY ABO FIELD
LEA COUNTY, NEW MEXICO

ABANDONMENT PROCEDURE

1. MIRU pulling unit. Install BOP.
2. RIH with 2 7/8" tubing to PBTD @ 8867'. Load hole with 10# brine containing 25 lb. gel per barrel.
3. Pull up hole. Spot 25 sx. (338') cement plug from 6562-6900. Class H cement (15.6 ppg, 1.18 cu. ft./sx., 5.19 gal/sx.)
4. Pull up hole. Spot 25 sx. (338') cement plug from 4602-4940. (Top of San Andres @ 4940')
5. Pull up hole. Spot 25 sx. (338') cement plug from 3031-3369 across 8 5/8" casing shoe at 3200.
6. Pull up hole. Spot 25 sx. (338') cement plug from 1811-2149. (Top of Salt @ 2149')
7. Pull up hole. Spot 25 sx. (338') cement plug from 181-519 across 11 3/4" casing shoe.
8. TOH with tubing. WOC 12 hours.
9. TIH with tubing. Tag top of cement. Pull up hole. Spot 10 sx. (135') cement plug from 135' to surface.
10. Cut off wellhead. Install marker. Clean location.

