

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30025-12226
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No. 1702010
7. Lease Name or Unit Agreement Name WEST DOLLARHIDE TUBB DRINKARD
8. Well No. 10
9. Pool name or Wildcat DOLLARHIDE TUBB DRINKARD

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER INJECTION	
2. Name of Operator TEXACO E&P INC.	
3. Address of Operator P.O. BOX 3109 MIDLAND TEXAS 79702	
4. Well Location Unit Letter <u>N</u> : <u>660</u> Feet From The <u>SOUTH</u> Line and <u>2303</u> Feet From The <u>WEST</u> Line Section <u>19</u> Township <u>24 S</u> Range <u>38E</u> NMMPM LEA County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3165 RT	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
- 1) Notify NMOC on intent to plug & abandon well.
 - 2) MIRU Pool ND well head NUBOP. Pickup workstring.TIH TO @ 6572. CIRC well w/25#perbb1. salt gel mud.
 - 3) Spot 25sx cmt plug on top of bridge plug @ 6572' Cal top of plug @ 6390' WOC & TAG.
 - 4) POOH to 3850'- spot 25sx cmt plug f/3850'-3700' WOC & TAG (QUEENS)
 - 5) POOH to 3300'- spot 35sx cmt plug f/ 3300-3050 (8-5/8" shoe plug)
 - 6) POOH to 2900'- Spot 25sx cmt plug f/2900-2750 (Yates; B salt)
 - 7) POOH to 1350- Spot 25sx cmt. plug f/1350-1250 (T-Salt)
 - 8) POOH to 425'-Spot 70sx cmt plug f/425'-surface (13-3/8 Shoe Plug)
 - 9) Dig out cellar cut off well head, cap well; install dry hole marker; clean location; rig down and move off.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE RJ Harding III TITLE OPERATIONS ENGINEER DATE 3-20-95
TYPE OR PRINT NAME RJ HARDING III TELEPHONE NO. 915-688-4816

(This space for State Use) ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

MAR 23 1995

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: