Submit 3 Copies To Appropriate District	State of New Me	exico	Form C-103
Office District I	Energy, Minerals and Natu	ıral Resources	May 27, 2004
1625 N. French Dr., Hobbs, NM 88240		WELL API NO).
District II	OIL CONSERVATION	DIVISION $30-041-20$	·····
1301 W. Grand Avc., Artesia, NM 88210 District III	1220 South St. Frag	5 Indicate Lyr	e of Lease
1000 Rio Brazos Rd., Aztec, NM 87410		1 SINIE	X FEE
District IV	Santa Fe, NM 87	/505 6. State Oil & 0	Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505			
	ICES AND REPORTS ON WELLS	7 Lease Name	or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPO	SALS TO DRILL OR TO DEEPEN OR PLI	UG BACK TO A	
	CATION FOR PERMIT* (FORM C-101) FO	DR SUCH Todd Lwr	SA Unit
PROPOSALS.) 1. Type of Well: Oil Well	Gas Well Other	8. Well Number	≭ 302
2. Name of Operator	Gas well [] Other	9. OGRID Nur	302
•		1	noer
Latigo Petroleum, Inc. 3. Address of Operator		227001 10. Pool name	or Wildcat
550 W. Texas, Suite 700 Midland, TX 70701			er San Andres Assoc
		10dd Howe	ST Dall Allutes Assoc
4. Well Location	((()	1000	
Unit Letter B :	660 feet from the N		rom the <u>E</u> line
Section 30			County Roosevelt
till state i der state for det state for state for the state of the st	11. Elevation (Show whether DR,	, RKB, RT, GR, etc.)	
			en transfer programme agreement on the transfer on the artist and a second of the commence with
Pit or Below-grade Tank Application	 		·
Pit type steel Depth to Groundw	rater $\underline{n/a}$ Distance from nearest fresh w	rater well 1000 Distance from nearest st	rface water 1000
Pit Liner Thickness: mil	Below-Grade Tank: Volume	bbls; Construction Material	
12 Charle	Ammondista Day to Indicate N	etros of Nation Bonnet on Othe	- Data
12. CHOCK	Appropriate box to indicate N	ature of Notice, Report or Other	a Data
NOTICE OF IN	ITENTION TO:	SUBSEQUENT R	FPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING OPNS.	PANDA 🔯
PULL OR ALTER CASING	MULTIPLE COMPL	CASING/CEMENT JOB	
FULL ON ALTER CASING I I			
FOLL ON ALTER CASING		CASITOCEMENT 30D	
OTHER:		OTHER:	
OTHER:			ates, including estimated date
OTHER: 13. Describe proposed or composed or starting any proposed we	oleted operations. (Clearly state all p	OTHER:	
OTHER: 13. Describe proposed or comp	oleted operations. (Clearly state all p	OTHER: pertinent details, and give pertinent d	
OTHER: 13. Describe proposed or composed we or recompletion.	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multip	OTHER: pertinent details, and give pertinent details. Attach wellbore dia	gram of proposed completion
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set	oleted operations. (Clearly state all pork). SEE RULE 1103. For Multiple 5-1/2" CIBP @ 4200',	OTHER: pertinent details, and give pertinent details. le Completions: Attach wellbore diagram w/ 35' cmt. w/ bail	gram of proposed completion
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/	oleted operations. (Clearly state all pork). SEE RULE 1103. For Multiple 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud	OTHER: pertinent details, and give pertinent details. le Completions: Attach wellbore diagram w/ 35' cmt. w/ bail 1. test csg. to 500#. OK	gram of proposed completion
OTHER: 13. Describe proposed or composed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx.	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace	OTHER: pertinent details, and give pertinent details, and give pertinent details. Attach wellbore diagram w/ 35' cmt. w/ bail 1, test csg. to 500#, OKee to 1739'.	er.
OTHER: 13. Describe proposed or composed or starting any proposed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626',	other: pertinent details, and give pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail t, test csg. to 500#, OK to 1739'. pressure up on perfs t	er. o 1400#, slow
OTHER: 13. Describe proposed or composed or starting any proposed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, s	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bb1s salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064	other: pertinent details, and give pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail t, test csg. to 500#, OK to 1739'. pressure up on perfs to displace to 818'. Wo	er. o 1400#, slow
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w, 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, s 3/17/05 Perforate @	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bb1s salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064	other: pertinent details, and give pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail t, test csg. to 500#, OK to 1739'. pressure up on perfs t	er. o 1400#, slow
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w, 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, s 3/17/05 Perforate @ 400#.	oleted operations. (Clearly state all pork). SEE RULE 1103. For Multiple to 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', s	other: pertinent details, and give pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail t, test csg. to 500#, OK to 1739'. pressure up on perfs to displace to 818'. Wo	er. o 1400#, slow
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, som the set of the	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bb1s salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pk	other: pertinent details, and give pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail t, test csg. to 500#, OK to 1739'. pressure up on perfs to displace to 818'. Wo	er. o 1400#, slow
OTHER: 13. Describe proposed or composed or starting any proposed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, s 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2 3/18/05 Spot 10 sx.	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 64', set pkr @ 64', set pkr @ 66', set pk	OTHER: pertinent details, and give pertinent details, and give pertinent details and give pertinent details are cap w/ 35' cmt. w/ bail l, test csg. to 500#, OK e to 1739'. pressure up on perfs to l', displace to 818', WO sezq 45 sx. cmt., displace	er. o 1400#, slow C & tag @ 830'. e to 231', shut
OTHER: 13. Describe proposed or composed or starting any proposed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, s 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2 3/18/05 Spot 10 sx.	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 64', set pkr @ 64', set pkr @ 66', set pk	other: pertinent details, and give pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail t, test csg. to 500#, OK to 1739'. pressure up on perfs to displace to 818'. Wo	er. o 1400#, slow C & tag @ 830'. e to 231', shut
OTHER: 13. Describe proposed or composed or starting any proposed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, s 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2 3/18/05 Spot 10 sx.	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 64', set pkr @ 64', set pkr @ 66', set pk	OTHER: pertinent details, and give pertinent details, and give pertinent details and give pertinent details are cap w/ 35' cmt. w/ bails, test csg. to 500#, OK to 1739'. pressure up on perfs to ', displace to 818', WO see 45 sx. cmt., displace install dry hole marker	er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location.
OTHER: 13. Describe proposed or composed or starting any proposed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, s 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2 3/18/05 Spot 10 sx.	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 64', set pkr @ 64', set pkr @ 66', set pk	other: pertinent details, and give pertinent details, and give pertinent details and give pertinent details are completions: Attach wellbore diagrams of the completions of the co	er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location.
OTHER: 13. Describe proposed or composed or starting any proposed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, s 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2 3/18/05 Spot 10 sx.	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 64', set pkr @ 64', set pkr @ 66', set pk	other: pertinent details, and give pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail t, test csg. to 500#, 0Ke to 1739'. pressure up on perfs to displace to 818', wo see to 500 for the complex of the comple	er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore.
OTHER: 13. Describe proposed or composed or starting any proposed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, s 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2 3/18/05 Spot 10 sx.	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 64', set pkr @ 64', set pkr @ 66', set pk	other: pertinent details, and give pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail t, test csg. to 500#, 0Ke to 1739'. pressure up on perfs to displace to 818', wo see to 500 for the complex of the comple	er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore. d until
OTHER: 13. Describe proposed or composed or starting any proposed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, s 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2 3/18/05 Spot 10 sx.	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 64', set pkr @ 64', set pkr @ 66', set pk	other: pertinent details, and give pertinent details, and give pertinent details and give pertinent details are completions: Attach wellbore diagrams of the completions of the co	er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore.
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w, 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, so 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 23/18/05 Spot 10 sx. 3/18/05 RDMO. Cut of	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 60' - surface.	other: pertinent details, and give pertinent details, and give pertinent details, and give pertinent details and give pertinent details and give pertinent details. cap w/ 35' cmt. w/ bail let test csg. to 500#, 0Ke to 1739'. pressure up on perfs to let to 818', wo le	er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore. d until Hobbs OCD
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w, 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, so 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2/3/18/05 Spot 10 sx. 3/18/05 RDMO. Cut of	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mudemt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 60' - surface.	other: pertinent details, and give pertinent details, and give pertinent details, and give pertinent details and give pertinent details and give pertinent details. cap w/ 35' cmt. w/ bail let test csg. to 500#, 0Ke to 1739'. pressure up on perfs to let to 818', wo le	er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore. d until Hobbs OCD ther certify that any pit or below-
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w., 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, so 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2/3/18/05 Spot 10 sx. 3/18/05 RDMO. Cut of I hereby certify that the information grade tank has been/will be constructed or	pleted operations. (Clearly state all pork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mudemt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 60' - surface.	other: pertinent details, and give pertinent details, and give pertinent details, and give pertinent details and give pertinent details and give pertinent details are details. Attach wellbore diagrams wellbore diagrams with the complete t	er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore. d until Hobbs OCD ther certify that any pit or below-
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w, 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, so 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2/3/18/05 Spot 10 sx. 3/18/05 RDMO. Cut of	pleted operations. (Clearly state all gork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 60' - surface.	other: pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail let cap w/ 500 to 50	gram of proposed completion er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore. d until Hobbs OCD ther certify that any pit or below- reative OCD-approved plan DATE 3/21/05
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, so 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2/3/18/05 Spot 10 sx. 3/18/05 RDMO. Cut of I hereby certify that the information grade tank has been/will be constructed or SIGNATURE	pleted operations. (Clearly state all gork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 60' - surface.	other: pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail let cap w/ 500 to 50	gram of proposed completion er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore. d until Hobbs OCD ther certify that any pit or below- reative OCD-approved plan DATE 3/21/05
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w, 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, so 3/17/05 Perforate @ @ 400#. 3/18/05 Tag plug @ 2/3/18/05 Spot 10 sx. 3/18/05 RDMO. Cut of SIGNATURE	pleted operations. (Clearly state all gork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 60' - surface.	other: pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail let cap w/ 500 to 50	gram of proposed completion er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore. d until Hobbs OCD ther certify that any pit or below- reative OCD-approved plan DATE 3/21/05
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w/ 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, so 3/17/05 Perforate @ 400#. 3/18/05 Tag plug @ 2/3/18/05 Spot 10 sx. 3/18/05 RDMO. Cut of I hereby certify that the information grade tank has been/will be constructed or SIGNATURE	pleted operations. (Clearly state all gork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 60' - surface.	other: pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail let cap w/ 500 to 50	gram of proposed completion er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore. d until Hobbs OCD ther certify that any pit or below- reative OCD-approved plan DATE 3/21/05
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w, 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, so 3/17/05 Perforate @ @ 400#. 3/18/05 Tag plug @ 2/3/18/05 Spot 10 sx. 3/18/05 RDMO. Cut of Signature of Signature I hereby certify that the information grade tank has been/will be constructed or Signature Type or print name Roger Mass For State Use Only	pleted operations. (Clearly state all gork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 60' - surface.	other: pertinent details, and give pertinent details. cap w/ 35' cmt. w/ bail let cap w/ 500 to 50	gram of proposed completion er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore. d until Hobbs OCD ther certify that any pit or below- reative OCD-approved plan DATE 3/21/05
OTHER: 13. Describe proposed or composed we or recompletion. 3/16/05 Wireline set 3/16/05 Circ hole w, 3/17/05 Spot 30 sx. 3/17/05 Perforate @ bleed off, so 3/17/05 Perforate @ @ 400#. 3/18/05 Tag plug @ 2/3/18/05 Spot 10 sx. 3/18/05 RDMO. Cut of SIGNATURE	pleted operations. (Clearly state all gork). SEE RULE 1103. For Multiplet 5-1/2" CIBP @ 4200', / 100 bbls salt gel mud cmt. @ 2035', displace 1000', set pkr @ 626', spot 25 sx. cmt. @ 1064 331', set pkr @ 64', set pkr @ 60' - surface.	other: pertinent details, and give pertinent details, and	gram of proposed completion er. o 1400#, slow C & tag @ 830'. e to 231', shut , and clean location. e Well Bore. d until Hobbs OCD ther certify that any pit or below- reative OCD-approved plan DATE 3/21/05