

HOBBS OCD

New Mexico Oil Conservation Division, District I
1625 N. French Drive
Hobbs, NM 88240

Form 3160-5
(August 2007)

JUL 20 2011

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0137
Expires: July 31, 2010

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an
abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.

NM-120355

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE - Other instructions on page 2.

7. If Unit of CA/Agreement, Name and/or No.

Drickey Queen Sand Unit

8. Well Name and No.

Drickey Queen Sand Unit #901

9. API Well No.

30-005-00910

10. Field and Pool or Exploratory Area

Caprock; Queen

11. Country or Parish, State

Chaves, NM

1. Type of Well

☐ Oil Well☐ Gas Well☒ Other

2. Name of Operator

Celero Energy II, LP

3a. Address

400 W. Illinois, Ste. 1601 Midland TX 79701

3b. Phone No. (include area code)

(432)686-1883

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660' FSL & 660' FEL
Sec 34, T13S, R31E (P)

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other Attempt to
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	return to
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	injection

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

3/18 - 3/30/11 TIH w/ bit, bit sub, 6- 3 1/2" DC's, x-over, 14 jts of 2 7/8" WS. Tag @ 631'. TOH. PU impression block & TIH w/ 20 jts 2 7/8" WS. Tag fish & TOH. TIH w/ taper tap & screwed into fish. Tried to unseat pkr w/ no success. Backed off taper tap & TOH. Left 8 jts of 2 7/8" WS & taper tap in hole. TIH & screwed back into fish. Tried to back off taper tap. TOH & left 1 jt w/ 2 7/8" WS & taper tap in hole. PU XO, bumper sub, jars, 6- 3 1/2" DC's, accelerator sub & 9 jts of 2 7/8" WS. TIH, work over & screw into fish @ 631'. Jar on fish & pipe came free. TOH. Recovered taper tap, 19 jts of 2 3/8" IPC & 16' of jt #20. TIH w/ 4 1/2" impression block, tag fish @ 1226'. TOH. PU 4 3/4" overshot w/ 2 3/8" grapple & TIH w/ overshot, XO, bumper sub, jars, 6- 3 1/2" DC's, accelerator sub & 2 7/8" WS. Tag fish @ 1226'. Jar on fish. Back off overshot & TOH. TIH w/ 4 3/4" overshot & 39 jts of 2 7/8" WS. Tag fish @ 1226', work over & latch onto fish. RU WLL & run in to 1410'. Tag up. Could not get through. Tried unsuccessfully to load hole. Pumped 100 bbls. Ran in hole w/ string shot & backed off @ 1381'. LD 3 jts. TOH, recovered 5 1/2 jts of 2 3/8" IPC (169'). TIH w/ 2 3/8" collar, x-over, 44 jts of 2 7/8" WS. Tag & screw onto fish @ 1390'. TIH w/ 1 7/8" mill & 45 jts CS P110. Tag @ 1390'. Wash out 2 3/8" IPC from 1390' - 1515'. Psi while washing 100# (no returns). Wash inside 2 3/8" IPC tbg from 1515' - 2619'. LD 1" CS P110. Jar on fish @ 2474'. RIH & backoff @ 2465'. Run 5 jts w/ shoe 4" UFJ 9.4# total 196.44'. TIH w/ 73 jts 2 7/8" WS & tag @ 2496'. Wash over from 2496' - 2539' w/ no returns. Pumped 70 bbls. Run CIL from 2455' to surface. Run CBL from 2460-1550'. TOC @ 1712'. TIH w/ DC's & 2 7/8" WS & LD same. RDMO. Prepare to send sundry to P&A.

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)

Lisa Hunt

Title Regulatory Analyst

Signature

Lisa Hunt

Date 06/28/2011

ACCEPTED FOR RECORD

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

/S/ DAVID R. GLASS

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001 and 1003 and 18 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or reports or to conceal, in any matter within its jurisdiction.

(Instructions on page 2)