

Submit 1 Copy to Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Received NMOCD 12/11/20 Revised July 18, 2013

WELL API NO.
30-025-30498

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name
State 29 Com

8. Well Number #1

9. OGRID Number
240974

10. Pool name or Wildcat
Lovington Upper Penn; Northeast

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
Legacy Reserves Operating LP

3. Address of Operator
P.O. Box 10848, Midland, TX 79702

4. Well Location

Unit Letter E : 1980 feet from the N line and 810 feet from the W line
Section 29 Township 16S Range 37E NMPM County LEA

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3810' GL

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ **PLUG AND ABANDON** ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Tag CIBP w/ 35' @ 11065'. Circ. hole w/ MLF. Pressure test plug & casing.
2. Isolate holes in casing (+/- 5920'). Establish injection rate. Sqz 55 sx into holes. WOC & tag 5820'.
3. Perf & Sqz 45 sx @ 4260'-4160'. WOC & Tag.
4. Perf & Sqz 55 sx @ 750'-650'. WOC & Tag.
5. Perf & Sqz 125 sx @ 454'-0'. Verify.
6. Cut off wellhead & weld on Dry Hole Marker.

Need:

Top of Canyon 10,800 P&S 50 sx Class H
Top of Wolfcamp 9700 P&S 50 sx Class H
Top of Tubb 7600 P&S 50 sx Class H
Top of Blinberry 6970 P&S 50 sx Class C
Top of Glorietta 6170 P&S 50 sx Class C
Top of San Andres 4930 P&S 50 sx Class C
Top of Salt 2100 P&S 50 sx Class C

See Attached
Conditions of Approval

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE MAR TITLE Compliance Coordinator DATE 12/07/2020

Type or print name Melanie Reyes E-mail address: mreyes@legacyreserves.com PHONE: (432) 221-6358
For State Use Only

APPROVED BY: Kerry Fortner TITLE Compliance Officer A DATE 12/9/20
Conditions of Approval (if any):

Legacy

STATE 29 Com #1

30-025-30498 ① Pap: Sg2

E-29-165-37E 125' Sg2 454'-0

1980 FNL: 810 FNL

Lea County

② Pap: Sg2 55' Sg2 750-650
WOC: TAG

③ Pap: Sg2 45' Sg2 4260-4160
WOC: TAG

④ Isolate holes in CSG (1/5920)
Sg2 50' Sg2. OOC: TAG

⑤ Isolate holes in CSG (1/5920)
establish injection rate. Sg2 w/55' Sg2
WOC: TAG

⑥ Tag CSBP w/35' c 11,000'

Pap: c 11,163-11,222'

Set CSBP c 11,100 w/35' cnt
ON 11-1-A

572 c 11,365 w/ 350' Sg2
TOC 9600' T.S.



1234 c 4M w/ 400' Sg2
Circ.



Legacy Reserves
DAILY OPERATIONS REPORT - (All Days)

10/29/2019 thru 12/3/2020

Printed 12/3/2020 Page 1

STATE 29 COM # 1

LEA Co., NM

BOLO ID: 300398.01

Zone:

SI-due to hole in csg. Set CIBP at 11,100'

Oct 29, 2019 Tuesday (Day 1)

MIRU Mesa well service. Unhang well, unseat pump. POOH and lay dwn 100 1" rods.

SISDON

Daily Cost: \$4,189

Cum. Cost: \$4,189

Oct 30, 2019 Wednesday (Day 2)

Continue laying dwn all rods. (Total of 106 1", 123 7/8", 208 3/4")

NDWH. NUBOP. POOH lay dwn 20 jts tbg.

SISDON

Daily Cost: \$5,414

Cum. Cost: \$9,603

Oct 31, 2019 Thursday (Day 3)

Continue POOH laying dwn tbg. (364 jts 2 7/8")

Daily Cost: \$4,374

Cum. Cost: \$13,977

Nov 1, 2019 Friday (Day 4)

RU wireline. RIH w/4 1/2" GR to 11,120'. POOH w/GR. PU CIBP, RIH to 11,100' and set plug. RDWL. Dumped 35' cement on top of plug. (4 sx)

Daily Cost: \$13,614

Cum. Cost: \$27,591

Nov 2, 2019 Saturday (Day 5)

Move production tbg to Double R yard

Daily Cost: \$1,320

Cum. Cost: \$28,911

Nov 3, 2019 Sunday (Day 6)

Daily Cost:

Cum. Cost: \$28,911

Nov 4, 2019 Monday (Day 7)

NU and secure WH
2-1/2 EUE Bullplugs

RDMO

Daily Cost: \$962

Cum. Cost: \$29,873

**CONDITIONS OF APPROVAL
FOR PLUGGING AND ABANDONMENT
OCD - Southern District**

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at **(575)-263-6633** at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
3. Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
8. Produced water will not be used during any part of the plugging operation.
9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
11. Class 'C' cement will be used above 7500 feet.
12. Class 'H' cement will be used below 7500 feet.
13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least 1/4" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION