

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103

June 19, 2008

HOBBS OGD

OCT 03 2011

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

| |
|---|
| WELL API NO. 30-025-34561 |
| 5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/> |
| 6. State Oil & Gas Lease No. |
| 7. Lease Name or Unit Agreement Name: MONUMENT 36 STATE |
| 8. Well Number #2 |
| 9. OGRID Number 005380 |
| 10. Pool name or Wildcat Goodwin, ABO |
| 11. Elevation (Show whether DR, RKB, RT, GR, etc.) |

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

| | |
|--|---|
| 1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other | 2. Name of Operator XTO Energy, Inc. |
| 3. Address of Operator 200 N. Loraine, Ste. 800 Midland, TX 79701 | 4. Well Location Unit Letter I : 1632 feet from the south line and 1298 feet from the east line Section 12 36 Township 18S Range 36E NMPM County LEA |
| 11. Elevation (Show whether DR, RKB, RT, GR, etc.) | |

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: Repair, sub pump, acidize/chemical sqz. ☒

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. MIRU PU. ND WH. NU BOP w/rams & tbq. & flat cable. MU & rack 7500' of 2 3/8" WS.
2. RU Spoolers. POOH & stand 2 3/8" tbq & failed ESP & LD.
3. Change BOP rams from 2 3/8 tbq, flat cable to tbq. RIH w/notched collar on WS to PBTD @ 7509' CO fill to PBTD Circ. w/treated PW.
4. PU & RIH w/sonic hammer on WS to 7261'. RU stripping head.
5. MIRU acid co. Test lines to 4000 psig.
6. Wash OH from 7261'- 7509' w/brine, circ to pit. Sonic hammer OH from 7509' up to 7261' w/acid.
7. RDMO acid co. RU swab. RD stripping head. POOH w/tbg & sonic hammer tool.
8. Change BOP rams. PU & RIH w/2 3/8 prod. Tbg and test ESP. ND BOP. NU WH. RWTP. Test well. RDMO PU.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Sharon Hindman TITLE Regulatory Analyst DATE 09/30/2011

sharon.hindman@xtoenergy.com

Type or print name Sharon Hindman E-mail address: sharon.hindman@xtoenergy.com PHONE 432-620-6741

For State Use Only

APPROVED BY [Signature] TITLE State Rep DATE 10-5-2011

Conditions of Approval (if any):

OCT 05 2011