State of New Mexico District (1-673) 393-6161 District (1-673) 48-1233 Bit S. First St., Artesia, NM 88240 District (1-673) 48-1233 Distric
District III - (575) 748-1283   SITS First N., Aresia, NM 8220   CONSERVATION DIVISION   District III - (505) 334-6178   1220 South St. Francis Dr.   Santa Fe, NM 87505   S. Indicate Type of Lease   STATE
District III - (505) 314-6178   10220 South St. Francis Dr.   Santa Fe, NM 87505   Santa Fe, NM 87505   STATE   FEE
STATE   FEE
12.0 S.S. Francis Dr., Santa Fe, NM   23.5 S.
COMONO USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEFERENT RESERVOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)   DIFFERENT RESERVOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)  1. Type of Well: Oil Well   Gas Well   Other INJECTION   8. Well Number: 023    2. Name of Operator   9. OGRID Number: 269324    LINN OPERATING, INC.   9. OGRID Number: 269324    10. Pool name or Wildcat LANGLIE MATTIX;7 RVRS-Q-GRAYBURG    4. Well Location   Unit Letter   O; 100   feet from the   S   line and   1980   feet from the   E   line Section   03   Township   258   Range   37E   NMPM   LEA   County    11. Elevation (Show whether DR, RKB, RT, GR, etc.)   3154'    12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data    NOTICE OF INTENTION TO:   PLUS AND ABANDON   CHANGE PLANS   COMMENCE DRILLING OPNS   PAND A   MULTIPLE COMPL   CASING/CEMENT JOB   OTHER:
1. Type of Well: Oil Well
2. Name of Operator LINN OPERATING, INC.  3. Address of Operator 600 TRAVIS; SUITE 5100, HOUSTON, TEXAS 77002  4. Well Location Unit Letter O; 100 feet from the S line and 1980 feet from the E line Section 03 Township 25S Range 37E NMPM LEA County  11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3154'  12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data  NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PAND A CASING/CEMENT JOB  DOWNHOLE COMMINGLE OTHER SEE ULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.  Amendment to the earlier dated October 14th (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 – MI RUPU Dug out cellar. NDWH, no tbg in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245". POH PU & RIH w/ CIBP @ 3,236". Circ hole w/ mud laden fluid. Spotted 70 sx class "C" neat cmt fr 2;220-3,236'. Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280' tbg. LD the remainder. SIFN.
3. Address of Operator 600 TRAVIS, SUITE 5100, HOUSTON, TEXAS 77002  4. Well Location Unit Letter O: 100 feet from the Section O3 Township 25S Range 37E NMPM LEA County  11. Elevation (Show whether DR, RKB, RT, GR, etc.)  12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data  NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS PAND A  PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT JOB  OTHER:  13. Describe proposed or completed operations, (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.  Amendment to the earlier dated October 14th (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 - MI RUPU Dug out cellar. NDWH, no tbg in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245". POH PU & RIH w/ CIBP @ 3,236". Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236°. Mark Whitaker.w/ OCD said they could combine two plugs. POH standing back 1,280° tbg. LD the remainder. SIFN.
4. Well Location Unit Letter O: 100 feet from the S line and 1980 feet from the E line Section 03 Township 25S Range 37E NMPM LEA County  11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3154'  12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data  NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS PAND A CASING/CEMENT JOB  PULL OR ALTER CASING MULTIPLE COMPL OTHER:  OTH
Unit Letter O: 100 feet from the S line and 1980 feet from the E line Section 03 Township 258 Range 37E NMPM LEA County  11. Elevation (Show whether DR, RKB, RT, GR, etc.)  12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data  NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS PAND A CASING C
Section 03 Township 25S Range 37E NMPM LEA County  11. Elevation (Show whether DR, RKB, RT, GR, etc.)  12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data  NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK   PLUG AND ABANDON   REMEDIAL WORK   ALTERING CASING   COMMENCE DRILLING OPNS   PAND A   ALTERING CASING   COMMENCE DRILLING OPNS   PAND A   ALTERING CASING   DOWNHOLE COMMINGLE   OTHER:  13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.  Amendment to the earlier dated October 14th (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 – MI RUPU Dug out cellar. NDWH, no tbg in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245". POH PU & RIH w/ CIBP @ 3,236". Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236'. Mark Whitaker.w/ OCD said they could combine two plugs. POH standing back 1,280" tbg. LD the remainder. SIFN.
11. Elevation (Show whether DR, RKB, RT, GR, etc.)  12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data    NOTICE OF INTENTION TO:   SUBSEQUENT REPORT OF:
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data  NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐ REMEDIAL WORK ☐ ALTERING CASING ☐ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ COMMENCE DRILLING OPNS.☐ P AND A ☑ PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐ CASING/CEMENT JOB ☐  OTHER:  13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.  Amendment to the earlier dated October 14 <sup>th</sup> (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 − MI RUPU Dug out cellar. NDWH, no tbg in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245°. POH PU & RIH w/ CIBP @ 3,236°. Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236°. Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280° tbg. LD the remainder. SIFN.
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK   PLUG AND ABANDON   REMEDIAL WORK   ALTERING CASING   COMMENCE DRILLING OPNS.   P AND A   PULL OR ALTER CASING   MULTIPLE COMPL   CASING/CEMENT JOB   DOWNHOLE COMMINGLE   OTHER:  13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.  Amendment to the earlier dated October 14 <sup>th</sup> (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 - MI RUPU Dug out cellar. NDWH, no tbg. in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245". POH PU & RIH w/ CIBP @ 3,236". Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236'. Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280' tbg. LD the remainder. SIFN.  10/3/11 - RIH w/ WL, tagged plug @ 2,262'. Perf @ 1,230'. POH. RIH w/ 4 ½" pkr to 930'. Sozd 25 sx class "C" neat-cmt & displ to plug and p
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK   PLUG AND ABANDON   REMEDIAL WORK   ALTERING CASING   COMMENCE DRILLING OPNS.   P AND A   PULL OR ALTER CASING   MULTIPLE COMPL   CASING/CEMENT JOB   DOWNHOLE COMMINGLE   OTHER:  13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.  Amendment to the earlier dated October 14 <sup>th</sup> (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 - MI RUPU Dug out cellar. NDWH, no tbg. in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245". POH PU & RIH w/ CIBP @ 3,236". Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236'. Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280' tbg. LD the remainder. SIFN.  10/3/11 - RIH w/ WL, tagged plug @ 2,262'. Perf @ 1,230'. POH. RIH w/ 4 ½" pkr to 930'. Sozd 25 sx class "C" neat-cmt & displ to plug and p
PERFORM REMEDIAL WORK  PLUG AND ABANDON  REMEDIAL WORK  ALTERING CASING  CHANGE PLANS  COMMENCE DRILLING OPNS. PAND A  DOWNHOLE COMMINGLE  OTHER:  OTHER: OTHER: OTHER: OTHER: OTHER: OTHER: PAND A  SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.  Amendment to the earlier dated October 14th (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 - MI RUPU Dug out cellar. NDWH, no tbg in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245". POH PU & RIH w/ CIBP @ 3,236". Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2;220-3,236". Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280" tbg. LD the remainder. SIFN.
TEMPORARILY ABANDON
PULL OR ALTER CASING DOWNHOLE COMMINGLE  MULTIPLE COMPL CASING/CEMENT JOB  OTHER:  OTHER:  OTHER:  13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.  Amendment to the earlier dated October 14 <sup>th</sup> (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 - MI RUPU Dug out cellar. NDWH, no tbg in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245". POH PU & RIH w/ CIBP @ 3,236". Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236". Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280" tbg. LD the remainder. SIFN.  10/3/11 - RIH w/ WL, tagged plug @ 2,262". Perf @ 1,230". POH. RIH w/ 4 ½" pkr to 930". Sozd 25 sx class "C" neat cmt & displ to
OTHER:  OTHERE:  OTHER:  OTHER:  OTHER:  OTHER:  OTHER:  OTHER:  OTHER:  OTHER
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.  Amendment to the earlier dated October 14th (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 - MI RUPU Dug out cellar. NDWH, no tbg in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245'. POH PU & RIH w/ CIBP @ 3,236'. Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236'. Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280' tbg. LD the remainder. SIFN.  10/3/11 - RIH w/ WL, tagged plug @ 2,262'. Perf @ 1,230'. POH. RIH w/ 4 ½" pkr to 930'. Sozd 25 sx class "C" neat cmt & displate.
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.  Amendment to the earlier dated October 14 <sup>th</sup> (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 - MI RUPU Dug out cellar. NDWH, no tbg in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245'. POH PU & RIH w/ CIBP @ 3,236'. Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236'. Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280' tbg. LD the remainder. SIFN.  10/3/11 - RIH w/ WL, tagged plug @ 2,262'. Perf @ 1,230'. POH. RIH w/ 4 ½" pkr to 930'. Sozd 25 sx class "C" neat cmt & displ to
proposed completion or recompletion.  Amendment to the earlier dated October 14 <sup>th</sup> (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 – MI RUPU Dug out cellar. NDWH, no tbg in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245'. POH PU & RIH w/ CIBP @ 3,236'. Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236'. Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280' tbg. LD the remainder. SIFN.  10/3/11 – RIH w/ WL, tagged plug @ 2,262'. Perf @ 1,230'. POH. RIH w/ 4 ½" pkr to 930'. Sozd 25 sx class "C" neat cmt & displ to
Amendment to the earlier dated October 14 <sup>th</sup> (I added the information for 10/5/11) Plug & Abandonment:  9/30/11 – MI RUPU Dug out cellar. NDWH, no tbg in well. NUBOP RIH w/ 4 ½" gauge ring to 3,245'. POH PU & RIH w/ CIBP @ 3,236'. Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236'. Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280' tbg. LD the remainder. SIFN.  10/3/11 – RIH w/ WL, tagged plug @ 2,262'. Perf @ 1,230'. POH. RIH w/ 4 ½" pkr to 930'. Sozd 25 sx class "C" neat cmt & displ to
3,236°. Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236°. Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280° tbg. LD the remainder. SIFN.  10/3/11 - RIH w/ WL, tagged plug @ 2,262°. Perf @ 1,230°. POH. RIH w/ 4 ½" pkr to 930°. Sozd 25 sx class "C" neat cmt & display.
3,236°. Circ hole w/ mud laden fluid. Spotted 70 sx class"C" neat cmt fr 2,220-3,236°. Mark Whitaker w/ OCD said they could combine two plugs. POH standing back 1,280° tbg. LD the remainder. SIFN.  10/3/11 - RIH w/ WL, tagged plug @ 2,262°. Perf @ 1,230°. POH. RIH w/ 4 ½" pkr to 930°. Sozd 25 sx class "C" neat cmt & display.
10/3/11 - RIH w/ WL, tagged plug @ 2,262'. Perf @ 1,230'. POH. RIH w/ 4 ½" pkr to 930'. Sazd 25 sx class "C" neat cmt & displate
10/3/11 - RIH w/ WL, tagged plug @ 2,262'. Perf @ 1,230'. POH. RIH w/ 4 ½" pkr to 930'. Sqzd 25 sx class "C" neat cmt & displ to 1,115'. WOC. RIH w/ WL, tagged plug @ 1,111'. POH LD the to 300'. Sqzd 40 sx class "C" neat cmt into csg leek, displaced out to
1,115. WUC. RIH W/ WL, tagged plug @ 1.111'. POH LD the to 300'. Sozd 40 sy class "C" neat cent into and leady displaced on the
590'. WOC. RIH w/ WL, tagged plug @ 583'. POH LD tbg & NDBOP. Put 5 sxs surface plug. RDPU & cleaned location.
10/5/11 - Moved in welder & backhoe. Dug out cellar, cut off wellhead. Weld on Dry Hole Marker. Backfilled cellar. Bury anchors. Cleaned location moved off.
Approved for plugging of well bore only.
Spud Date:  Rig Release Date:  Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging)
which may be found at OCD Web Page under Forms, www.smnrd.state.nm.us/05d.
I hereby certify that the information above is true and complete to the best of my knowledge and belief.
SIGNATURE PHILAS CHILARA TUTE PROVINCE
TITLE: REGULATORY SPECIALIST III DATE OCTOBER 17, 2011
Type or print name TERRY B, CALLAHAN E-mail address: tcallahan@linnenergy.com PHONE: 281, 840, 4272
Type or print name TERRY B. CALLAHAN E-mail address: tcallahan@linnenergy.com PHONE: 281-840-4272  For State Use Only