	xico	Form C-103
District I Energy, Minerals and Natural 1625 N. French Dr., Hobbs, NM 88240	ral Resources WELL AF	March 4, 2004
District II		30-025-30317
District III 1220 South St. Fran	5. Indicate	e Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410 District IV Santa Fe, NM 87410	214	ATE—FEE YZ il & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	6. State O	il & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease N	Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLI DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FO		Veir "B"
PROPOSALS.)	8. Well N	
1. Type of Well: Oil Well Gas Well Other	o. Well IV	10
2. Name of Operator	9. OGRID	
Chevron USA Inc		
3. Address of Operator	10. Pool n	enne of Wilden 24 35 - ABO
15 Smith Rd, Midland, TX 79705 4. Well Location	Skage	AS - ABO TOS
_	line and410 \(\begin{pmatrix} \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\	
Unit Letter 1 : 1790 feet from the South	line and10	feet from the East line
Section 11 Township 20-S Ra	nge 37-E NMPM	Lea County
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		
Pit or Below-grade Tank Application (For pit or below-grade tank closures, a form C-144 must be attached)		
Pit or Below-grade Tank Application (For pit or below-grade tank closures, a form C-144 must be attached) Pit Location: UL Sect 11 Twp 20S Rng 37E Pit type Steel Depth to Groundwater 70 Distance from nearest fresh water well Over 1000		
Distance from nearest surface water		
4700	teel Tank)	 •
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON PROPERTY OF THE		
	SUBSEQUEN	T REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON	SUBSEQUEN REMEDIAL WORK	T REPORT OF: ALTERING CASING
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS	SUBSEQUEN	T REPORT OF: ALTERING CASING PLUG AND
PERFORM REMEDIAL WORK PLUG AND ABANDON	SUBSEQUEN REMEDIAL WORK	T REPORT OF: ALTERING CASING
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE	SUBSEQUEN REMEDIAL WORK COMMENCE DRILLING OPNS CASING TEST AND CEMENT JOB	T REPORT OF: ALTERING CASING PLUG AND ABANDONMENT
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPLETION THER:	SUBSEQUEN REMEDIAL WORK COMMENCE DRILLING OPNS CASING TEST AND CEMENT JOB OTHER: ertinent details, and give perting	T REPORT OF: ALTERING CASING ALTERING CASING ABANDONMENT Control dates, including estimated date
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPLETION	SUBSEQUEN REMEDIAL WORK COMMENCE DRILLING OPNS CASING TEST AND CEMENT JOB OTHER: ertinent details, and give perting	T REPORT OF: ALTERING CASING ALTERING CASING ABANDONMENT Control dates, including estimated date
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: 13. Describe proposed or completed operations. (Clearly state all p of starting any proposed work). SEE RULE 1103. For Multiple or recompletion. 1. Notify OCD 24 hours Prior to MI & RU. 2. Set 5 1/2 CIBP @ 7000 Spot 25sx plug 7000-6800 (ABO) WOC Tag @ 6: 3. Displace hole w/MLF 9.5 # Brine w/12.5# gel P/BBL. 4. Spot 25sx plug 5300-5100 (Glorieta) 5. Spot 25sx plug 4100-3900 (8 5/8 Shoe) WOC Tag @ 3880. 6. Spot 25sx plug 2700-2500 (Yates, B-Salt)	SUBSEQUEN REMEDIAL WORK COMMENCE DRILLING OPNS CASING TEST AND CEMENT JOB OTHER: ertinent details, and give pertine e Completions: Attach wellbore 8. Spot 40sx plu	T REPORT OF: ALTERING CASING ALTERING CASING ABANDONMENT Control dates, including estimated date
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: 13. Describe proposed or completed operations. (Clearly state all p of starting any proposed work). SEE RULE 1103. For Multipl or recompletion. 1. Notify OCD 24 hours Prior to MI & RU. 2. Set 5 1/2 CIBP @ 7000 Spot 25sx plug 7000-6800 (ABO) WOC Tag @ 6 3. Displace hole w/MLF 9.5 # Brine w/12.5# gel P/BBL. 4. Spot 25sx plug 5300-5100 (Glorieta) 5. Spot 25sx plug 4100-3900 (8 5/8 Shoe) WOC Tag @ 3880. 6. Spot 25sx plug 2700-2500 (Yates, B-Salt) 7. Spot 30sx plug 1550-1250 (11 3/4 Shoe, T-Salt) WOC Tag @ 1255 I hereby certify that the information above is true and complete to the be	SUBSEQUEN REMEDIAL WORK COMMENCE DRILLING OPNS CASING TEST AND CEMENT JOB OTHER: ertinent details, and give pertine e Completions: Attach wellbore 93. 8. Spot 40sx plu 9. Install Dry Ho	TREPORT OF: ALTERING CASING BLUG AND ABANDONMENT Cont dates, including estimated date ediagram of proposed completion ag 300-Surf (Surf) Tag @ Surf le Marker 4-11-05.
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: 13. Describe proposed or completed operations. (Clearly state all p of starting any proposed work). SEE RULE 1103. For Multiple or recompletion. 1. Notify OCD 24 hours Prior to MI & RU. 2. Set 5 1/2 CIBP @ 7000 Spot 25sx plug 7000-6800 (ABO) WOC Tag @ 6: 3. Displace hole w/MLF 9.5 # Brine w/12.5# gel P/BBL. 4. Spot 25sx plug 5300-5100 (Glorieta) 5. Spot 25sx plug 4100-3900 (8 5/8 Shoe) WOC Tag @ 3880. 6. Spot 25sx plug 2700-2500 (Yates, B-Salt)	SUBSEQUEN REMEDIAL WORK COMMENCE DRILLING OPNS CASING TEST AND CEMENT JOB OTHER: ertinent details, and give pertine e Completions: Attach wellbore 93. 8. Spot 40sx plu 9. Install Dry Ho	TREPORT OF: ALTERING CASING BLUG AND ABANDONMENT Cont dates, including estimated date ediagram of proposed completion ag 300-Surf (Surf) Tag @ Surf le Marker 4-11-05.
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: 13. Describe proposed or completed operations. (Clearly state all p of starting any proposed work). SEE RULE 1103. For Multipl or recompletion. 1. Notify OCD 24 hours Prior to MI & RU. 2. Set 5 1/2 CIBP @ 7000 Spot 25sx plug 7000-6800 (ABO) WOC Tag @ 6 3. Displace hole w/MLF 9.5 # Brine w/12.5# gel P/BBL. 4. Spot 25sx plug 5300-5100 (Glorieta) 5. Spot 25sx plug 4100-3900 (8 5/8 Shoe) WOC Tag @ 3880. 6. Spot 25sx plug 2700-2500 (Yates, B-Salt) 7. Spot 30sx plug 1550-1250 (11 3/4 Shoe, T-Salt) WOC Tag @ 1255 I hereby certify that the information above is true and complete to the be	SUBSEQUEN REMEDIAL WORK COMMENCE DRILLING OPNS CASING TEST AND CEMENT JOB OTHER: ertinent details, and give pertine e Completions: Attach wellbore 93. 8. Spot 40sx plu 9. Install Dry Ho	TREPORT OF: ALTERING CASING BLUG AND ABANDONMENT Cont dates, including estimated date ediagram of proposed completion ag 300-Surf (Surf) Tag @ Surf le Marker 4-11-05.
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: 13. Describe proposed or completed operations. (Clearly state all profit of starting any proposed work). SEE RULE 1103. For Multiple or recompletion. 1. Notify OCD 24 hours Prior to MI & RU. 2. Set 5 1/2 CIBP @ 7000 Spot 25sx plug 7000-6800 (ABO) WOC Tag @ 63. Displace hole w/MLF 9.5 # Brine w/12.5# get P/BBL. 4. Spot 25sx plug 5300-5100 (Glorieta) 5. Spot 25sx plug 4100-3900 (8 5/8 Shoe) WOC Tag @ 3880. 6. Spot 25sx plug 2700-2500 (Yates, B-Salt) 7. Spot 30sx plug 1550-1250 (11 3/4 Shoe, T-Salt) WOC Tag @ 1255 I hereby certify that the information above is true and complete to the begrade tank has been/will be constructed or closed according to NMOCD guidelines	SUBSEQUEN REMEDIAL WORK COMMENCE DRILLING OPNS CASING TEST AND CEMENT JOB OTHER: ertinent details, and give pertine e Completions: Attach wellbore 93. 8. Spot 40sx plu 9. Install Dry Ho st of my knowledge and belief. , a general permit or an (attached	TREPORT OF: ALTERING CASING BLUG AND ABANDONMENT ABANDONMENT Cent dates, including estimated date endiagram of proposed completion ag 300-Surf (Surf) Tag @ Surf le Marker 4-11-05. I further certify that any pit or below-) alternative OCD-approved plan
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: 13. Describe proposed or completed operations. (Clearly state all prof starting any proposed work). SEE RULE 1103. For Multiple or recompletion. 1. Notify OCD 24 hours Prior to MI & RU. 2. Set 5 1/2 CIBP @ 7000 Spot 25sx plug 7000-6800 (ABO) WOC Tag @ 6 3. Displace hole w/MLF 9.5 # Brine w/12.5# gel P/BBL. 4. Spot 25sx plug 5300-5100 (Glorieta) 5. Spot 25sx plug 4100-3900 (8 5/8 Shoe) WOC Tag @ 3880. 6. Spot 25sx plug 2700-2500 (Yates, B-Salt) 7. Spot 30sx plug 1550-1250 (11 3/4 Shoe, T-Salt) WOC Tag @ 1255 I hereby certify that the information above is true and complete to the begrade tank has been/will be constructed or closed according to NMOCD guidelines SIGNATURE TITLE Type or print name E-mail add	SUBSEQUEN REMEDIAL WORK COMMENCE DRILLING OPNS CASING TEST AND CEMENT JOB OTHER: ertinent details, and give pertine e Completions: Attach wellbore 93. 8. Spot 40sx plu 9. Install Dry Ho st of my knowledge and belief. 1, a general permit or an (attached Consultant	TREPORT OF: ALTERING CASING BLUG AND ABANDONMENT Cont dates, including estimated date endinger of proposed completion By 300-Surf (Surf) Tag @ Surf le Marker 4-11-05. I further certify that any pit or belowater of paper over the paper over t
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: 13. Describe proposed or completed operations. (Clearly state all p of starting any proposed work). SEE RULE 1103. For Multipl or recompletion. 1. Notify OCD 24 hours Prior to MI & RU. 2. Set 5 1/2 CIBP @ 7000 Spot 25sx plug 7000-6800 (ABO) WOC Tag @ 6 3. Displace hole w/MLF 9.5 # Brine w/12.5# get P/BBL. 4. Spot 25sx plug 5300-5100 (Glorieta) 5. Spot 25sx plug 4100-3900 (8 5/8 Shoe) WOC Tag @ 3880. 6. Spot 25sx plug 2700-2500 (Yates, B-Salt) 7. Spot 30sx plug 1550-1250 (11 3/4 Shoe, T-Salt) WOC Tag @ 1255 I hereby certify that the information above is true and complete to the be grade tank has been/will be constructed or closed according to NMOCD guidelines SIGNATURE Title Type or print name Title Type or print name Title	SUBSEQUEN REMEDIAL WORK COMMENCE DRILLING OPNS CASING TEST AND CEMENT JOB OTHER: ertinent details, and give pertine e Completions: Attach wellbore 93. 8. Spot 40sx plu 9. Install Dry Ho st of my knowledge and belief. 1, a general permit or an (attached Consultant	TREPORT OF: ALTERING CASING BLUG AND ABANDONMENT Cont dates, including estimated date endinger of proposed completion By 300-Surf (Surf) Tag @ Surf le Marker 4-11-05. I further certify that any pit or belowater of paper over the paper over t
PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: 13. Describe proposed or completed operations. (Clearly state all prof starting any proposed work). SEE RULE 1103. For Multiple or recompletion. 1. Notify OCD 24 hours Prior to MI & RU. 2. Set 5 1/2 CIBP @ 7000 Spot 25sx plug 7000-6800 (ABO) WOC Tag @ 6 3. Displace hole w/MLF 9.5 # Brine w/12.5# gel P/BBL. 4. Spot 25sx plug 5300-5100 (Glorieta) 5. Spot 25sx plug 4100-3900 (8 5/8 Shoe) WOC Tag @ 3880. 6. Spot 25sx plug 2700-2500 (Yates, B-Salt) 7. Spot 30sx plug 1550-1250 (11 3/4 Shoe, T-Salt) WOC Tag @ 1255 I hereby certify that the information above is true and complete to the begrade tank has been/will be constructed or closed according to NMOCD guidelines SIGNATURE TITLE Type or print name E-mail add	SUBSEQUEN REMEDIAL WORK COMMENCE DRILLING OPNS CASING TEST AND CEMENT JOB OTHER: ertinent details, and give pertine e Completions: Attach wellbore 93. 8. Spot 40sx plu 9. Install Dry Ho st of my knowledge and belief. , a general permit or an (attached	TREPORT OF: ALTERING CASING BLUG AND ABANDONMENT Cont dates, including estimated date endinger of proposed completion By 300-Surf (Surf) Tag @ Surf le Marker 4-11-05. I further certify that any pit or belowater of paper over the paper over t

Approved as to plugging of the Well Bore. Liability under bond is retained until surface restoration is completed.