Submit 1 Copy To Appropriate District Office		w Mexico	Form C-1	
District I	Energy, Minerals and	Natural Resources	October 13, 20 WELL API NO.	009
1625 N. French Dr., Hobbs, NM-88240 OCD District II		30-025-08936		
1301 W. Grand Ave., Artesia, NM 88210 District III  1220 South St. Francis Dr		5. Indicate Type of Lease		
District III 1000 Rio Brazos Rd., Aztec, NM 87410' 2011   1220 South St. Francis Dr. Santa Fe, NM 87505		STATE X FEE		
<u>District IV</u> 1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe, N	INI 0/303	6. State Oil & Gas Lease No.	
87505 CENTED		B-1536		
SUNDRY NOTICES AND REPORTS ON WELLS  (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) KORSTICHOCD PROPOSALS.)		7. Lease Name or Unit Agreement Name State E	e	
1. Type of Well: Oil Well X Gas Well Other		8. Well Number 2		
2. Name of Operator ConocoPhillips Company		9. OGRID Number 217817		
3. Address of Operator 3300 N "A" St Midland, TX 7	9705	RECEIVED	10. Pool name or Wildcat Jalmat Yates	
4. Well Location			Jamat Tates	
Unit Letter I : 1980	0' feet from the So	outh line and	660' feet from the East lir	ne
Section 17	Township 22S	Range 36E	NMPM CountyLEA	,
	. Elevation (Show wheth		The state of the s	
3	556' GL			
12 Check Appr	opriate Box to Indic	ate Nature of Noti	ce, Report or Other Data	
11	•		•	
NOTICE OF INTEN		_	UBSEQUENT REPORT OF: /ORK	П
<del></del>	UG AND ABANDON [ IANGE PLANS [		DRILLING OPNS. □ PANDA [	
<del></del>	JLTIPLE COMPL			<u>—</u>
DOWNHOLE COMMINGLE			_	
			•	
OTHER:		OTHER: elimi	inate surf water in P&A	X
		te all pertinent details	inate surf water in P&A [s, and give pertinent dates, including estimated]	X date
13. Describe proposed or completed of starting any proposed work).	SEE RULE 19.15.7.14	te all pertinent details		X date
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl	SEE RULE 19.15.7.14 etion.	te all pertinent details	s, and give pertinent dates, including estimated	X date
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld	SEE RULE 19.15.7.14 etion. on WH.	te all pertinent details NMAC. For Multiple	s, and give pertinent dates, including estimated Completions: Attach wellbore diagram of	date
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b	SEE RULE 19.15.7.14 detion. on WH. bit & stripper, tag @ 3' D	te all pertinent details NMAC. For Multiple OO to 350' & fell out.	s, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.	date
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL.	SEE RULE 19.15.7.14 etion. on WH. bit & stripper, tag @ 3' E brine, PT csg to 500#-he	te all pertinent details NMAC. For Multiple OO to 350' & fell out. eld. RU WL & run lo	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial	date
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls	SEE RULE 19.15.7.14 letion. on WH. bit & stripper, tag @ 3' E brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg	te all pertinent details NMAC. For Multiple OO to 350' & fell out. eld. RU WL & run log @ 1420' circ well w/	s, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.	date
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain	SEE RULE 19.15.7.14 betion.  on WH. bit & stripper, tag @ 3' D brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 b	on to 350' & fell out.  eld. RU WL & run log  g @ 1420' circ well wobbls	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial	date
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 ss 11/14/11 TIH w/ csg bond log & tag @	SEE RULE 19.15.7.14 letion.  on WH. bit & stripper, tag @ 3' D brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 le x HAD 250# cmt. Stung @ 860', run from 860' to	oo to 350' & fell out. eld. RU WL & run log g @ 1420' circ well wobbls g out off retainer. surf. 100% bonded for	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial	
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 ss 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho	SEE RULE 19.15.7.14 letion.  on WH. bit & stripper, tag @ 3' D brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 le x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur	oo to 350' & fell out. eld. RU WL & run log g@ 1420' circ well wobbls g out off retainer. surf. 100% bonded for	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial / 10# PT to 500#-held. RD WL. TIH w/cmt //860' to surf, 75% from 500' to 250', 50% f/250	
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 ss 11/14/11 TIH w/ csg bond log & tag @	SEE RULE 19.15.7.14 letion.  on WH. bit & stripper, tag @ 3' D brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 le x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur	oo to 350' & fell out. eld. RU WL & run log g@ 1420' circ well wobbls g out off retainer. surf. 100% bonded for	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial / 10# PT to 500#-held. RD WL. TIH w/cmt //860' to surf, 75% from 500' to 250', 50% f/250	
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 ss 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho	SEE RULE 19.15.7.14 letion.  on WH. bit & stripper, tag @ 3' D brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 le x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur	te all pertinent details NMAC. For Multiple NMAC. For Multiple of to 350' & fell out. eld. RU WL & run log @ 1420' circ well wobls gout off retainer. surf. 100% bonded for well come back & inst	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial / 10# PT to 500#-held. RD WL. TIH w/cmt //860' to surf, 75% from 500' to 250', 50% f/250 all Dry hole marker.	
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 ss 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho	SEE RULE 19.15.7.14 letion.  on WH. bit & stripper, tag @ 3' D brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 le x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur	te all pertinent details NMAC. For Multiple O to 350' & fell out. eld. RU WL & run log @ 1420' circ well wobbls gout off retainer. surf. 100% bonded for Vill come back & inst	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial / 10# PT to 500#-held. RD WL. TIH w/cmt //860' to surf, 75% from 500' to 250', 50% f/250 all Dry hole marker.	
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 st 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho 11/15/11 Pump class c cmt 14.5# to su	SEE RULE 19.15.7.14 etion.  on WH. bit & stripper, tag @ 3' E brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 k x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur urf. Top off. RDMO. V	te all pertinent details NMAC. For Multiple NMAC. For Multiple O to 350' & fell out. eld. RU WL & run log @ 1420' circ well wobbls gout off retainer. surf. 100% bonded for Vill come back & instruction of C-1 which which	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial / 10# PT to 500#-held. RD WL. TIH w/cmt / 860' to surf, 75% from 500' to 250', 50% f/250 all Dry hole marker.  Sixed for plugging of well bore only.  ity under bond is retained pending receipt 03 (Subsequent Report of Well Plugging) may be found at OCD Web Page under	
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 ss 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho	SEE RULE 19.15.7.14 etion.  on WH. bit & stripper, tag @ 3' E brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 k x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur urf. Top off. RDMO. V	te all pertinent details NMAC. For Multiple NMAC. For Multiple O to 350' & fell out. eld. RU WL & run log @ 1420' circ well wobbls gout off retainer. surf. 100% bonded for Vill come back & instruction of C-1 which which	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial / 10# PT to 500#-held. RD WL. TIH w/cmt //860' to surf, 75% from 500' to 250', 50% f/250 all Dry hole marker.	
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 st 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho 11/15/11 Pump class c cmt 14.5# to su	SEE RULE 19.15.7.14 etion.  on WH. bit & stripper, tag @ 3' E brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 k x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur urf. Top off. RDMO. V	te all pertinent details NMAC. For Multiple NMAC. For Multiple O to 350' & fell out. eld. RU WL & run log @ 1420' circ well wobbls gout off retainer. surf. 100% bonded for Vill come back & instruction of C-1 which which	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial / 10# PT to 500#-held. RD WL. TIH w/cmt / 860' to surf, 75% from 500' to 250', 50% f/250 all Dry hole marker.  Sixed for plugging of well bore only.  ity under bond is retained pending receipt 03 (Subsequent Report of Well Plugging) may be found at OCD Web Page under	
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 st 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho 11/15/11 Pump class c cmt 14.5# to su	SEE RULE 19.15.7.14 etion.  on WH. bit & stripper, tag @ 3' E brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 he x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur urf. Top off. RDMO. V	te all pertinent details NMAC. For Multiple NMAC. For Multiple O to 350' & fell out. eld. RU WL & run log @ 1420' circ well word of the surf. 100% bonded for the surf. 100% b	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial / 10# PT to 500#-held. RD WL. TIH w/cmt //860' to surf, 75% from 500' to 250', 50% f/250 all Dry hole marker.  Social Dry hole marker.  Social Ory plugging of well bore only.  ity under bond is retained pending receipt 03 (Subsequent Report of Well Plugging) may be found at OCD Web Page ander it, www.cmnrd.state.nm.us/ocd.	
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 ss 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho 11/15/11 Pump class c cmt 14.5# to su	SEE RULE 19.15.7.14 etion.  on WH. bit & stripper, tag @ 3' E brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 he x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur urf. Top off. RDMO. V	te all pertinent details NMAC. For Multiple NMAC. For Multiple O to 350' & fell out. eld. RU WL & run log @ 1420' circ well word of the surf. 100% bonded for the surf. 100% b	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial / 10# PT to 500#-held. RD WL. TIH w/cmt //860' to surf, 75% from 500' to 250', 50% f/250 all Dry hole marker.  Social Dry hole marker.  Social Ory plugging of well bore only.  ity under bond is retained pending receipt 03 (Subsequent Report of Well Plugging) may be found at OCD Web Page ander it, www.cmnrd.state.nm.us/ocd.	
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 ss 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho 11/15/11 Pump class c cmt 14.5# to su	SEE RULE 19.15.7.14 etion.  on WH. bit & stripper, tag @ 3' E brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 b x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur urf. Top off. RDMO. V	te all pertinent details NMAC. For Multiple NMAC. For Multiple O to 350' & fell out. eld. RU WL & run log @ 1420' circ well word of the surf. 100% bonded for the surf. 100% b	circ clean. g f/1419' to surf w/miltifinger capiper, Radial / 10# PT to 500#-held. RD WL. TIH w/cmt //860' to surf, 75% from 500' to 250', 50% f/250 all Dry hole marker. //red for plugging or well bore only.	
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 sx 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho 11/15/11 Pump class c cmt 14.5# to su	SEE RULE 19.15.7.14 etion.  on WH. bit & stripper, tag @ 3' D brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 le x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur urf. Top off. RDMO. V	te all pertinent details NMAC. For Multiple NMAC. For Multiple O to 350' & fell out. eld. RU WL & run log @ 1420' circ well words out off retainer. surf. 100% bonded for Will come back & instruction of C-1 which Forms of the best of my knowled.	completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial 10# PT to 500#-held. RD WL. TIH w/cmt 10# PT to 500#-held. RD WL. TIH w/cmt 10# PT hole marker.  Seed for plugging or well bore only.  Given the bond is retained pending receipt 10 may be found at OCD Web Page 11 may be found at OCD Web Page 12 moder 13 may be found at OCD Web Page 14 moder 15 may be found at OCD Web Page 15 may be found at OCD Web Page 16 may be found at OCD Web Page 17 moder 18 may be found at OCD Web Page 18 moder 19	)' to
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 sx 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho 11/15/11 Pump class c cmt 14.5# to su	SEE RULE 19.15.7.14 etion.  on WH. bit & stripper, tag @ 3' D brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 le x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur urf. Top off. RDMO. V	of C-1 which for the best of my knowledge and	circ clean.  g f/1419' to surf w/miltifinger capiper, Radial  / 10# PT to 500#-held. RD WL. TIH w/cmt  //860' to surf, 75% from 500' to 250', 50% f/250  all Dry hole marker.  / 10# PT to 500#-held bore only.  ity under bond is retained pending receipt  03 (Subsequent Report of Well Plugging)  may be found at OCD Web Page  my www.cmnrd.state.nm.us/ocd.    DATE 11/30/2011	)' to
13. Describe proposed or completed of starting any proposed work). proposed completion or recompl 11/7/11 Cut off Dry hole marker weld 11/8/11 NDWH & NUBOP. RIH w/b 11/10/11 Tagged @ 1420' circ w/10# bond/GR/CCL. RD WL. 11/11/11 Circ well w/12# mud 30 bbls retainer & set @ 1222'. Sting in retain up int & 15 bbls up surf. Pump 300 ss 11/14/11 TIH w/ csg bond log & tag @ 130'. RIH w/ squeeze gun, shoot 4 ho 11/15/11 Pump class c cmt 14.5# to su Spud Date:  Spud Date:  I hereby certify that the information above SIGNATURE	SEE RULE 19.15.7.14 etion.  on WH. bit & stripper, tag @ 3' D brine, PT csg to 500#-he s. RIH & perf 5 1/2" csg her & pump mud cir 26 le x HAD 250# cmt. Stung @ 860', run from 860' to les @ 120'. COH w/gur urf. Top off. RDMO. V	of C-1 which for the best of my knowledge and	c, and give pertinent dates, including estimated Completions: Attach wellbore diagram of Circ clean.  g f/1419' to surf w/miltifinger capiper, Radial / 10# PT to 500#-held. RD WL. TIH w/cmt //860' to surf, 75% from 500' to 250', 50% f/250 all Dry hole marker.  Sived for plugging of well bore only.  Ity under bond is retained pending receipt 03 (Subsequent Report of Well Plugging) may be found at OCD Web Page in www.cmnrd.state.nm.us/ocd.  Redge and belief.  DATE 11/30/2011  Rocophillips.com PHONE: (432)688-9174	)' to