OBBS OCD Form 316

✓ Subsequent Report

Final Abandonment Notice

(April 2004) DEC 2 0 2011

DEPARTMENT OF THE INTERIOR OCD-HOBBS BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Casing Repair

Convert to Injection

Change Plans

5.	Lease Sena	al No		
	NM-L	- 0	62	34

		to drill or to re-enter an (APD) for such proposals.	6. If Indian, Allottee or Tribe Name	
SUBMIT IN TR	7. If Unit or CA/Agreement, Name and/or No.			
1. Type of Well ☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐☐	8. Well Name and No. Cotton Draw Unit # 2			
2. Name of Operator OXY USA In	c. 4	16696	9. API Well No. 30-025-08(83	
3a Address P.O. Box 50250 Midland, TX	79710	3b. Phone No. (include area code) 432-685-5717		
4. Location of Well (Footage, Sec.,	10. Field and Pool, or Exploratory Area Paduca Delaware			
1980 FNL 1980	11. County or Parish, State			
( 100) ( ) ( 100	, to e person c.	,	Lea NM	
12. CHECK AI	PPROPRIATE BOX(ES) TO	O INDICATE NATURE OF NOTICE,	REPORT, OR OTHER DATA	
TYPE OF SUBMISSION · TYPE OF ACTION				
Notice of Intent	Acıdize Alter Casing	Deepen Production (S	tart/Resume)	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

New Construction

✓ Plug and Abandon

Plug Back

Recomplete

Water Disposal

Temporarily Abandon

RECLAMATION DUE 5-21-12

Other

See A Hacked

Accepted as to plugging of the well bore. Liability under bond is retained until Surface restoration is completed.

14. I hereby certify that the foregoing is true and correct Name (Printed/Typed)						
David Stewart	Title Regulatory Advisor					
Signature Sur Stuff	Date 11/24/OCFPTFD FOR RECORD					
THIS SPACE FOR FEDERAL OR STATE OFFICE USE						
Approved by	Title DEC 1 5 2011					
Conditions of approval, if any, are attached. Approval of this notice does not warre certify that the applicant holds legal or equitable title to those rights in the subject I which would entitle the applicant to conduct operations thereon.	ease Office					
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make of any department of agency, of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.						

(Instructions on page 2)

MW/OCD 12-21-2011

## Cotton Draw Unit #2

11/01/2011	MIRU, NDWH, Surface csg parted, 4-1/2" intact, NU BOP, attempt to rel pkr, RIH w/ WL & tag @ 2135', RDWL
11/02/2011	Work tbg & stretch tbg 35000-42000#+8.375"+4133', RIH w/ WL & tag @ 2135', RDWL
11/03/2011	RU Slickline, RIH w/ gauge ring & tag @ 2100', POOH w/ GR, RIH w/ 1-1/2" broach, stack out @ 2135', POOH. RIH w/ bailer, stack @ 2135', get sample of scale, POOH.
11/04/2011	RU CTU, BOP malfuntion, wo repairs to CTU & BOP
11/07/2011	RU CTU, CO tbg from 2135' to 4659', POOH w/ CT, attempt to rel pkr.
11/08/2011	RU pump trk, EIR @ 2BPM @ 1500#. Contact Paul Flowers-BLM to sqz production perfs, Rec BLM
	approval from Wesley Ingram. Sqz 50sx CL C cmt, displace w/ 17.9 bbls, SITP-600#, WOC.
11/09/2011	RU WL, RIH & free pt tbg, 30% free @ 4550', POOH. RIH & cut tbg @ 4590', POOH. Pull 50000# on tbg,
	came up hole 10', LD subs, circ hole 10# mud, pull on tbg, parted @ 56000#, POOH w/ 12 jts, TOF @ 391',
	RIH w/ pkr @ set @ 95', SI for rig repair.
11/11-11/18/2011	RIH w/ overshots, work to fish tbg & pkr, detail furnished on request.
	POOH w/ tbg & pkr, RIH & set CIBP @ 4624',
11/21/2011	RIH & tag CIBP @ 4624', circ hole w/ 65bbl 10# MLF, spot 30sx CL C cmt on CIBP @ 4624', POOH. RIH
	& set pkr @ 2457', test below pkr to 1500#, tested good. RIH w/ WL & tag cmt @ 4153', PUH & perf @
	3100', EIR @ 2BPM @ 900#, sqz 45sx CL C cmt, SITP-300#, WOC
11/22/2011	Rel pkr, PUH & set @ 517', pressure test csg below pkr to 1500#, no test, move pkr to 808', no test, move
	pkr to 1010', no test. RIH w/ WL & tag cmt @ 2830', PUH & perf @ 1200', sqz 40sx CL C cmt w/ 2%
	CaCl2, Rel pkr, WOC. RIH & set pkr @ 30', RIH w/ WL & tag cmt @ 984', POOH.
11/23/2011	RIH & set pkr @ 30', RIH w/ WL & perf @ 426', POOH w/ WL. Break circulation & M&P CL C 170sx cmt,
	circ to surface. Rel pkr, POOH, ND BOP, top off csg, RDPU.