Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD-HOBBS

FORM APPROVED OMB No 1004-0137 Expires July 31, 2010

	OMB N	lo 1004-013
	Expires	July 31, 20
a Samal No		


5. Lease Serial No NMNM86144 6 If Indian, Allottee or Tribe Name

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals

abandoned well.	Jse Form 3160-3 (A		ch proposal	s.			
SUBMIT IN TRIPLICATE – Other instructions on page 2.			7. If Unit of CA/Agreement, Name and/or No.				
1. Type of Well			N/A	- N/A			
Oil Well Gas Well			8 Well Name and No. Pronghorn SWD #	8 Well Name and No. Pronghorn SWD #1			
2 Name of Operator COG Operating LLC					9. API Well No 30-025-32735		
3a Address	0. Marie - 11 11.	3b. Phone No	(ınclude area co	de)	10. Field and Pool or E	xploratory Area	
		432-685-4332	2		SWD; Yates 7 Rivers		
4 Location of Well (Footage, Sec., T.,R	M, or Survey Description	1	.,		11. Country or Parish,	State	
Sec 24 T19S R32E 330FNL1650FEL, Lot B			Lea COUNTY, NM	Lea COUNTY, NM			
12. CHECI	K THE APPROPRIATE BO	OX(ES) TO IND	ICATE NATUR	E OF NO	TICE, REPORT OR OTHE	ER DATA	
TYPE OF SUBMISSION			TY	PE OF A	CTION		
	Acidize	Deep	en	Pr	roduction (Start/Resume)	Water Shut-Off	
Notice of Intent	Alter Casing	Fract	ure Treat	☐ R	eclamation	Well Integrity	
Subsequent Report	Casing Repair	☐ New	Construction	□ R	ecomplete	Other	
	Change Plans	Plug	and Abandon	Т	emporarily Abandon		
Final Abandonment Notice	Convert to Injection	Plug	Back	□ w	ater Disposal		
11/07/11 MIRU. Nipple down valve in hole w/ bit and scraper. 11/08/11 Finish TIH w/ bit and scrap 11/09/11 TIH w/ packer and set @ 3 packer. TOH with packer and RBP. 11/10/11 Rig up tubing testers. TIH v 98jts IPC tbg, 10', 8' 2-7/8 IPC subs, joints from surface. R/D testers. Nipple acker. Nipple up wellhead. Chart w 11/11/11 Finish nipple up wellhead.	per to 3260. TOH w/ bit a 3204. Test csg to 600psi w/ pump out plug, 2.31 R 1jt 2-7/8tbg. Tested tbg ple down BOP. Set packe ell w/ 300psi on casing. 0	nd scraper. TII for 30min, ok. (nipple, 6' nick in hole at 4000 er. Unlactch on Charted good	H w/ RBP to 323 Unset packer. The coated sub, 1 psi above the soff tool. Circ 13 Pump out plug the Retv	33 and set of the set	et RBP. set packer @ 3212. Test 2-7/8 arrowset packer, 2 nd 1 hole in collar, 17 joi acker fluid. Latch on off to	csg to 600psi for 30min, ok. Unset .31 F seal nipple, T-2 on off tool, ints from surface and 1 bad pin 12 bol. Pull 16 points tension in	
14 I hereby certify that the foregoing is tr	us and sorrest Name (Punt	end/Tunned)	Wi	1/2 d	myram		
Kanicia Castillo	de and correct. Name (17th)	ей Турей)	Title Lead R	روک egulatory	Analyst	Engr	
Signature	<u> </u>		Date 12/09/2	011	See	Engr. ottoched	
THIS SPACE FOR FEDERAL OR STATE OFFICE USE							
Approved by			Title			Date	
Conditions of approval, if any, are attached that the applicant holds legal or equitable pentitle the applicant to conduct operations	tle to those rights in the subj	ect lease which w	certify				

Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false,

fictitious or fraudulent statements or representations as to any matter within its jurisdiction

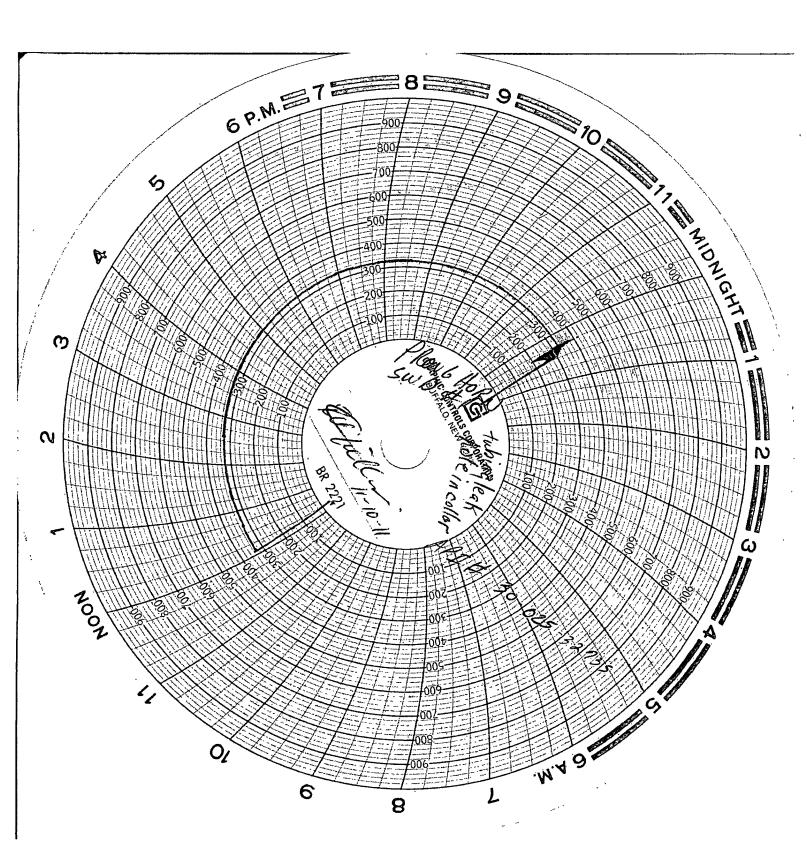

PRONCHORN SWD SYSTEM

PRONCHORN SWD NO. 1

SEC. 24. T195, R32E

LEA COUNTY, AM

ROW # AM - 93345

STATE NO. MARK WHITAKER

STATE NO. MARK WHITAKER

Pronghorn SWD #1 30-025-32735 COG Operating LLC December 19, 2011 Additional Requirements

- 1. Operator started the work prior to submitting a sundry for approval. When operator determined that there was not a casing leak, they should have requested that the Notice of Intent sundry be returned as it was no longer required.
- 2. However, Notice of Intent was submitted November 9, 2011 and approved November 16, 2011. Operator had completed their work on November 11, 2011. As a result, operator did not test the casing to the pressure required by the BLM.
- 3. The MIT was not performed to the pressure required by the BLM. This test shall be repeated and witnessed by the BLM.
- 4. Operator stated on Subsequent Report that they found a hole in tubing collar and 1 bad pin. There is no comment that these were replaced. What was the pressure on the annulus while the tubing was being tested to 4000 psi?
- 5. Operator has not complied with the other Conditions of Approval based on the Subsequent Report.

WWI 121911