Submit 1 Copy To Appropriate DistrictState of New MexicoOfficeEnergy, Minerals and Natural Resources	26079 Form C-103 Revised August 1, 2011
	WELL API NO. 30-025-08608
District II – (575) 748-1283 811 S First St., Artesia, NM 88240 District III – (505) 334-6178 District III – (505) 334-61	5. Indicate Type of Lease
$\frac{1000 \text{ Rio Brazos Rd., Aztec, NM 87410 } 112012}{\text{District IV} - (505) 476-3460} \text{ JAN 11} 2012} \text{ Santa Fe, NM 87505}$	STATE X FEE 6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505 SUNDRY NORGES AND REPORTS ON WELLS	L-258
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	7. Lease Name or Unit Agreement Name
PROPOSALS.) 1. Type of Well: Oil Well X Gas Well Other	DeSoto State 8. Well Number 002
2. Name of Operator	9. OGRID Number
Manzano 3. Address of Operator	10. Pool name or Wildcat
PO Box 2107 Roswell, NM	,
4. Well Location Unit LetterI: 1980 feet from the South line and660	feet from the East line
	NMPM Lea County
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	
12. Check Appropriate Box to Indicate Nature of Notice,	Report or Other Data
	SEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORI TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRI	
PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT	— //
OTHER: OTHER: OTHER:	
 Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Com 	give pertinent dates, including estimated date npletions: Attach wellbore diagram of
 Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Com proposed completion or recompletion. 	give pertinent dates, including estimated date npletions: Attach wellbore diagram of
 Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 	npletions: Attach wellbore diagram of
 Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIO 	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued ting returns from 5 ½ casing head and intermediate
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIO 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. 12/30/2011 RIH to tag. Tagged nothing. Spotted another 25 sx class H cement at 9612'. WOC and 	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued ting returns from 5 ½ casing head and intermediate DN Pulled up out of cement and SION.
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIC 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. 12/30/2011 RIH to tag. Tagged nothing. Spotted another 25 sx class H cement at 9612'. WOC and class C cement. SION. 	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued ting returns from 5 ½ casing head and intermediate N Pulled up out of cement and SION. tagged at 9441'. POH to 6708' and spotted 25 sx
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIC 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. 12/30/2011 RIH to tag. Tagged nothing. Spotted another 25 sx class H cement at 9612'. WOC and class C cement. SION. 1/2/2012 POH with tubing and picked up 5 ½ AD-1 packer. RIH to 4274' dropped standing valve ar testing 5 ½ casing. Isolated holes from 4150' to 3419'. SION 	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued ting returns from 5 ½ casing head and intermediate N Pulled up out of cement and SION. tagged at 9441'. POH to 6708' and spotted 25 sx
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIC 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. 12/30/2011 RIH to tag. Tagged nothing. Spotted another 25 sx class H cement at 9612'. WOC and class C cement. SION. 1/2/2012 POH with tubing and picked up 5 ½ AD-1 packer. RIH to 4274' dropped standing valve ar testing 5 ½ casing. Isolated holes from 4150' to 3419'. SION 1/3/2012 POH and laid down packer. RIH and spotted 50 sx class C cement at 4150'. SION 1/4/2012 RIH and tagged cement at 4008'. Still need to cover holes up to 3419'. Pumped 75 sx class 	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued ting returns from 5 ½ casing head and intermediate DN Pulled up out of cement and SION. tagged at 9441'. POH to 6708' and spotted 25 sx and tested tubing. Fished standing valve and started
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIO 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. 12/30/2011 RIH to tag. Tagged nothing. Spotted another 25 sx class H cement at 9612'. WOC and class C cement. SION. 1/2/2012 POH with tubing and picked up 5 ½ AD-1 packer. RIH to 4274' dropped standing valve ar testing 5 ½ casing. Isolated holes from 4150' to 3419'. SION 1/3/2012 RIH and tagged cement at 4008'. Still need to cover holes up to 3419'. Pumped 75 sx class POH with pipe. SION. 1/5/2011 RIH and perforated 5 ½ casing at 1439'. RIH with packer and squeezed holes at 1439' with 	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued ting returns from 5 ½ casing head and intermediate DN Pulled up out of cement and SION. tagged at 9441'. POH to 6708' and spotted 25 sx ind tested tubing. Fished standing valve and started s c cement at 4008'. WOC and tagged at 3263'.
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIC 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. 12/30/2011 RIH to tag. Tagged nothing. Spotted another 25 sx class H cement at 9612'. WOC and class C cement. SION. 1/2/2012 POH with tubing and picked up 5 ½ AD-1 packer. RIH to 4274' dropped standing valve ar testing 5 ½ casing. Isolated holes from 4150' to 3419'. SION 1/3/2012 RIH and tagged cement at 4008'. Still need to cover holes up to 3419'. Pumped 75 sx class POH with pipe. SION. 1/5/2011 RIH and perforated 5 ½ casing at 1439'. RIH with packer and squeezed holes at 1439' witt Laid down remaining tubing. Perforated 5 ½ casing at 450'. Rigged up on 5 ½ casing and pumped ce surface. Took 115 sx class C. Rigged down. 	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued ting returns from 5 ½ casing head and intermediate DN Pulled up out of cement and SION. tagged at 9441'. POH to 6708' and spotted 25 sx ind tested tubing. Fished standing valve and started s c cement at 4008'. WOC and tagged at 3263'.
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIC 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. 12/30/2011 RIH to tag. Tagged nothing. Spotted another 25 sx class H cement at 9612'. WOC and class C cement. SION. 1/2/2012 POH with tubing and picked up 5 ½ AD-1 packer. RIH to 4274' dropped standing valve ar testing 5 ½ casing. Isolated holes from 4150' to 3419'. SION 1/3/2012 POH and laid down packer. RIH and spotted 50 sx class C cement at 4150'. SION 1/4/2012 RIH and tagged cement at 4008'. Still need to cover holes up to 3419'. Pumped 75 sx class POH with pipe. SION. 1/2/2011 RIH and perforated 5 ½ casing at 1439'. RIH with packer and squeezed holes at 1439' with Laid down remaining tubing. Perforated 5 ½ casing at 450'. Rigged up on 5 ½ casing and pumped ce surface. Took 115 sx class C. Rigged down. 1/6/2012 Cut off well head, installed marker, and cut off anchors. 	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued ting returns from 5 ½ casing head and intermediate DN Pulled up out of cement and SION. tagged at 9441'. POH to 6708' and spotted 25 sx and tested tubing. Fished standing valve and started s c cement at 4008'. WOC and tagged at 3263'. h 35 sx class C cement. WOC and tagged at 1291'. ment to perfs at 450' and up 5 ½ X 8 5/8 annulus to
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIO 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. 12/30/2011 RIH to tag. Tagged nothing. Spotted another 25 sx class H cement at 9612'. WOC and class C cement. SION. 1/2/2012 POH with tubing and picked up 5 ½ AD-1 packer. RIH to 4274' dropped standing valve ar testing 5 ½ casing. Isolated holes from 4150' to 3419'. SION 1/3/2012 RIH and tagged cement at 4008'. Still need to cover holes up to 3419'. Pumped 75 sx class POH with pipe. SION. 1/2/2011 RIH and perforated 5 ½ casing at 1439'. RIH with packer and squeezed holes at 1439' with Laid down remaining tubing. Perforated 5 ½ casing at 450'. Rigged up on 5 ½ casing and pumped ce 	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued ting returns from 5 ½ casing head and intermediate DN Pulled up out of cement and SION. tagged at 9441'. POH to 6708' and spotted 25 sx and tested tubing. Fished standing valve and started s c cement at 4008'. WOC and tagged at 3263'. h 35 sx class C cement. WOC and tagged at 1291'. ment to perfs at 450' and up 5 ½ X 8 5/8 annulus to
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIC 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. 12/30/2011 RIH to tag. Tagged nothing. Spotted another 25 sx class H cement at 9612'. WOC and class C cement. SION. 1/2/2012 POH with tubing and picked up 5 ½ AD-1 packer. RIH to 4274' dropped standing valve ar testing 5 ½ casing. Isolated holes from 4150' to 3419'. SION 1/3/2012 POH and laid down packer. RIH and spotted 50 sx class C cement at 4150'. SION 1/4/2012 RIH and tagged cement at 4008'. Still need to cover holes up to 3419'. Pumped 75 sx class POH with pipe. SION. 1/5/2011 RIH and perforated 5 ½ casing at 1439'. RIH with packer and squeezed holes at 1439' with Laid down remaining tubing. Perforated 5 ½ casing at 450'. Rigged up on 5 ½ casing and pumped ce surface. Took 115 sx class C. Rigged down. 1/6/2012 Cut off well head, installed marker, and cut off anchors. 	npletions: Attach wellbore diagram of imped 75 bbls fresh water down tubing. Continued tring returns from 5 ½ casing head and intermediate N Pulled up out of cement and SION. tagged at 9441'. POH to 6708' and spotted 25 sx ind tested tubing. Fished standing valve and started is c cement at 4008'. WOC and tagged at 3263'. In 35 sx class C cement. WOC and tagged at 1291'. ment to perfs at 450' and up 5 ½ X 8 5/8 annulus to e and belief.
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIO 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. 12/30/2011 RIH to tag. Tagged nothing. Spotted another 25 sx class H cement at 9612'. WOC and class C cement. SION. 1/2/2012 POH with tubing and picked up 5 ½ AD-1 packer. RIH to 4274' dropped standing valve ar testing 5 ½ casing. Isolated holes from 4150' to 3419'. SION 1/3/2012 POH and laid down packer. RIH and spotted 50 sx class C cement at 4150'. SION 1/4/2012 RIH and tagged cement at 4008'. Still need to cover holes up to 3419'. Pumped 75 sx class POH with pipe. SION. 1/5/2011 RIH and perforated 5 ½ casing at 1439'. RIH with packer and squeezed holes at 1439' with Laid down remaining tubing. Perforated 5 ½ casing at 450'. Rigged up on 5 ½ casing and pumped ce surface. Took 115 sx class C. Rigged down. 1/6/2012 Cut off well head, installed marker, and cut off anchors. I hereby certify that the information above is true and complete to the best of my knowledge SIGNATURE	npletions: Attach wellbore diagram of imped 75 bbls fresh water down tubing. Continued tring returns from 5 ½ casing head and intermediate N Pulled up out of cement and SION. tagged at 9441'. POH to 6708' and spotted 25 sx ind tested tubing. Fished standing valve and started is c cement at 4008'. WOC and tagged at 3263'. In 35 sx class C cement. WOC and tagged at 1291'. ment to perfs at 450' and up 5 ½ X 8 5/8 annulus to e and belief.
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIC 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. WOC and class C cement. SION. 1/2/2012 POH with tubing and picked up 5 ½ AD-1 packer. RIH to 4274' dropped standing valve ar testing 5 ½ casing. Isolated holes from 4150' to 3419'. SION 1/3/2012 RIH and tagged cement at 4008'. Still need to cover holes up to 3419'. Pumped 75 sx class POH with pipe. SION. 1/5/2011 RIH and perforated 5 ½ casing at 1439'. RIH with packer and squeezed holes at 1439' with Laid down remaining tubing. Perforated 5 ½ casing at 450'. Rigged up on 5 ½ casing and pumped ce surface. Took 115 sx class C. Rigged down. 1/6/2012 Cut off well head, installed marker, and cut off anchors. I hereby certify that the information above is true and complete to the best of my knowledge SIGNATURE	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued ting returns from 5 $\frac{1}{2}$ casing head and intermediate DN Pulled up out of cement and SION. tagged at 9441'. POH to 6708' and spotted 25 sx and tested tubing. Fished standing valve and started is c cement at 4008'. WOC and tagged at 3263'. In 35 sx class C cement. WOC and tagged at 1291'. ment to perfs at 450' and up 5 $\frac{1}{2} \times 85/8$ annulus to be and belief. DATE $\frac{16}{12}/12$
 13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Comproposed completion or recompletion. 12/22/2011 Rigged up pulling unit and spotted equipment. 12/23/2011 Unseated pump and laid down rods. 12/27/2011 Installed POB. Unset anchor. Pulled 8 stands and anchor hung up. Worked pipe and put to work pipe until dark. SION 12/28/2011 Continued to work pipe. Pumped 130 bbls down tubing. Circulated 100 bbls to pit. Get head. There is a hole in the 5 ½ casing somewhere. Pipe came free. POH with tubing until dark. SIO 12/29/2011 Finished POH with tubing. RIH with tubing and spotted 25 sx class H cement at 9612'. 12/30/2011 RIH to tag. Tagged nothing. Spotted another 25 sx class H cement at 9612'. WOC and class C cement. SION. 1/2/2012 POH with tubing and picked up 5 ½ AD-1 packer. RIH to 4274' dropped standing valve ar testing 5 ½ casing. Isolated holes from 4150' to 3419'. SION 1/3/2012 POH and laid down packer. RIH and spotted 50 sx class C cement at 4150'. SION 1/4/2012 RIH and tagged cement at 4008'. Still need to cover holes up to 3419'. Pumped 75 sx class POH with pipe. SION. 1/5/2011 RIH and perforated 5 ½ casing at 1439'. RIH with packer and squeezed holes at 1439' with Laid down remaining tubing. Perforated 5 ½ casing at 450'. Rigged up on 5 ½ casing and pumped ce surface. Took 115 sx class C. Rigged down. 1/6/2012 Cut off well head, installed marker, and cut off anchors. I hereby certify that the information above is true and complete to the best of my knowledge SIGNATURE	npletions: Attach wellbore diagram of mped 75 bbls fresh water down tubing. Continued ting returns from 5 $\frac{1}{2}$ casing head and intermediate DN Pulled up out of cement and SION. tagged at 9441'. POH to 6708' and spotted 25 sx and tested tubing. Fished standing valve and started is c cement at 4008'. WOC and tagged at 3263'. In 35 sx class C cement. WOC and tagged at 1291'. ment to perfs at 450' and up 5 $\frac{1}{2} \times 85/8$ annulus to be and belief. DATE $\frac{16}{12}/12$

۰.

JAN 1 2 2012