Office	To Appropriate Distric	et	State of N	ew Me	xico		Form (	C-103
Office District I – (575) 393-6161  Energy, Minerals and Natural Resources							Revised August	
1625 N. French Dr., Hobbs, NM <b>供<b>企服S OCD</b></b>						WELL API NO. 30025-40184		
811 S. First St., Artesia, NM 88210 OIL CONSERVATION DIVISION						5. Indicate Type	of Lease	
District III - (505) 334-6178 FFB 2 2 2012 1220 South St. Francis Dr. 1000 Rio Brazos Rd., Aztec, NM 87410 Santa Fe, NM 87505						STATE	FEE	
1220 S St Francis Dr., Santa Fe, NM						6. State Oil & G	as Lease No.	
87505	RE	CEIVED						
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH						7. Lease Name or Unit Agreement Name Triste Draw 36 State		
PROPOSALS)  1. Type of Well: Oil Well Gas Well Other						8. Well Number 1H		
2. Name of Operator Cimarex Energy Co.						9. OGRID Number 215099		
3. Address of Operator						10. Pool name or Wildcat		
600 N. Marienfeld, Ste. 600; Midland, TX 79701						Triste Draw; Bone Spring		
4. Well Loc				_				
1	t LetterD_	_: <u>330</u>	_feet from the		North line and			line
Sec	tion 32		Township 1		Range 26E RKB, RT, GR, etc.	NMPM	Eddy Coun	ty
	30 A	3689' GR	m (Show when	iner Bri,				Kalife.
	12. Che	ck Appropriate	Box to Indi	icate N	ature of Notice,	Report or Other	r Data	
	NOTICE OF	FINTENTION	TO:		SUB	SEQUENT RE	EPORT OF:	
PERFORM F	REMEDIAL WORK				REMEDIAL WOR	_	ALTERING CASIN	IG □
	RILY ABANDON	☐ CHANGE P			COMMENCE DRI		P AND A	
	TER CASING COMMINGLE	☐ MULTIPLE	COMPL		CASING/CEMEN	T JOB		
50,,,,,,,							_	
OTHER:					OTHER:	drill & complete	$\square$	
12 Daga	miles musuasad ou s	ammlated amaration	na (Claarly a	toto all r	artinant dataila an	d airea partipant da	too including actime	tod data
					pertinent details, an C. For Multiple Con			
of sta		ed work). SEE RU					tes, including estima wellbore diagram of	
of sta prop 10/09/11 Spu	arting any propose osed completion on the well	ed work). SEE RU or recompletion.						
of sta prop 10/09/11 Spu 10/14/11 TD	arting any propose osed completion on the delignment of the delign	ed work). SEE RU or recompletion.	LE 19.15.7.14	4 NMAĈ	C. For Multiple Co	mpletions: Attach	wellbore diagram of	•
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIF 12+ hrs. Test	arting any propose osed completion of the did well 17-1/2" hole @ 12 I w/ 13-3/8", 48#, csg to 1200 psi fo	ed work). SEE RU or recompletion. 230'. H40, STC csg & s or 30 mins. Ok.	LE 19.15.7.14	4 NMAĈ	C. For Multiple Co	mpletions: Attach		•
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIH 12+ hrs. Test 10/19/11 TD	arting any propose osed completion of well 17-1/2" hole @ 12 I w/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 484	ed work). SEE RU or recompletion. 230'. H40, STC csg & s or 30 mins. Ok. 40'.	LE 19.15.7.14	4 NMAĈ	C. For Multiple Con Lead: 800 sx Class	mpletions: Attach  C; Tail: 250 sx Cla	wellbore diagram of ass C. Circ 355 sx.	WOC
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIH 12+ hrs. Test 10/19/11 TD 10/21/11 RIH	arting any propose osed completion of d well 17-1/2" hole @ 12 H w/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 484 H w/ 9-5/8",, 40#,	ed work). SEE RU or recompletion. 230'. H40, STC csg & s or 30 mins. Ok. 40'.	LE 19.15.7.14	4 NMAĈ	C. For Multiple Con Lead: 800 sx Class	mpletions: Attach  C; Tail: 250 sx Cla	wellbore diagram of	WOC
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIH 12+ hrs. Test 10/19/11 TD 10/21/11 RIH WOC 24+ hrs 10/23/11 Tes	arting any propose osed completion of d well 17-1/2" hole @ 12 I w/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 484 I w/ 9-5/8",, 40#, s. t csg to 2800 psi fo	ed work). SEE RU or recompletion.  230'. H40, STC csg & sor 30 mins. Ok. 40'. J55, LTC csg & ser	LE 19.15.7.14 et @ 1230'. ( t @ 4840'. C	4 NMAC	C. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65	mpletions: Attach  C; Tail: 250 sx Cla	wellbore diagram of ass C. Circ 355 sx.	WOC
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIH 12+ hrs. Test 10/19/11 TD 10/21/11 RIH WOC 24+ hrs 10/23/11 Tes 11/11/11 TD	arting any propose osed completion of d well 17-1/2" hole @ 12 H w/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 484 H w/ 9-5/8",, 40#, t csg to 2800 psi fo 8-3/4" hole @ 11	ed work). SEE RU or recompletion.  230'. H40, STC csg & sor 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C	LE 19.15.7.14 et @ 1230'. ( t @ 4840'. C	4 NMAC  Cmt w/ I  mt w/ Le  on latera	C. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20	wellbore diagram of ass C. Circ 355 sx.	WOC
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIH 12+ hrs. Test 10/19/11 TD 10/21/11 RIH WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set	arting any propose osed completion of well 17-1/2" hole @ 12 H w/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 484 H w/ 9-5/8",, 40#, strong to 2800 psi fo 8-3/4" hole @ 11 plugs to abandon	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' –	LE 19.15.7.14 et @ 1230'. ( t @ 4840'. C DCD to aband 190 sx; 10,06	4 NMAC  Cmt w/ I  mt w/ Le  on latera  00 – 190	C. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65 al. sx; @ 9350' -190	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out.	wellbore diagram of ass C. Circ 355 sx.	WOC
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIF 12+ hrs. Test 10/19/11 TD 10/21/11 RIF WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set 11/13/11 KO 12/10/11 TD	arting any propose osed completion of dwell 17-1/2" hole @ 12 Hw/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 484 Hw/ 9-5/8", 40#, st csg to 2800 psi f 8-3/4" hole @ 11 plugs to abandon P @ 9129'. Mill 6 8-3/4" hole @ 13	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' – out hole from 9211	LE 19.15.7.14  et @ 1230'. 0  t @ 4840'. C  OCD to aband 190 sx; 10,00 -9226'. RIH	4 NMAC  Cmt w/ I  mt w/ Le  on latera  00 – 190  w/ whip	C. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65 al. sx; @ 9350' -190 stock & set @ 9220	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out. 6'.	wellbore diagram of ass C. Circ 355 sx.	WOC
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIF 12+ hrs. Test 10/19/11 TD 10/21/11 RIF WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set 11/13/11 KO 12/10/11 TD 12/12/11 RIF	arting any propose osed completion of dwell 17-1/2" hole @ 12 H w/ 13-3/8", 48#, csg to 1200 psi fc 12-1/4" hole # 484 H w/ 9-5/8", 40#, st csg to 2800 psi ff 8-3/4" hole @ 11 plugs to abandon P @ 9129'. Mill 6 8-3/4" hole @ 13 H w/ 5-1/2", 17#, F	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' – out hole from 9211	LE 19.15.7.14  et @ 1230'. 0  t @ 4840'. C  OCD to aband 190 sx; 10,00 -9226'. RIH	4 NMAC  Cmt w/ I  mt w/ Le  on latera  00 – 190  w/ whip	C. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65 al. sx; @ 9350' -190 stock & set @ 9220	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out. 6'.	wellbore diagram of ass C. Circ 355 sx.	WOC 21 sx.
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIF 12+ hrs. Test 10/19/11 TD 10/21/11 RIF WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set 11/13/11 KO 12/10/11 TD	arting any propose osed completion of well 17-1/2" hole @ 12 H w/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 484 H w/ 9-5/8", 40#, st csg to 2800 psi fo 8-3/4" hole @ 11 plugs to abandon P @ 9129'. Mill 6 8-3/4" hole @ 13 H w/ 5-1/2", 17#, Fease rig.	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' – out hole from 9211	LE 19.15.7.14  et @ 1230'. 0  t @ 4840'. C  OCD to aband 190 sx; 10,00 -9226'. RIH	4 NMAC  Cmt w/ I  mt w/ Le  on latera  00 – 190  w/ whip	C. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65 al. sx; @ 9350' -190 stock & set @ 9220 lead: 1250 sax 50:	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out. 6'.	wellbore diagram of ass C. Circ 355 sx.	WOC 21 sx.
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIF 12+ hrs. Test 10/19/11 TD 10/21/11 RIF WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set 11/13/11 KO 12/10/11 TD 12/12/11 RIF	arting any propose osed completion of dwell 17-1/2" hole @ 12 H w/ 13-3/8", 48#, csg to 1200 psi fc 12-1/4" hole # 484 H w/ 9-5/8", 40#, st csg to 2800 psi ff 8-3/4" hole @ 11 plugs to abandon P @ 9129'. Mill 6 8-3/4" hole @ 13 H w/ 5-1/2", 17#, F	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' – out hole from 9211	LE 19.15.7.14  et @ 1230'. 0  t @ 4840'. C  OCD to aband 190 sx; 10,00 -9226'. RIH	Cmt w/ Imt w/ Loon latera 00 - 190 w/ whip Cmt w/	C. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65 al. sx; @ 9350' -190 stock & set @ 9220 lead: 1250 sax 50::	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out. 6'.	wellbore diagram of ass C. Circ 355 sx.	WOC 21 sx.
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIH 12+ hrs. Test 10/19/11 TD 10/21/11 RIH WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set 11/13/11 KO 12/10/11 TD 12/12/11 RIH 12/13/11 Rel	arting any propose osed completion of well 17-1/2" hole @ 12 H w/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 484 H w/ 9-5/8", 40#, st csg to 2800 psi fo 8-3/4" hole @ 11 plugs to abandon P @ 9129'. Mill 6 8-3/4" hole @ 13 H w/ 5-1/2", 17#, Fease rig.	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' – out hole from 9211	LE 19.15.7.14  et @ 1230'. 0  t @ 4840'. C  OCD to aband  190 sx; 10,00  -9226'. RIH  et @ 13927'.	Cmt w/ Imt w/ Loon latera 00 - 190 w/ whip Cmt w/	C. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65 al. sx; @ 9350' -190 stock & set @ 9220 lead: 1250 sax 50::	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out. 6'.	wellbore diagram of ass C. Circ 355 sx.	WOC 21 sx.
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RII- 12+ hrs. Test 10/19/11 TD 10/21/11 RII- WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set 11/13/11 KO 12/10/11 TD 12/12/11 RII- 12/13/11 Rel Spud Date:	arting any propose osed completion of dwell 17-1/2" hole @ 12 H w/ 13-3/8", 48#, csg to 1200 psi fc 12-1/4" hole # 484 H w/ 9-5/8", 40#, st csg to 2800 psi ff 8-3/4" hole @ 11 plugs to abandon P @ 9129'. Mill 6 8-3/4" hole @ 13'H w/ 5-1/2", 17#, Fease rig.	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' – out hole from 9211 942' P110, LTC csg & sei	LE 19.15.7.14 et @ 1230'. 0 t @ 4840'. C DCD to aband 190 sx; 10,00 -9226'. RIH et @ 13927'.  Rig Rele	4 NMAC  Cmt w/ I  mt w/ Le  on latera  00 – 190  w/ whip  Cmt w/  ase Date	C. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65 al. sx; @ 9350' -190 stock & set @ 9226 lead: 1250 sax 50:	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out. 6'. 50 Class H. Tail w	wellbore diagram of ass C. Circ 355 sx.	WOC 21 sx.
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RII- 12+ hrs. Test 10/19/11 TD 10/21/11 RII- WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set 11/13/11 KO 12/10/11 TD 12/12/11 RII- 12/13/11 Rel Spud Date:	arting any propose osed completion of dwell 17-1/2" hole @ 12 H w/ 13-3/8", 48#, csg to 1200 psi fc 12-1/4" hole # 484 H w/ 9-5/8", 40#, st csg to 2800 psi ff 8-3/4" hole @ 11 plugs to abandon P @ 9129'. Mill 6 8-3/4" hole @ 13'H w/ 5-1/2", 17#, Fease rig.	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' – out hole from 9211	LE 19.15.7.14 et @ 1230'. 0 t @ 4840'. C DCD to aband 190 sx; 10,00 -9226'. RIH et @ 13927'.  Rig Rele	Cmt w/ Imt w/ Loon latera 00 - 190 w/ whip Cmt w/ ase Date	C. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65 al. sx; @ 9350' -190 stock & set @ 9220 lead: 1250 sax 50::	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out. 6'. 50 Class H. Tail w	wellbore diagram of ass C. Circ 355 sx.	WOC 21 sx.
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RII- 12+ hrs. Test 10/19/11 TD 10/21/11 RII- WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set 11/13/11 KO 12/10/11 TD 12/12/11 RII- 12/13/11 Rel Spud Date:	arting any propose osed completion of dwell 17-1/2" hole @ 12 H w/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 482 H w/ 9-5/8", 40#, st csg to 2800 psi f 8-3/4" hole @ 11 plugs to abandon P @ 9129'. Mill 68-3/4" hole @ 13 H w/ 5-1/2", 17#, Fease rig.	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' – out hole from 9211 942' P110, LTC csg & sei	LE 19.15.7.14 et @ 1230'. 0 t @ 4840'. C DCD to aband 190 sx; 10,00 -9226'. RIH et @ 13927'.  Rig Rele	Cmt w/ Imt w/ Loon latera 00 - 190 w/ whip Cmt w/ ase Date	C. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65 al. sx; @ 9350' -190 stock & set @ 9226 lead: 1250 sax 50:	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out. 6'. 50 Class H. Tail w	wellbore diagram of ass C. Circ 355 sx.	WOC 21 sx.
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIF 12+ hrs. Test 10/19/11 TD 10/21/11 RIF WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set 11/13/11 KO 12/10/11 TD 12/12/11 RIF 12/13/11 Rel Spud Date:	arting any propose osed completion of dwell 17-1/2" hole @ 12 Hw/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 484 Hw/ 9-5/8", 40#, fs. t csg to 2800 psi fo 8-3/4" hole @ 11 plugs to abandon P @ 9129'. Mill & 8-3/4" hole @ 13 Hw/ 5-1/2", 17#, Fease rig.	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' – out hole from 9211 942' P110, LTC csg & sei ation above is true a	et @ 1230'. 6  t @ 4840'. C  CCD to aband 190 sx; 10,06 -9226'. RIH  et @ 13927'.  Rig Rele  and complete  TITLE	Cmt w/ I mt w/ Le on latera 00 – 190 w/ whip Cmt w/ ase Date	2. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65 al. sx; @ 9350' -190 stock & set @ 9220 lead: 1250 sax 50::	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out. 5'. 50 Class H. Tail w e and belief	wellbore diagram of ass C. Circ 355 sx.  90 sx Class C. Circ 3  9/ 900 sx 50:50 Class	WOC 21 sx.
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIH- 12+ hrs. Test 10/19/11 TD 10/21/11 RIH- WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set 11/13/11 KO 12/10/11 TD 12/12/11 RIH- 12/13/11 Rel Spud Date:	arting any propose osed completion of dwell 17-1/2" hole @ 12 l w/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 484 l w/ 9-5/8", 40#, st csg to 2800 psi f 8-3/4" hole @ 11 plugs to abandon P @ 9129'. Mill 8-3/4" hole @ 13 l w/ 5-1/2", 17#, Fease rig.  10/9/11  fy that the information of the inf	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' – out hole from 9211 942' P110, LTC csg & sei	et @ 1230'. o  t @ 4840'. C  CCD to aband 190 sx; 10,00 -9226'. RIH  et @ 13927'.  Rig Rele	Cmt w/ I  mt w/ Le  on latera  00 – 190  w/ whip  Cmt w/  ase Date  to the be  Reg  ress:	C. For Multiple Condense Lead: 800 sx Class lead: 1450 sx 35:65 ll. sx; @ 9350° -190 stock & set @ 9220 lead: 1250 sax 50::  12/13/11  est of my knowledgulatory  tstathem@cima	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out. 5'. 50 Class H. Tail w e and belief	wellbore diagram of ass C. Circ 355 sx.  10 sx Class C. Circ 3  17/ 900 sx 50:50 Class  2/17/12  1E:432-620-1936	WOC 21 sx.
of sta prop 10/09/11 Spu 10/14/11 TD 10/15/11 RIF 12+ hrs. Test 10/19/11 TD 10/21/11 RIF WOC 24+ hrs 10/23/11 Tes 11/11/11 TD 11/12/11 Set 11/13/11 KO 12/10/11 TD 12/12/11 RIF 12/13/11 Rel Spud Date: Type or print	arting any propose osed completion of dwell 17-1/2" hole @ 12 H w/ 13-3/8", 48#, csg to 1200 psi fo 12-1/4" hole # 484 H w/ 9-5/8", 40#, st csg to 2800 psi ff 8-3/4" hole @ 11 plugs to abandon P @ 9129'. Mill 8-3/4" hole @ 13 H w/ 5-1/2", 17#, Fease rig.  10/9/11  fy that the information of the in	ed work). SEE RU or recompletion.  230'. H40, STC csg & s or 30 mins. Ok. 40'. J55, LTC csg & sei for 30 mins – ok. 342'. Contacted C lateral @ 10700' – out hole from 9211 942' P110, LTC csg & sei ation above is true a	et @ 1230'. 6  t @ 4840'. C  CCD to aband 190 sx; 10,06 -9226'. RIH  et @ 13927'.  Rig Rele  and complete  TITLE	Cmt w/ Imt w/ Loon latera 00 - 190 w/ whip Cmt w/ ase Date to the box E Reg	2. For Multiple Con Lead: 800 sx Class ead: 1450 sx 35:65 al. sx; @ 9350' -190 stock & set @ 9220 lead: 1250 sax 50::	mpletions: Attach C; Tail: 250 sx Cla POZ C; Tail w/ 20 sx. Circ out. 6'. 50 Class H. Tail w e and belief. DATE	wellbore diagram of ass C. Circ 355 sx.  90 sx Class C. Circ 3  9/ 900 sx 50:50 Class	WOC 21 sx.

## Triste Draw 36 State #1H C103 – Drill & Completion Sundry Cimarex Energy Co. 30025-40184

## **Completion:**

12/27/11 MIRU & run CBL - TOC @ 4414'.

01/02/12 to

01/04/12 Perf @ 9500-13896', 6 spf, 480 holes. Frac w/ 2,928,445 gals total fluid; 3,820,391# sd. 01/07/12 MIRU and DO CBP. Wash to PBTD @ 13932'.

01/11/12 RIH w/ Versa Set II pkr & set @ 9200'.

01/13/12 RIH w/ prod equip. 2-7/8", 6.5#, L80 tbg & set @ 9200'. Turn well to prod. Gas lift valves @ 2013', 3485', 4467', 5352', 6075', 6731', 7389', 7981', 8603', 9159'