	Form C-103
Office District I HORRE Energy, Minerals and Natural Resources	May 27, 2004
Office District I  1625 N. French Dr., Hobbs, NM 88240  District II  CONSERVATION DIVISION	WELL API NO.
District II  1301 W. Grand Ave., Artesia, NM 8 1440  District III  1000 Rio Brazos Rd., Aztec, NM 87410  12012  OIL CONSERVATION DIVISION  1220 South St. Francis Dr.	5. Indicate Type of Lease
District III 1200 South St. Francis Dr.	STATE STEE STATE
1000 Rio Brazos Rd., Aztec, NM 87410 District IV  Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, Ning Carlon	o. State on & Gas Estate No.
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name:
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	Caprock Maljamar Unit
PROPOSALS.)	
1. Type of Well: Oil Well 🛛 Gas Well 🔲 Other	8. Well No. <b>191</b>
2. Name of Operator	9. OGRID Number
Linn Operating, Inc.	269324
3. Address of Operator	10. Pool name or Wildcat
600 Travis, Ste. 5100, Houston, TX 77002  4. Well Location	Maljamar, Grayburg-San Andres
4. Well Location Unit Letter <b>G</b> : <b>2474</b> feet from the <b>N</b> line and	2472 feet from the E line
Section 19 Township 17-S Range 33-E	NMPM County Lea
11. Elevation (Show whether DR, RKB, RT, GR, e	
4100	
Pit or Below-grade Tank Application or Closure	
Pit type Depth to Groundwater Distance from nearest fresh water well	
Pit Liner Thickness: mil Below-Grade Tank: Volume	bbls; Construction Material
12. Check Appropriate Box to Indicate Nature of Notic	e, Report or Other Data
NOTICE OF INTENTION TO:	JBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK   PLUG AND ABANDON   REMEDIAL WO	
	RILLING OPNS.  P AND A
PULL OR ALTER CASING MULTIPLE CASING/CEME	
COMPLETION	_
_	_
OTHER: OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and	
starting any proposed work). SEE RULE 1103. For Multiple Completions: Attack	wellbore diagram of proposed completion or
recompletion.	
02/02/12 MIRU plugging equipment.	
02/03/12 POH w/ rods & pump. NU BOP, POH w/ tbg.	. 1.4 .11 .1. / . 11 .1. 61 .1. 6 .44 .1.25
02/03/12 POH w/ rods & pump. NU BOP, POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci	
02/03/12 POH w/ rods & pump. NU BOP, POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2	118'. Pulled out of cement.
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH	118'. Pulled out of cement. I. Perf'd casing @ 1364'. RIH w/ packer and
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug @	118'. Pulled out of cement. [. Perf'd casing @ 1364'. RIH w/ packer and [] 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug @ and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet	118'. Pulled out of cement. [. Perf'd casing @ 1364'. RIH w/ packer and [] 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug @ and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packer with 15 sx cement to surface. WOC.	118'. Pulled out of cement.  I. Perf'd casing @ 1364'. RIH w/ packer and  I. 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH  I. r and 1 jt. out of hole. Filled 5 1/2 surface
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug @ and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet	118'. Pulled out of cement.  1. Perf'd casing @ 1364'. RIH w/ packer and  2 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH  1 and 1 jt. out of hole. Filled 5 1/2 surface  wn and cleaned location.
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POF set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.	118'. Pulled out of cement.  1. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface wn and cleaned location.  on ground level Dry Hole Marker. Back filled
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.	118'. Pulled out of cement.  1. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface wn and cleaned location.  on ground level Dry Hole Marker. Back filled
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.	118'. Pulled out of cement.  1. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface wn and cleaned location.  on ground level Dry Hole Marker. Back filled
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.	118'. Pulled out of cement.  1. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface wn and cleaned location.  on ground level Dry Hole Marker. Back filled in gof well bore only.
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.	118'. Pulled out of cement.  1. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface wn and cleaned location.  on ground level Dry Hole Marker. Back filled in retained pending receipt in the Report of Well Plugging) of the OCD Web Page under
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for plug Liability under hon of C-103 (Subseque which may be fount Forms, www.emard.	118'. Pulled out of cement.  1. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface wn and cleaned location.  on ground level Dry Hole Marker. Back filled ing of well bore only.  d is retained pending receipt int Report of Well Plugging) at OCD Web Page under state.nm.us/ocd.
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for plug Liability under hon of C-103 (Subseque which may be fount Forms, www.emnrd.	118'. Pulled out of cement.  1. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface wn and cleaned location.  on ground level Dry Hole Marker. Back filled in retained pending receipt int Report of Well Plugging) at OCD Web Page under state.nm.us/ocd.  belief. I further certify that any pit or below-grade tank
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug @ and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packe with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for plug Liability under hon of C-103 (Subseque which may be found Forms, www.emard.	Al8'. Pulled out of cement.  L. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface wn and cleaned location.  on ground level Dry Hole Marker. Back filled ing of well bore only.  d is retained pending receipt int Report of Well Plugging) at OCD Web Page under state.nm.us/ocd.  belief. I further certify that any pit or below-grade tank or an (attached) alternative OCD-approved plan
02/03/12 POH w/ rods & pump. NU BOP. POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug @ and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packe with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for plug Liability under hon of C-103 (Subseque which may be found Forms, www.emard.	Al8'. Pulled out of cement.  L. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface wn and cleaned location.  on ground level Dry Hole Marker. Back filled ing of well bore only.  d is retained pending receipt int Report of Well Plugging) at OCD Web Page under state.nm.us/ocd.  belief. I further certify that any pit or below-grade tank or an (attached) alternative OCD-approved plan
02/03/12 POH w/ rods & pump. NU BOP, POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packer with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for pluss Liability under hour Whitch may be fount Rethin, www.emmrd.  I hereby certify that the information above is true and complete to the best of my knowledge and has been/will be constructed or closed according to NMOCD guidelines, a general permit  SIGNATURE	Al8'. Pulled out of cement.  I. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface  we and cleaned location. on ground level Dry Hole Marker. Back filled  ling of well bore only.  d is retained pending receipt int Report of Well Plugging)  at OCD Web Page under  State.nm.us/ocd.  belief. I further certify that any pit or below-grade tank or an (attached) alternative OCD-approved plan .  Specult III DATE 2/28/2002
02/03/12 POH w/ rods & pump. NU BOP, POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packer with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for pluss Liability under hour Whitch may be fount Rethin, www.emmrd.  I hereby certify that the information above is true and complete to the best of my knowledge and has been/will be constructed or closed according to NMOCD guidelines, a general permit  SIGNATURE	Al8'. Pulled out of cement.  I. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface  we and cleaned location. on ground level Dry Hole Marker. Back filled  ling of well bore only.  d is retained pending receipt int Report of Well Plugging)  at OCD Web Page under  State.nm.us/ocd.  belief. I further certify that any pit or below-grade tank or an (attached) alternative OCD-approved plan .  Specult III DATE 2/28/2002
02/03/12 POH w/ rods & pump. NU BOP, POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packer with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for pluss Liability under hour Whitch may be fount Rethin, www.emmrd.  I hereby certify that the information above is true and complete to the best of my knowledge and has been/will be constructed or closed according to NMOCD guidelines, a general permit  SIGNATURE	Al8'. Pulled out of cement.  L. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface wn and cleaned location.  on ground level Dry Hole Marker. Back filled ing of well bore only.  d is retained pending receipt int Report of Well Plugging) at OCD Web Page under state.nm.us/ocd.  belief. I further certify that any pit or below-grade tank or an (attached) alternative OCD-approved plan
02/03/12 POH w/ rods & pump. NU BOP, POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Ci sx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 2 02/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for rlug, Liability under hon of C:103 (Subseque) Www.emnrd.  Approved for rlug, Liability under hon of C:103 (Subseque) Signature  For State Use Only  Type or print name  E-mail address: +COLANC  E-mail address: +COLANC	Al8'. Pulled out of cement.  I. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface  wn and cleaned location. on ground level Dry Hole Marker. Back filled  Ing of well bore only.  d is retained pending receipt int Report of Well Plugging) at OCD Web Page under state.nm.us/oed.  Delief. I further certify that any pit or below-grade tank or an (attached) alternative OCD-approved plan .  DATE 2/28/2012  Climary Telephone No. 28/840 4272
02/03/12 POH w/ rods & pump. NU BOP, POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Cisx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 202/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for plus, Liability under how of C-103 (Subsequive which may be found be acknown as been/will be constructed or closed according to NMOCD guidelines, a general permit  Title Scalland  Title Scalland  APPROVED BY  TITLE Title Scalland  TITLE Scalland  TITLE Scalland  TITLE Scalland  TITLE Scalland  TITLE Scalland	Al8'. Pulled out of cement.  I. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface  wn and cleaned location. on ground level Dry Hole Marker. Back filled  Ing of well bore only.  d is retained pending receipt int Report of Well Plugging) at OCD Web Page under state.nm.us/oed.  Delief. I further certify that any pit or below-grade tank or an (attached) alternative OCD-approved plan .  DATE 2/28/2012  Climary Telephone No. 28/840 4272
02/03/12 POH w/ rods & pump. NU BOP, POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Cisx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 202/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug @ and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for plus, Liability under how of C:103 (\$ubseque with may be found be remained by the constructed or closed according to NMOCD guidelines, a general permit  Title	18'. Pulled out of cement.  1. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface  wn and cleaned location. on ground level Dry Hole Marker. Back filled  ing of well bore only.  d is retained pending receipt nt Report of Well Plugging) at OCD Web Page under  state.nm.us/ocd.  DATE 428/2012  Clivery Telephone No. 28/840 4272  DATE 5-1-2012
02/03/12 POH w/ rods & pump. NU BOP, POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Cisx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 202/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug @ and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for plus, Liability under how of C:103 (\$ubseque with may be found be remained by the constructed or closed according to NMOCD guidelines, a general permit  Title	Al8'. Pulled out of cement.  I. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface  wn and cleaned location. on ground level Dry Hole Marker. Back filled  Ing of well bore only.  d is retained pending receipt int Report of Well Plugging) at OCD Web Page under state.nm.us/oed.  Delief. I further certify that any pit or below-grade tank or an (attached) alternative OCD-approved plan .  DATE 2/28/2012  Climary Telephone No. 28/840 4272
02/03/12 POH w/ rods & pump. NU BOP, POH w/ tbg. 02/06/12 RIH w/ bit and scraper to 3970'. POH. RIH w/ CIBP and set @ 3970'. Cisx cementon top of CIBP @ 3970'-3624'. POH to 2418'. Spotted 25 sx cement @ 202/07/12 Tagged plug @ 2170'. POH to 1364'. WOC. Tagged plug @ 1187'. POH set @ 1000'. Got pump in rate of 500 psi. Sqz'd 35 sx cement. WOC. Tagged plug @ and set packer @ 30'. Sqz'd 160 sx cement and circulated to surface. Pulled packet with 15 sx cement to surface. WOC. 02/08/12 Tagged plug @ 90'. Pumped 10 sx cement to surface in & out. Rigged do 02/13/12 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded cellar. Buried anchors. Cleaned location and moved off.  Approved for plus, Liability under how of C:103 (\$ubseque with may be found be remained by the constructed or closed according to NMOCD guidelines, a general permit  Title	18'. Pulled out of cement.  1. Perf'd casing @ 1364'. RIH w/ packer and @ 1187'. POH w/ tbg. Perf'd csg @ 550'. RIH r and 1 jt. out of hole. Filled 5 1/2 surface  wn and cleaned location. on ground level Dry Hole Marker. Back filled  ing of well bore only.  d is retained pending receipt nt Report of Well Plugging) at OCD Web Page under  state.nm.us/ocd.  pelief. I further certify that any pit or below-grade tank or an (attached) alternative OCD-approved plan   Charactery. Telephone No. 28/840 4272  DATE 3-1-20/2