Submit 3 Copies To Appropriate District Office State of New Mexico	Form C-103
<u>District I</u> Energy, Minerals and Natural Resources	March 4, 2004 WELL API NO.
1625 N. French Dr., Hobbs, NM 88240 District II	30-025-34778
1301 W. Grand Ave., Artesia, NM 88210 OIL CONSERVATION DIVISION	5. Indicate Type of Lease
District III 1220 South St. Francis Dr. 1000 Rio Brazos Rd., Aztec, NM 87410	STATE FEE
District IV 1220 S. St. Francis Dr., Santa Fe, NM	6. State Oil & Gas Lease No.
87505	
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	Monument 11 State
PROPOSALS.)	8. Well Number
1. Type of Well:	
Oil Well Gas Well Other	30
2. Name of Operator Chevron USA Inc	9. OGRID Number
3. Address of Operator	10. Pool name or Wildcat
15 Smith Rd, Midland, TX 79705	Monument, ABO, North
4. Well Location	
Unit Letter P . 754 feet from the South line and 330 feet from the East line	
Unit Letter P: 754 feet from the South line and 33	feet from the East line
Section 11 Township 19-S Range 36-E	NMPM Lea County
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	
6.5031	
Pit or Below-grade Tank Application (For pit or below-grade tank closures, a form C-144 must be attached)	
Pit Location: UL P Sect 11 Twp 19S Rug 36E Pit type Steel Depth to Groundwater 55 Distance from nearest fresh water well Over 1000'	
Distance from nearest surface water Below-grade Tank Location UL Sect Twp Rng /5;	
754 feet from the South line and 330 feet from the East line (Steel Tank)	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐ REMEDIAL WOR	
TEMPORARIES EL COMPONICIONES EL COMPONIC	
TEMPORARILY ABANDON	RILLING OPNS.□ PLUG AND ☑ ABANDONMENT
PULL OR ALTER CASING MULTIPLE CASING TEST A	
COMPLETION CEMENT JOB	_
OTHER: OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion	
or recompletion.	
I. Notify OCD 24 Hrs Prior to MI & RU. 8. Perf @ 1400' Sqz 60sx plug 1400-1200 (T-Salt) WOC Tag @ 1190.	
2. Set 5 1/2 CIBP @ 7075 Spot 25sx Plug 7075-6950 (Lateral, ABO) WOC Tag @ 6942 B. Displace Hole W/MLF, 9.5 # Brine w/12.5 # Gel P/BBL. 9. Perf @ 500 - Sqz 60sx plug 500-Surf (11 3/4 Shoe) WOC Tag Surf. 10. Install Dry Hole Marker 4-18-05.	
l. Spot 25sx plug 4400-4200 (S. Andres). 5. Spot 25sx plug 2900-2700 (8 5/8 Shoe) WOC Tag.	
6. Cut 5 1/2 CSG @ 2500, Unable to pull, Unable to EPIR.	
7. Spot 25sx plug 2550-2400 (Stub) WOC Tag - 2425'.	
I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-	
grade tank has been/will be constructed or closed according to NMOCD guidelines [], a general permit [or an (attached) alternative OCD-approved plan .
SIGNATURE TITLE Consulta	nt DATE 4/19/05
Type or print name Jimmy Bagley E-mail address:	Telephone No. 432-561-8600
(This space for State use)	
(This space for State use)	Welleam
	ns, District Supermissor 4/21/08

Approved as to plugging of the Well Bore. Liability under bond is retained until surface restoration is completed.