

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

New Mexico Oil Conservation Division, District 1  
1625 N. French Drive  
Hobbs, NM 88240

FORM APPROVED  
OMB No. 1004-0137  
Expires: July 31, 2010

**SUNDRY NOTICES AND REPORTS ON WELLS**  
**Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.**

5. Lease Serial No.  
NMNM0267786

6. If Indian, Allottee or Tribe Name

**SUBMIT IN TRIPLICATE – Other instructions on page 2.**

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator  
Ridgeway Arizona Oil Corporation

3a. Address  
200 N. Loraine, STE 1440  
Midland, TX 79701

3b. Phone No. (include area code)  
432-687-0303

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)  
1980 FNL & 1980 FEL  
Sec 25, T - 08S, R - 32E, NMP

7. If Unit of CA/Agreement, Name and/or No.

8. Well Name and No.  
Garretson #2

9. API Well No.  
#2 30-005-10091

10. Field and Pool or Exploratory Area  
Tobac, Upper Penn

11. Country or Parish, State  
Chaves Co, NM

**12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA**

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13 Describe Proposed or Completed Operation. Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleation in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

Ridgeway Arizona Oil Corp. requests approval to plug and abandon this well according to the attached proposed procedure and wellbore diagram.

Ridgeway will contact BLM 24 hours prior to the beginning of plugging operations.

HOBBS OCD

MAY 21 2012

APPROVED FOR 3 MONTH PERIOD  
ENDING AUG 14 2012

RECEIVED  
SEE ATTACHED FOR  
CONDITIONS OF APPROVAL

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)

Jana True

Title Mgr - Prorations/Regulatory

Signature

Date 02/29/2012

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved by

/S/ DAVID R. GLASS

PETROLEUM ENGINEER

Date

MAY 14 2012

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title  
Office

ROSWELL FIELD OFFICE

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

MAY 22 2012




**Ridgeway**

**Arizona Oil Corporation**

St. Johns Helium/CO<sub>2</sub> Project

Plugging Procedure  
Garretson #2  
API No. – 30-005-10091

1. Prepare location and test anchors
2. MIRU plugging rig
3. Notify OCD/BLM 24 hours prior to commencement of P & A procedure.
4. NDWH/NU BOP
5. RIH w-4 ½ CIBP on 2 3/8 WS @ 8925' (+/-) – within 100' of top perf – 9004'
  - a. Spot 35' of cement on CIBP
  - b. WOC – bump plug @ 8890' (+/-)
6. Load well with a minimum of 9 lb. mud and conduct MIT to 500 psi., test for leak off.
  - a. / Bleed pressure off after MIT.
7. TIH to 8865' and spot 25 SX cement plug
  - a. Wait on cement and tag
8. MIRU WL and RIH w/perf gun to 7865'
  - a. perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
9. TIH w/WS – Squeeze 40 SX cement plug @ 7865' to 7765' (+/-)
  - a. Wait on cement
  - b. Tag plug @ 7765' or above.
10. MIRU WL and RIH w/perf gun to 6765'
  - a. perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
11. TIH w/WS – Squeeze 40 SX cement plug @ 6765' to 6665'
  - a. Wait on cement
  - b. Tag plug @ 6665' or above
12. MIRU WL and RIH w/perf gun to 5765'
  - a. perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
13. TIH w/WS – Squeeze 40 SX cement plug @ 5765' to 5665'
  - a. Wait on cement
  - b. Tag plug @ 5665' or above
14. MIRU WL and RIH w/perf gun to 4265'
  - a. perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
15. TIH w/WS – Squeeze 60 SX cement plug @ 4265' to 4115'
  - a. Wait on cement
  - b. Tag plug @ 4115' or above
16. MIRU WL and RIH w/perf gun to 2615'
  - a. perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
17. TIH w/WS – Squeeze 60 SX cement plug @ 2615' to 2465'
  - a. Wait on cement
  - b. Tag plug @ 2465' or above
18. MIRU WL and RIH w/perf gun to 1615'
  - a. perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL

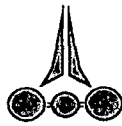

**Ridgeway**

**Arizona Oil Corporation**

St. Johns Helium/CO<sub>2</sub> Project

19. TIH w/WS – Squeeze 60 SX cement plug @ 1615' to 1465'
  - a. Wait on cement
  - b. Tag plug @ 1465' or above
20. MIRU WL and RIH w/perf gun to 530'
  - a. perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
21. TIH w/WS – Squeeze 60 SX cement plug @ 530' to 380'
  - a. Wait on cement
  - b. Tag plug @ 380' or above
22. MIRU WL and RIH w/perf gun to 80'
  - a. perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
  - d. TIH w/WS – Squeeze 40 SX (+/-) cement plug @ 80'
  - e. Circulate cement to have solid plug from 80' to surface
23. RDMO Plugging Rig
  - a. Install P & A marker plate
  - b. Cut off dead men
  - c. Remediate Location

Description	O.D.	Grade	Weight	Depth	Cmt Sx	TOC
Surface Csg	10 3/4	H40	32 3/4	392	300	Surface
Inter Csg	7 5/8	H-40	24-26	3650	500	Unknown
Prod Csg	4 1/2	N80-J55	11 3/5	9160	400	Unknown
Liner O.D.	0	0	0	0	0	0

[illegible]

CIBP @ 9048'

CIBP @ 9048'

**BUREAU OF LAND MANAGEMENT**  
**Roswell Field Office**  
**2909 West Second Street**  
**Roswell, New Mexico 88201**  
**(575) 627-0272**

**Permanent Abandonment of Federal Wells**  
**Conditions of Approval**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety (90)** days from the approval date of this Notice of Intent to Abandon. **If you are unable to plug the well by the 90<sup>th</sup> day provide the BLM Roswell Field Office (RFO), prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.**

2. Notification: Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

3. Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.

4. Mud Requirement: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

6. Monument: Upon abandonment of the well, all casing shall be cut-off at the base of the cellar or 3-feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. Timing Limitation Lease Stipulation / Condition of Approval For Lesser Prairie-Chicken: Oil and gas activities including 3-D geophysical exploration, and drilling will not be allowed in lesser prairie-chicken habitat during the period from March 1 through June 15 annually. During that period, other activities that produce noise or involve human activity, such as the maintenance of oil and gas facilities, geophysical exploration other than 3-D seismic operations, and pipeline, road, and well pad construction, will be allowed except between 3:00 am and 9:00 am. The 3:00 am to 9:00 am restriction will not apply to normal, around-the-clock operations, such as venting, flaring, or pumping, which do not require a human presence during this period. Additionally, no new drilling will be allowed within up to 200 meters of leks known at the time of permitting. Normal vehicle use on existing roads will not be restricted. Exhaust noise from pump jack engines must be muffled or otherwise controlled so as not to exceed 75 db measured at 30 feet from the source of the noise.

8. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.