

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
2005 APR 27 PM 2 46

FORM APPROVED
OMB No. 1004-0135
Expires November 30, 2000

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.
NMNM04206

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.
San Juan 32-7Unit #39A

9. API Well No.
30-045-28967

10. Field and Pool, or Exploratory Area
Blanco Mesaverde

11. County or Parish, State
San Juan
NM

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well
☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
ConocoPhillips Co.

3a. Address
P.O. Box 2197, WL3-6081 Houston Tx 77252

3b. Phone No. (include area code)
(832)486-2463

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
Sec. 23 T32N R7W 790FNL 1450FWL

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/ Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other <u>Clean Out & Chg</u>
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	<u>in Tubing Depth</u>
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

Tubing change with end of 2.375" tubing now @ 6097'. Daily Summary is attached.



ACCEPTED FOR RECORD

MAY 10 2005

FARMINGTON FIELD OFFICE
BY [Signature]

14. I hereby certify that the foregoing is true and correct:

Name (Printed/Typed)

Christina Gustartis

Signature

[Signature]

Title

As Agent for ConocoPhillips Co

Date

04/26/2005

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on reverse)

NMOC



Regulatory Summary

SAN JUAN 32 7 UNIT #039A

Clean-out, 03/14/2005 00:00

API/UWI	County	State/Province	Surface Legal Location	N/S Dist (ft)	N/S Ref	E/W Dist (ft)	E/W Ref
300452896700	San Juan	NEW MEXICO	NMPM-32N-07W-23-C	790.0	N	1,450.1	W
Ground Elevation (ft)	Latitude (DMS)	Longitude (DMS)	Spud Date	Rig Release Date			
6,813.00	36° 58' 14.3148" N	107° 32' 23.2512" W	07/20/1993	03/08/1993			

03/14/2005 00:00 - 03/14/2005 00:00

Last 24hr Summary

MOVE RIG AND EQUIPMENT TO LOCATION

03/15/2005 00:00 - 03/15/2005 00:00

Last 24hr Summary

SAFETY MEETING AND WRITE JSA. RIG UP EXPERT DOWN HOLE AND RUN IN WELL WITH 1.75 IMPRESSION BLOCK. TAGGED SAND @ 6368'; FLUID LEVEL @ 5500'. RUN IN WITH "CW" PLUG AND SET @ 6398' (WLM). SET COLLAR STOP @ 6389' AND RIG DOWN WIRELINE UNIT. REPAIR RIG. RIG UP RIG AND EQUIPMENT. SET 2 WAY CHECK IN TBG HANGER AND REMOVE WELLHEAD. NIPPLE UP BOP AND PRESSURE TEST BLIND RAMS TO 250 PSI FOR 10 MIN AND 2000 PSI FOR 10 MIN. TEST TBG RAMS TO 250 PSI FOR 10 MIN AND 2000 PSI FOR 10 MIN. GOOD TEST. SECURE WELL AND LOC AND SDFN.

03/16/2005 07:00 - 03/16/2005 19:30

Last 24hr Summary

HOLD SAFETY MEETING AND WRITE JSA. CHECK LOTO AND PRESSURE. WORK ON RIG PUMP (RIG REPAIR). ATTEMPT TO UNSEAT TBG HANGER. TBGD STUCK. COULD NOT PULL FREE. RIG UP WIRELINE SPECIALTIES TO RUN FREEPOINT AND CUT OFF. FREEPOINT SHOWED 100% FREE @ 6210', 92% FREE @ 6218' AND 0% FREE @ 6232'. WAIT ON EXPERT DOWN HOLE TO PULL PLUG IN TBG. UNABLE TO LATCH ONTO PLUG. RUN IN WITH CHEMICAL CUTTER AND CUT TBG @ 6206' (WIRELINE MEASUREMENT). RIG DOWN WIRELINE UNIT, SECURE WELL AND LOC AND SDFN.

03/17/2005 07:00 - 03/17/2005 18:30

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. BLOW WELL DOWN TO FLOW BACK TANK. UNSEAT AND LAY DOWN TBG HANGER AND STRAP OUT OF HOLE. STRAPPED OUT 197 JTS (6175.0'); CUT OFF (12.30'). TOTAL TBG 6187.30'. STRAP AND PICK UP FISHING TOOLS AND TIH TO TOP OF FISH @ 6204'. LATCH ONTO FISH WITH OVERSHOT AND JAR. MOVED FISH DOWN HOLE 10' AND UP HOLE 5' ABOVE ORIGINAL POSITION. DID NOT HAVE ANY FREE TRAVEL. PICK UP POWER SWIVEL, GET OFF FISH AND PULL 5 STDS. SECURE WELL AND LOC AND SDFN

03/18/2005 07:30 - 03/18/2005 17:30

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. BLOW WELL DOWN TO FLOW BACK TANK. TIH TO TOP OF FISH AND PUMP 10 BBLS OF 2% KCL. LATCH ONTO FISH AND JAR. UNABLE TO GET FISH TO GO DOWN. WORK FISH UP APPROX 6". UNABLE TO CIRC AIR. GRAPPLE SLIPPED OFF FISH; UNABLE TO LATCH ONTO FISH. LAY DOWN POWER SWIVEL AND TOH. LAY DOWN JARS, BUMPER SUB AND ACCELERATOR. PICK UP WASH PIPE, JARS AND DCS. TIH WITH 50 STDS OF TBG. SECURE WELL AND SDFWE.

03/19/2005 00:00 - 03/19/2005 00:00

Last 24hr Summary

SDFWE

03/20/2005 00:00 - 03/20/2005 00:00

Last 24hr Summary

SDFWE

03/21/2005 07:30 - <End Date?>

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. SERVICE RIG AND BLOW WELL DOWN TO FLOW BACK TANK. TIH TO 6180'; TOP OF FISH @ 6194'. DRUM CLUTCH ON RIG NOT WORKING PROPERLY. OPERATOR COULD NOT REPAIR CLUTCH. TOH TO TOP OF 4-1/2" LINER. WAIT ON MECHANIC AND REPAIR CLUTCH. SECURE WELL AND SDFN.

03/22/2005 07:30 - 03/22/2005 16:30

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. SICP - 280 PSI; SITP -150 PSI. BLOW WELL DOWN TO FLOW BACK TANK AND SERVICE RIG. TIH WITH TBG. DRUM CLUTCH ON DRAW WORKS NOT OPERATING PROPERLY. OPERATOR CALLED TP. TP CHECKED CLUTCH AND CALLED FOR MECHANIC. WAIT ON MECHANIC AND REPAIR CLUTCH. TIH 15 STDS AND PULL 15 STDS TO CHECK OPERATION OF CLUTCH. SEEMS TO BE WORKING PROPERLY. SECURE WELL AND LOC AND SDFN.

03/23/2005 07:00 - 03/23/2005 18:00

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. SICP - 300 PSI; SITP 100 PSI. BLOW WELL DOWN TO FLOW BACK TANK. TIH TO 6142'. TAGGED @ 6142'. PICK UP POWER SWIVEL. EST CIRC AND MIST @ 10BPH. WASH BRIDGES TO TOP OF FISH @ 6204'. WASH OVER FISH FROM 6204' TO 6280'. REPAIR FLOW LINE. MIX 4 BBL SWEEP AND BLOW WELL CLEAN. SET BACK POWER SWIVEL AND TOH TO TOP OF LINER. SECURE WELL AND LOC AND SDFN

03/24/2005 07:00 - 03/24/2005 19:30

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. REPAIR FLOW LINE. BLOW WELL DOWN TO FLOW BACK TANK. TIH TO 6240'; TAG FILL. ESTABLISH CIRC AND MIST RATE AND CLEAN OUT FROM 6240' TO 6280'. WASH OVER FISH FROM 6280' TO 6379'. BLOW WELL CLEAN. WORK ON PUMP. PUMP 6 BBLS OF 2% KCL, SET SWIVEL BACK AND TOH. TO 4837'. SHUT DOWN BECAUSE OF DARKNESS.

03/25/2005 07:00 - 03/25/2005 12:00

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. REPAIR FLOWLINE. PICK UP SWIVEL AND DETERMINE THAT WASH PIPE AND TBG ARE FREE, LAY DOWN SWIVEL AND TOH TO TOP OF LINER. PULL 14 STDS. INSTALL NEW SUCTION LINE INSIDE OF RIG PIT. SECURE WELL AND SDFWE.

03/26/2005 00:00 - 03/26/2005 00:00

Last 24hr Summary

SDFWE

03/27/2005 00:00 - 03/27/2005 00:00

Last 24hr Summary

SDFWE

03/28/2005 07:30 - 03/28/2005 18:30

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK PRESSURE (SICP - 300 PSI; SITP - 210 PSI) AND LOTO. BLOW WELL DOWN TO FLOW BACK TANK AND INSTALL NEW SUCTION HOSE ON RIG PUMP. PUMP 6 BBLS OF 2% KCL DOWN TBG TO KILL WELL AND TIH TO 6336'. HAD 43' OF FILL. PICK UP POWER SWIVEL, UNLOAD WELL AND ESTABLISH MIST RATE. CLEAN FILL FROM 6336' TO 6379'. MIX 5 BBL SWEEP AND BLOW WELL CLEAN. SET SWIVEL BACK AND TOH. STAND BACK DC AND WASH PIPE. LAY DOWN JARS. SECURE WELL AND LOCATION AND SDFN.

03/29/2005 07:00 - 03/29/2005 16:00

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. SICP - 260 PSI. BLOW WELL DOWN TO FLOW BACK TANK. PICK UP OVERSHOT, BUMPER SUB, JARS, 6 DCS, AND ACCELERATOR AND TIH TO TOP OF FISH @ 6193'. LATCH ONTO FISH AND JAR ON FISH. JAR ON FISH 3-1/4 HRS AND MOVE IT UP THE HOLE 10'. WORK 2 JTS OUT AND LAY DOWN. TOH TO TOP OF LINER WITH FISH. SHUT DOWN BECAUSE OF WINDY CONDITIONS. SECURE WELL AND LOCATION AND SDFN.

03/30/2005 07:00 - 03/30/2005 15:00

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. BLOW WELL DOWN TO FLOW BACK TANK. TOH AND LAY DOWN DCS, FISHING TOOLS AND FISH. PUMP 10 BBLS OF 2% KCL TO KILL WELL AND RUN WASH PIPE IN WELL AND LAY DOWN WASH PIPE. PICK UP 3-7/8" BIT, BIT SUB, 2 DCS AND TIH 31 STDS. SECURE WELL AND SDFN BECAUSE OF HIGH WINDS.

03/31/2005 07:00 - 03/31/2005 19:00

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. SICP - 260 PSI. BLOW WELL DOWN TO FLOW BACK TANK AND TIH TO 6175.66'. PICK UP 5 JTS TBG AND TAG FILL @ 6309'. APPROX 70' OF FILL. PICK UP POWER SWIVEL, ESTABLISH CIRC AND MIST RATE @ 12 BPH WITH 2 GAL FOAMER PER 10 BBLS AND CLEAN OUT FILL FROM 6309' TO 6535'. BLOW WELL CLEAN AND TOH TO TOP OF LINER (4113'). SECURE WELL AND LOCATION AND SDFN.

04/01/2005 10:30 - 04/01/2005 17:30

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. SICP - 260 PSI. TIH AND TAG FILL @ 6509' (26' OF FILL). PICK UP POWER SWIVEL, ESTABLISH AIR/MIST RATE AND CLEAN OUT TO 6535'. BLOW WELL CLEAN, SET POWER SWIVEL BACK AND TOH 45 STDS. SECURE WELL AND LOCATION AND SDFWE.

04/02/2005 00:00 - 04/02/2005 00:00

Last 24hr Summary

SDFWE

04/03/2005 00:00 - 04/03/2005 00:00

Last 24hr Summary

SDFWE

04/04/2005 07:00 - 04/04/2005 20:00

Last 24hr Summary

HOLD SAFETY MEETING AND REVIEW JSA. CHECK LOTO AND PRESSURE. SICP - 300 PSI; SITP - 320 PSI. PUMP 6 BBLS OF 2% KCL DOWN TBG TO KILL WELL. TOH AND LAY DOWN 2 DRILL COLLARS. PICK UP EXPENDABLE CHECK, 1.78" PROFILE NIPPLE AND TIH. TAG FILL @ 6531.74' KB (APPROX 3.25' OF FILL). LAY DOWN 14 JTS TBG TO LAND TBG @ 6096.51' KB. TBG RAN AS FOLLOWS: EXPENDABLE CHECK (1.0'), 1.78" PROFILE NIPPLE (0.92'), 194 JTS (6082.67') 2-3/8", 4.7#, J-55, EU 8RD TBG. EOT @ 6096.59' KB. TOP OF PROFILE NIPPLE 6094.67' KB. RIG DOWN FLOOR, NIPPLE DOWN AND SET OUT BOP AND INSTALL TREE. PUMP 2 BBLS OF 2% KCL DOWN TBG AND PUMP BALL. RIG DOWN AND PREPARE TO MOVE TO SAN JUAN 32-7 # 203A.