Submit 3 Copies to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT I OIL CONSERVATIO	N DIVISION
P.O. Box 1980, Hobbs NM 88241-1980 2040 Pacheco	1 20 026 24640
DISTRICT II Santa Fe, NM P.O. Drawer DD, Artesia, NM 88210	5. Indicate Type of Lease STATE X FEE
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410	6. State Oil & Gas Lease No. A-2614
SUNDRY NOTICES AND REPORTS ON WE	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN DIFFERENT RESERVOIR. USE "APPLICATION FOR PER (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL GAS WELL OTHER	
2. Name of Operator	8. Well No.
BP America Production Company	22
3. Address of Operator P.O. Box 1089, Eunice, NM 88231	9. Pool name or Wildcat JALMAT TANSIL YATES SRQ
4. Well Location Unit Letter A: 990 Feet From The NORTH	Line and660 Feet From TheEASTLine
Section 26 Township 22S Ran	ge 36E NMPM LEA County
10. Elevation (Show whether	
Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK PLUG AND ABANDON	REMEDIAL WORK ALTERING CASING
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT X	
PULL OR ALTER CASING CASING TEST AND CEMENT JOB	
_	
OTHER:	OTHER: L
12. Describe Proposed or Completed Operations Clearly state all pertinent deta work) SEE RULE 1103.	ails, and give pertinent dates, including estimated date of starting any propose
work) SEE RULE 1103. TD: 3600' PBD: 3550' PERFS: 2938-3352' Liability under bond is retained until Surface restoration in a surface restoration	
03.27.03: MIRUPU. NUMH. NUBUP.	
03.28.03: PU tbg & tag CIBP @ 2900'. Spot 25 sxs cmt on top of CIBP. PU & Circ P. Standard Company of Cibp.	
03.31.03: RU wireline & perf @ 1250'. POH. RIH w/pkr & tbg. Set pkr @ 1650	
Squeeze 50 sxs cmt @ 1.5 BPM @ 1400# PSI. WC. Rls pkr & tag cmt @ 1700'.	
POH. RU wireline & perf @ 450'. POH. RIH w/pkr & tbg. Set pkr @ 250'. Squeeze 50 sxs cmt. WOC. Rls pkr & tag plug @ 326'. NDBOP. Flange up well	
w/ 2 jts. tbg.	
04.01.03: PU & pmp cmt from 60' to surf. Cut off wellhead and dead man marker. Place	
	rellhead and dead man marker. Place
dry hole marker. Clean location. Well F	rellhead and dead man marker. Place
dry hole marker. Clean location. Well F I hereby certify that the information above is true and complete to the best of my knowled	rellhead and dead man marker. Place 8A'd.
dry hole marker. Clean location. Well F I hereby certify that the information above is true and complete to the best of my knowled	rellhead and dead man marker. Place
dry hole marker. Clean location. Well F I hereby certify that the information above is true and complete to the best of my knowled	rellhead and dead man marker. Place 8A'd.
I hereby certify that the information above is true and complete to the best of my knowled SIGNATURE TYPE OR PRINT NAME Kellie D. Murrish	ge and belief. Sr. Administrative Assistant DATE 04.15.03 TELEPHONE NO. 505.394.1649
I hereby certify that the information above is true and complete to the best of my knowled SIGNATURE SIGNATURE TYPE OR PRINT NAME Kellie D. Murrish	ge and belief. Sr. Administrative Assistant DATE 04.15.03 TELEPHONE NO. 505.394.1649