

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 87210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO. 30-025-09340-00-00

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
B-1167

7. Lease Name or Unit Agreement Name:

STATE JJ

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
JOHN H. HENDRIX CORPORATION

8. Well No. 2

3. Address of Operator
P.O. BOX 3040; MIDLAND, TEXAS 79702-3040

9. Pool name or Wildcat
LANGLIE MATTIX

4. Well Location

Unit Letter J : 1980 feet from the SOUTH line and 1980 feet from the EAST line

Section 13 Township 23S Range 36E NMPM LEA County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3381' DF

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1.) RIG UP P & A EQUIPMENT; DIG AND LINE WORK PIT; NIPPLE UP BOP. 04/25/2003

2.) SET CIBP AT 3142'; AUTHORIZED BY GARY WINK. 04/26/2003

3.) PUMP 90 BBLS OF 9.5# MUD. 04/26/2003

4.) SET CIBP AT 3132'. 04/26/2003

5.) SPOT 30 SACKS OF CEMENT FROM 3100' TO 3000'. 04/30/2003 TAG AT 2917'. 05/01/2003

6.) PERFORATE AT 2870'; SPOT 25 SACKS OF CEMENT. 05/01/2003 TAG AT 2750'.

7.) PERFORATE AT 1300'; SQUEEZE 55 SACKS OF CEMENT; DISPLACE TOC TO 1200'; TAG AT 1200'. 05/02/2003

8.) PERFORATE AT 297'; SQUEEZE WITH 100 SACKS OF CEMENT; DISPLACE TOC TO 197'. 05/02/2003 TAG AT 145'.

9.) CUT OFF WELLHEAD; SPOT 10 SACK SURFACE PLUG.

10.) INSTALL P & A MARKER.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Howard Boatright TITLE AGENT DATE 05/08/2003

Type or print name HOWARD BOATRIGHT

(This space for State use)

OC FIELD REPRESENTATIVE II/STAFF MANAGER

Telephone No. (432) 570-5382

APPROVED BY Gary W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE MAY 09 2003

Conditions of approval, if any:

Approved as to plugging of the Well Bore
Liability under bond is retained until
surface restoration is completed