Submit 3 Copies To Appropriate District Office District I State of New Mexico Energy, Minerals and Natural Re	Form C-103 sources Revised March 25, 1999
District I Energy, Minerals and Natural Re 1625 N. French Dr., Hobbs, NM 88240 District II	WELL API NO. 30-025-26474
1301 W. Grand Avenue, Artesia, NM 88210 OIL CONSERVATION DIV	5 Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410	STATE L FEE L
District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BAC DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUC PROPOSALS.) 1. Type of Well: Oil Well Gas Well Other	7. Lease Name or Unit Agreement Name: R.E. Cole(Nct-A)
2. Name of Operator Chevron USA, Inc.	8. Well No.
3 Address of Operator	9. Pool name or Wildcat
15 Smith Rd. Midland, 1X 79705	Drinkard
4. Well Location	
Unit Letter B: 430 feet from the North line and 2310 feet from the East line	
Section 16 Township 22-S Range 37-E NMPM County Lea	
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	
11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REM	EDIAL WORK ALTERING CASING
TEMPORARILY ABANDON	MENCE DRILLING OPNS. PLUG AND ABANDONMENT
	NG TEST AND ENT JOB
OTHER: OTH	
12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date	
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation. 1. Notify OCD 24 hrs prior to MI &RU 2. Set 5 1/2 CIBP @ 6250, spot 25sx plug 6250-6050(Drinkard)WOC Tag.	
1. Notify OCD 24 hrs prior to MI &RU 2. Set 5 1/2 CIBP @ 6250, spot 25sx plug 6250-6050(Drinkard)WOC Tag.	
2. Set 5 1/2 CIBP @ 6250, spot 25sx plug 6250-6050(Drinkard)WOC Tag.	
3. Displace hole w/mlf, 9.5 # Brine w/25# Gel P/BBL. 4. Spot 25sx plug 5000-4800(Glorieta) 5. Spot 25sx plug 3300-3100(Queen,DV Tool) 6. Spot 30sx plug 2600-2300(Yates,B-salt)WOC Tag.	
5. Spot 25sx plug 3300-3100(Queen,DV Tool)	
6. Spot 30sx plug 2600-2300(Yates,B-salt)WOC Tag. 7. Spot 30sx plug 1300-1050(8 5/8 shoe,T-salt)WOC Tag.	
8. Perf 4 holes @ 300, circ 90sx plug 300-surf 5 1/2 X 8 5/8 to in	sure cmt behind 5 1/2 was circ to surf.
If unable to pump into perfs, Fill 5 1/2 csg w/30sx plug 300-surf. (Surf)WOC Tag. 9. Install dry hole marker.	
THE COMMISSION MUST BE NOTIFIED 24	
H	OURS PRIOR TO THE BEGINNING OF
PI	LUGGING OPERATIONS FOR THE C-103 DIBE APPROVED.
I hereby certify that the information above is true and complete to the best of my knowledge and belief.	
SIGNATURE DATE 5/16/2003	
Type or print name G.R. Bledsoe	Telephone No. 915-687-7153
APPPROVED BY LOUIS TREFFELD REPRESENTATIVE II/STAFF MANAGER DATE DATE	
Conditions of approval, if any:	