

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 1301 W. Grand Avenue, Artesia, NM 87210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised March 25, 1999

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 30-025-09219-00-00

5. Indicate Type of Lease
 STATE FEE

6. State Oil & Gas Lease No.
 B-1167

7. Lease Name or Unit Agreement Name:
 STATE JG

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
 Oil Well Gas Well Other

2. Name of Operator
 JOHN H. HENDRIX CORPORATION

8. Well No. 4

3. Address of Operator
 P.O. BOX 3040; MIDLAND, TEXAS 79702-3040

9. Pool name or Wildcat
 LANGLIE MATTIX

4. Well Location
 Unit Letter L : 1980 feet from the SOUTH line and 660 feet from the WEST line
 Section 2 Township 23S Range 36E NMPM LEA County


10. Elevation (Show whether DR, RKB, RT, GR, etc.)
 3472' DL

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 1.) RIG UP P & A EQUIPMENT; NIPPLE UP BOP.
- 2.) SET CIBP AT 3370'.
- 3.) CIRCULATE HOLE WITH MUD; CAP CIBP WITH 25 SACKS OF CEMENT.
- 4.) PERFORATE CASING AT 2814'; COULD NOT PUMP INTO PERFORATIONS; RIH TO 2860'; SPOT 25 SACK PLUG.
- 5.) PERFORATE AT 1320'; COULD NOT SQUEEZE; RIH TO 1370'; SPOT 50 SACKS OF CEMENT; WOC.
- 6.) TAG PLUG AT 1240'.
- 7.) PUH TO 350'; SPOT 30 SACKS OF CEMENT; WOC.
- 8.) NO TAG ON PLUG; RESPOT 30 SACKS OF CEMENT; WOC.
- 9.) NO TAG ON PLUG; RESPOT 30 SACKS OF CEMENT; WOC.
- 10.) TAG PLUG AT 50'.
- 11.) CUT OFF WELLHEAD; SPOT 50 SACK SURFACE PLUG IN ANNULUS OF 4 1/2" x 8 5/8".
- 12.) INSTALL DRY HOLE MARKER AND RIG DOWN.

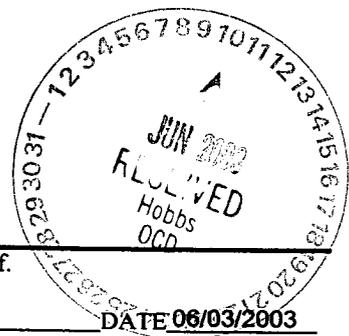

I hereby certify that the information above is true and complete to the best of my knowledge and belief.
 SIGNATURE [Signature] TITLE AGENT DATE 06/03/2003

Type or print name HOWARD BOATRIGHT Telephone No. (432)570-5382
 (This space for State use) OGD FIELD REPRESENTATIVE II/STAFF MANAGER

APPROVED BY [Signature] TITLE DATE JUN 17 2003
 Conditions of approval, if any

Approved as to plugging of the Well Bore.
 Liability under bond is retained until
 surface restoration is completed.