

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1940, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-26922
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 3709
7. Lease Name or Unit Agreement Name Maralo "16" State
8. Well No. 3Y
9. Pool name or Wildcat Sioux Yates Pool

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐	
2. Name of Operator Draco Energy, Inc.	
3. Address of Operator P.O. Box 11404, Midland, TX 79702	
4. Well Location Unit Lease C : 710' 660 Feet From The North Line and 1980 Feet From The West Line Section 16 Township 26-S Range 36-E NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 2949.8 GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 5-22-03 Rig up unit, POOH w/rods & tbg.
- 5-23-03 Set 4-1/2" CIBP @ 3187', cap w/ 35' cmt., mud up, cut and pull 1940' (4-1/2" csg.) Spot 35 sx cmt. @ 1992', WOC.
- 5-27-03 Tag cmt. plug @ 1905', re-spot 35 sx cmt. w/2%+or-CaCl @ 1905' (suggest by Buddy Hills). WOC 4 hrs. tag cmt. plug @ 1715', cut 7" csg. @ 1500'.
- 5-28-03 Spot 55 sx cmt. w/ 2% +or- CaCl @ 1552', WOC & tag @ 1475', re-spot 55 sx @ 1475', WOC.
- 5-29-03 Tag plug @ 1434', add 15 sx cmt. to plug. Spot 45 sx cmt. w/ 2% +or- CaCl @ 400'. WOC. (No tag). Re-spot 45 sx cmt. @ 400' WOC.
- 5-30-03 Tag plug @ 286', spot 10 sx cmt. to surface, RDMO. Cut off wellhead, install dry hole marker, and clean location.

Approved as to plugging of the well bore.
Liability under bond is retained until
surface restoration is completed.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE _____ TITLE _____ Agent
TYPE OR PRINT NAME _____ DATE _____
6/05/03
TELEPHONE NO. 432-530-0907

(This space for State Use)

APPROVED BY: Harry W. Wink
OFFICIALS OF APPROVAL, IF ANY:

OC FIELD REPRESENTATIVE II/STAFF MANAGER
DATE _____

JUN 20 2003