

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 5-27-2004

FILE IN TRIPLICATE

OIL CONSERVATION DIVISION

DISTRICT I

1625 N. French Dr. , Hobbs, NM 88240

DISTRICT II

1301 W. Grand Ave, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd, Aztec, NM 87410

1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.
30-025-37435

5. Indicate Type of Lease

STATE ☒

FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

NORTH HOBBS (G/SA) UNIT
Section 19

8. Well No. 943

9. OGRID No. 157984

10. Pool name or Wildcat HOBBS (G/SA)

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.)

1. Type of Well:

Oil Well ☒

Gas Well ☐

Other ☐

2. Name of Operator

Occidental Permian Ltd.

3. Address of Operator

1017 W. Stanolind Rd., HOBBS, NM 88240

505/397-8200

4. Well Location

Unit Letter

☒ H : 2470

Feet From The

NORTH

225

Feet From The

EAST

Line

Section 19

Township

18-S

Range

38-E

NMPM

LEA

County

11. Elevation (Show whether DF, RKB, RT GR, etc.)

3655' GR

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit Type _____ Depth of Ground Water _____ Distance from nearest fresh water well _____ Distance from nearest surface water

Pit Liner Thickness _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material

12.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

REMEDIAL WORK ☐

ALTERING CASING ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

COMMENCE DRILLING OPNS. ☐

PLUG & ABANDONMENT ☐

PULL OR ALTER CASING ☐

Multiple Completion ☐

CASING TEST AND CEMENT JOB ☐

OTHER: _____

OTHER: _____

New Well Completion

☒

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. RUPU. Drill out DV tool @3507'. Tag PBTB @4407'.
2. Perforate the following intervals; 4331-38, 4343-48, 4353-58, 4376-83, and 4388-97 using 2 spf, 120 deg sp ph. (76 holes).
3. Stimulate perms 4331 to 4397 w/2400 g 15% NEFE HCL acid in 19 settings.
4. RIH Reda ESP equipment on 126 jts 2-7/8" tbg w/drain valve. Intake set @4193'.
5. Install QCI wellhead connection.
6. RDPU. Clean Location.

Rig Up Date: 12/13/2005

Rig Down Date: 12/16/2005

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOC guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐

SIGNATURE

Robert Gilbert

TITLE Workover Completion Specialist

DATE 12/20/2005

TYPE OR PRINT NAME Robert Gilbert

E-mail address: robert_gilbert@oxy.com

TELEPHONE NO. 505/397-8206

For State Use Only

APPROVED BY

Harry W. Wink

CONDITIONS OF APPROVAL IF ANY:

OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE DEC 30 2005