OCD-HOBBS

UNITED STATES Form 3160-5 FORM APPROVED DEPARTMENT OF THE INTERIOR (JUNE 1990) Budget Bureau No. 1004-0135 **BUREAU OF LAND MANAGEMENT** Expires: March 31, 1993 Lease Designation and Serial No. SUNDRY NOTICES AND REPORTS ON WELLS NM-14791 Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. If Indian, Allottee or Tribe Name Use "APPLICATION FOR PERMIT-" for such proposals SUBMIT IN TRIPLICATE 7. If Unit or CA, Agreement Designation 1. Type of Well Gas Oil Well Well Well Name and No. New Mexico A Federal #6 2. Name of Operator STRATA PRODUCTION COMPANY 9. API Well No. 3. Address and Telephone No. P. O. Box 1030 30-025-31377 Roswell, New Mexico 88202-1030 505-622-1127 10. Field and Pool, or Exploratory Area 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Hat Mesa Delaware 1650' FNL & 330' FWL 11. County or Parish, State Section 4-21S-32E Lea County, New Mexico CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Abandonment Change of Plans Recompletion New Construction X Subsequent Report Plugging Back Non-Routine Fracturing Casing Repair Water Shut-Off Final Abandonment Notice Altering Casing Conversion to Injection Approved as to plugging of the well bore OTHER Dispose Water tiability under bond is retained until (Note: Report results of multiple completion on Well Stribes rectoration is completed. Completion or Recompletion Report and Log form.) 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* 11/09/05: Mayo Marrs notified OCD. MIRU. Move in steel pit. Test tbg to 500#. Unseat pump. TOH w/325 rods. NDWH. NUBOP. Close in well. 11/10/05: TOH w/tbg. TIH w/gauge ring to 8100'. No CIBP tagged. TIH and set CIBP at 8050'. Dump 35' (4 sxs) cmt on top. TIH and set CIBP at 6574'. Dump 35' (4 sxs) cmt on top. TIH w/29 stands. Close in well. TIH to 6500'. Circ 10# mud. POOH and spot 25 sxs at 3222 - 2982'. TOH. NDWH. 11/11/05: Weld on pull nipple. Cut csg at 1987'. Not free. Pressure test to 500#. TIH and spot 25 sxs at 2032'. TOH. Close in well. 11/14/05: Tag at 1841'. Call BLM - Jim Amos. No stretch in csg. BLM wants perfs. Cut csg at 1457'. Test to 1000#. TIH and spot 25 sxs at 1510'. TOH. WOC. Tag at 1357'. Perforate at 418'. Test to 1000#. Spot 25 sxs at 468'. Will tag per BLM. Tag at 233'. TOH and spot 10 sxs at 60' to surface. RD. Cut off wellhead and 11/15/05: anchors. Install dry hole marker. 14. I hereby certify that the foregoing is true and correct Title Production Records 12/13/05

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Title



(This space for Federal or State office use)

Conditions of approval, if any:

Approved by