

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 3002531124
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Christmas A/NCT-A
8. Well Number # 10
9. OGRID Number
10. Pool name or Wildcat

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Arch Petroleum & Pogo Production Co.

3. Address of Operator
PO Box 10340, Midland, Tx 79701

4. Well Location
Unit Name: **J** **1780** feet from the **South** line and **1780** feet from the **East** line
Section **27** Township **22S** Range **36E** NMPM County **Lea**

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3,509'

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type **Steel** Depth to Groundwater **160** Distance from nearest fresh water well **1000'** Distance from nearest surface water **1000'**

Pit Liner Thickness: **mil** Below-Grade Tank: Volume **bbls**; Construction Material

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☒
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Inform Buddy Hill, OCD, of move in.
2. POOH production tbg. TIH Bit & Scraper to 3148', POOH tbg.
3. Set CIBP at 3131', mix & circ. Salt Gel mud. Spot 25 sx cement on top of CIBP w/ TOC 2879'.
4. Perforate csg. at 1600' - pressure up to 1000 PSI- Set Tbg. at 1650', spot 40 sx Plug - WOC, Tag cement 1300' - Perf. 5 1/2" csg at 400' w/ Packer, pressure up to 1000 PSI, no bleed off.
5. Spot 25 sx Plug from 450', WOC, Tag cement at 200'. Cut off wellhead, spot 10 sx cement, 30' to Surf. Install Dry Hole Marker. Rig down. **11/14/05**

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE *[Signature]* TITLE Agent DATE 11-14-05

Type or print name
For State Use Only

E-mail address:

Telephone No.

APPROVED BY: *Larry W. Wink* TITLE _____
Conditions of Approval (if any):

DATE

FEB 20 2006