Office	State of New Mexico	Form C-103
District I – (575) 393-6161 1625 N French Dr. Hobbs NM 88240 — • • •	Energy Minerals and Natural Resource	Revised August 1, 2011 WELL API NO.
District II – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283 811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	OIL CONSERVATION DIVISIO	N 30-025-09085 V
811 S. First St., Artesia, NM 882 0° District III – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410 UN 0 9	2 2016 1220 South St. Francis Dr.	5. Indicate Type of Lease STATE FEE X
1000 Rio Brazos Rd., Aztec, NM 8/410011	Santa Ea NIM 97505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	EIVED SAIRA FE, NIVI 87303	
SUNDRY NOTICES	AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS DIFFERENT RESERVOIR. USE "APPLICATION OF THE PROPOSALS	TO DRILL OR TO DEEPEN OR PLUG BACK TO ON FOR PERMIT" (FORM C-101) FOR SUCH	B.A. CHRISTMAS
PROPOSALS.) 1. Type of Well: Oil Well Gas We	ell X Other	8. Well Number
	- Cuici	001
2. Name of Operator CIMAREX ENERGY CO. OF COLOR.	ADO /	9. OGRID Number 162683
3. Address of Operator		10. Pool name or Wildcat
600 N. MARIENFELD, SUITE 600, MI	DLAND, TEXAS 79701	JALMAT; TANSILL-YATES-7-RIVERS
4. Well Location		A S S S S S S S S S S S S S S S S S S S
Unit Letter L : 1650 Section 28	feet from the SOUTH line and 330 Township 22S Range) feet from the WEST line 36E NMPM LEA County
	Elevation (Show whether DR, RKB, RT, C	
	3,508' – GR	
12. Check Appro	opriate Box to Indicate Nature of N	otice, Report or Other Data
NOTICE OF INT		SUBSEQUENT REPORT OF:
	NT TO PAREMEDIA	
	CASING/	CE DRILLING OPNS. P AND A X CEMENT JOB
DOWNHOLE COMMINGLE	P&A R	Z.W.E.N. 00B
OTUED.	071150	
		AITH DILLOCED AND ADANDONED OF 100 140
OTHER: 13 Describe proposed or completed		WELL PLUGGED AND ABANDONED 05/29/16. ails, and give pertinent dates, including estimated date
13. Describe proposed or completed of starting any proposed work).	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult	WELL PLUGGED AND ABANDONED 05/29/16. ails, and give pertinent dates, including estimated date ple Completions: Attach wellbore diagram of
13. Describe proposed or completed	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult	ails, and give pertinent dates, including estimated date
13. Describe proposed or completed of starting any proposed work). proposed completion or recompleted to the complete of starting any proposed work.	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion.	ails, and give pertinent dates, including estimated date the Completions: Attach wellbore diagram of
13. Describe proposed or completed of starting any proposed work). proposed completion or recompleted of 5/28/16: SET 5-1/2" CIBP @ 3,100'; P	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion.	ails, and give pertinent dates, including estimated date
13. Describe proposed or completed of starting any proposed work). proposed completion or recompleted of SET 5-1/2" CIBP @ 3,100'; PAXA FLUID X PRES. TEST 5	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X7 -1/2" CSG. TO 750# - HELD OK; PUMP	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD).
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100'; PPXA FLUID X PRES. TEST 5	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100'; PPXA FLUID X PRES. TEST 5	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD).
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100'; PPXA FLUID X PRES. TEST 5 05/29/16: PUMP 30 SXS. CMT. @ 1,485 356'-3'; DIG OUT X CUT OFF	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD).
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100'; PPXA FLUID X PRES. TEST 5 05/29/16: PUMP 30 SXS. CMT. @ 1,485 356'-3'; DIG OUT X CUT OFF	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD).
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100'; PPXA FLUID X PRES. TEST 5 05/29/16: PUMP 30 SXS. CMT. @ 1,485 356'-3'; DIG OUT X CUT OFF HOLE MARKER.	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP '; WOC X TAG CMT. PLUG @ 1,240'; IF WELLHEAD 3' B.G.L.; WELD ON ST	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD).
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100'; P PXA FLUID X PRES. TEST 5 05/29/16: PUMP 30 SXS. CMT. @ 1,485 356'-3'; DIG OUT X CUT OFF HOLE MARKER.	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP 3'; WOC X TAG CMT. PLUG @ 1,240'; If WELLHEAD 3' B.G.L.; WELD ON ST	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD). MIX X CIRC. TO SURF. 45 SXS. CMT. @ EEL PLATE TO CSGS. X INSTALL DRY
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100'; P PXA FLUID X PRES. TEST 5 05/29/16: PUMP 30 SXS. CMT. @ 1,485 356'-3'; DIG OUT X CUT OFF HOLE MARKER.	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP T'; WOC X TAG CMT. PLUG @ 1,240'; I'WELLHEAD 3' B.G.L.; WELD ON STI	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD). MIX X CIRC. TO SURF. 45 SXS. CMT. @ EEL PLATE TO CSGS. X INSTALL DRY
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100'; PPXA FLUID X PRES. TEST 5 05/29/16: PUMP 30 SXS. CMT. @ 1,485 356'-3'; DIG OUT X CUT OFF HOLE MARKER.	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP T'; WOC X TAG CMT. PLUG @ 1,240'; I'WELLHEAD 3' B.G.L.; WELD ON STI	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD). MIX X CIRC. TO SURF. 45 SXS. CMT. @ EEL PLATE TO CSGS. X INSTALL DRY
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100'; P PXA FLUID X PRES. TEST 5 05/29/16: PUMP 30 SXS. CMT. @ 1,485 356'-3'; DIG OUT X CUT OFF HOLE MARKER.	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP T'; WOC X TAG CMT. PLUG @ 1,240'; I'WELLHEAD 3' B.G.L.; WELD ON STI	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD). MIX X CIRC. TO SURF. 45 SXS. CMT. @ EEL PLATE TO CSGS. X INSTALL DRY
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100'; P PXA FLUID X PRES. TEST 5 05/29/16: PUMP 30 SXS. CMT. @ 1,485 356'-3'; DIG OUT X CUT OFF HOLE MARKER.	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP T'; WOC X TAG CMT. PLUG @ 1,240'; I'WELLHEAD 3' B.G.L.; WELD ON STI	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD). MIX X CIRC. TO SURF. 45 SXS. CMT. @ EEL PLATE TO CSGS. X INSTALL DRY
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100"; PPXA FLUID X PRES. TEST 5 05/29/16: PUMP 30 SXS. CMT. @ 1,485 356'-3"; DIG OUT X CUT OFF HOLE MARKER. Spud Date: MIRU: 05/26/16 I hereby certify that the information above SIGNATURE	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP 3'; WOC X TAG CMT. PLUG @ 1,240'; NELLHEAD 3' B.G.L.; WELD ON STORY WELLHEAD 3' B.G.L.; WELD ON STORY WELLHEAD 3' B.G.L.; AGENT	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD). MIX X CIRC. TO SURF. 45 SXS. CMT. @ EEL PLATE TO CSGS. X INSTALL DRY 10: 05/29/16 DATE: 05/31/16
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100'; PPXA FLUID X PRES. TEST 5 05/29/16: PUMP 30 SXS. CMT. @ 1,485 356'-3'; DIG OUT X CUT OFF HOLE MARKER. Spud Date: MIRU: 05/26/16 I hereby certify that the information above SIGNATURE Type or print name: DAVID A. EYLER	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP 3'; WOC X TAG CMT. PLUG @ 1,240'; NELLHEAD 3' B.G.L.; WELD ON STORY WELLHEAD 3' B.G.L.; WELD ON STORY WELLHEAD 3' B.G.L.; AGENT	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD). MIX X CIRC. TO SURF. 45 SXS. CMT. @ EEL PLATE TO CSGS. X INSTALL DRY MO: 05/29/16
13. Describe proposed or completed of starting any proposed work). proposed completion or recomple 05/28/16: SET 5-1/2" CIBP @ 3,100"; PPXA FLUID X PRES. TEST 5 05/29/16: PUMP 30 SXS. CMT. @ 1,485 356'-3"; DIG OUT X CUT OFF HOLE MARKER. Spud Date: MIRU: 05/26/16 I hereby certify that the information above SIGNATURE	operations. (Clearly state all pertinent det SEE RULE 19.15.7.14 NMAC. For Mult etion. PUMP 55 SXS. CMT. @ 3,100'; WOC X 7-1/2" CSG. TO 750# - HELD OK; PUMP 3'; WOC X TAG CMT. PLUG @ 1,240'; NELLHEAD 3' B.G.L.; WELD ON STORY WELLHEAD 3' B.G.L.; WELD ON STORY WELLHEAD 3' B.G.L.; AGENT	ails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of TAG CMT. PLUG @ 3,040'; CIRC. WELL W/55 SXS. CMT. @ 3,040'-2,910' (PER OCD). MIX X CIRC. TO SURF. 45 SXS. CMT. @ EEL PLATE TO CSGS. X INSTALL DRY 10: 05/29/16 DATE: 05/31/16