ubmit 1 Copy To Appropriate District State of New Mexico			Form C-103	
Office District I – (575) 393-6161 Energy, Min	erals and Natural R	esources _		Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283	SERVATION DIVISION		WELL API NO. 30-025-39840	
orr o. r list ot., rutesia, livi oozio	South St. Francis I		5. Indicate Type of Le	
1000 Rio Brazos Rd., Aztec, NM 87410	ta Fe, NM 87505		6. State Oil & Gas Lea	FEE /
District IV – (505) 476-3460 1220 S. St. Francis Dr., Santarfe, NM 2 2016 87505	ia i e, i i i i o / 5 0 5		6. State OII & Gas Le	ase no.
SUNDRY NOTICES AND REPOR	TS ON WELLS		7. Lease Name or Uni	t Agreement Name
(DO NOT USE THIS FORMED REPORTED OR TO DRILL OR TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"	O DEEPEN OR PLUG BA " (FORM C-101) FOR SU(	CK TO A	Creasered de 22 State	1
PROPOSALS.) 1. Type of Well: Oil Well 🔀 Gas Well 🗌 Oth			Crossroads 22 State 8. Well Number 3H	*
2. Name of Operator	,		9. OGRID Number	
Marshall & Winston, Inc. 3. Address of Operator			14187 10. Pool name or Wild	deat
P. O. Box 50880, Midland, TX 79710-0880			Flying M; Abo	ucat .
4. Well Location				
Unit Letter C : 400 feet from	nthe North	line and 19	80 feet from the	e <u>West</u> line '
Section 22 Townsh	1 0	33E	NMPM Co	ounty Lea
11. Elevation (Sh	ow whether DR, RKB	, RT, GR, etc.)		
	4359' GR			
12. Check Appropriate Box	to Indicate Nature	e of Notice, F	Report or Other Dat	a
NOTICE OF INTENTION TO:		SUBS	EQUENT REPO	
PERFORM REMEDIAL WORK PLUG AND ABAI		MEDIAL WORK		
TEMPORARILY ABANDON		MMENCE DRIL	LING OPNS.	ND A
	PL 🗌 CAS	SING/CEMENT	JOB 🗌	
DOWNHOLE COMMINGLE				
	_			5
OTHER:		HER: Work		K
13. Describe proposed or completed operations. (C	Clearly state all pertine	ent details, and	give pertinent dates, in	
<ol> <li>Describe proposed or completed operations. (0 of starting any proposed work). SEE RULE 19</li> </ol>	Clearly state all pertine	ent details, and	give pertinent dates, in	
13. Describe proposed or completed operations. (C	Clearly state all pertine	ent details, and	give pertinent dates, in	
<ol> <li>Describe proposed or completed operations. (0 of starting any proposed work). SEE RULE 19</li> </ol>	Clearly state all pertine 0.15.7.14 NMAC. For	ent details, and	give pertinent dates, in	
<ol> <li>Describe proposed or completed operations. (Constraints of starting any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fisher the set of the set of</li></ol>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac	ent details, and r Multiple Com	give pertinent dates, in pletions: Attach wellb e water & POH. PU v	ore diagram of
<ul> <li>13. Describe proposed or completed operations. (Constraints of starting any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fist</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> </ul>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac down to 7,564' &	ent details, and r Multiple Com e hole w/brin POH. MU ext	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters.	ore diagram of wash pipe.
<ol> <li>Describe proposed or completed operations. (Constraints of starting any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fis</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,52</li> </ol>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac down to 7,564' &	ent details, and r Multiple Com e hole w/brin POH. MU ext	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters.	ore diagram of wash pipe.
<ul> <li>13. Describe proposed or completed operations. (Constraints of starting any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fis</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,53</li> <li>wash pass 7,660'. Circ well clean.</li> </ul>	Clearly state all pertine 9.15.7.14 NMAC. For BOP. h @ 7,323'. Displac down to 7,564' & 32' & POOH w/fish.	ent details, and r Multiple Com e hole w/brin POH. MU ext RIH w/wash	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to	ore diagram of wash pipe. o 7,660'. Could not
<ol> <li>Describe proposed or completed operations. (Constraints of starting any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fist</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and</li> </ol>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac l down to 7,564' & 32' & POOH w/fish. d fish broke off, PO	ent details, and r Multiple Com e hole w/brin POH. MU ext RIH w/wash H w/ fish. Insp	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to	ore diagram of wash pipe. o 7,660'. Could not
<ul> <li>13. Describe proposed or completed operations. (Constraints of starting any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fist 12-01-16 RIH w/wash pipe, tag up 7,323', washed 12-02-16 RIH w/external cutters, made cut @ 7,55 wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> </ul>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac l down to 7,564' & 32' & POOH w/fish. d fish broke off, PO	ent details, and r Multiple Com e hole w/brin POH. MU ext RIH w/wash H w/ fish. Insp	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to	ore diagram of wash pipe. o 7,660'. Could not
<ol> <li>Describe proposed or completed operations. (Constraints of starting any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fist</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and</li> </ol>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac l down to 7,564' & 32' & POOH w/fish. d fish broke off, PO	ent details, and r Multiple Com e hole w/brin POH. MU ext RIH w/wash H w/ fish. Insp	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to	ore diagram of wash pipe. o 7,660'. Could not
<ol> <li>Describe proposed or completed operations. (Constraints of starting any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fis</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,52</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> </ol>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac down to 7,564' & 32' & POOH w/fish. d fish broke off, PO to P&A well. PU CI	ent details, and r Multiple Com re hole w/brin POH. MU ext RIH w/wash H w/ fish. Insp BP.	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out	ore diagram of wash pipe. o 7,660'. Could not of hole and
<ul> <li>13. Describe proposed or completed operations. (Constraints of starting any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fist</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> <li>12-05-16 Cont to mill plug.</li> </ul>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac I down to 7,564' & 32' & POOH w/fish. d fish broke off, POI to P&A well. PU CII hole clean. POH LD	ent details, and r Multiple Com POH. MU ext RIH w/wash H w/ fish. Insp BP. 2-7/8" AOH t	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out bg. MIRU JSI Wirelin	ore diagram of wash pipe. o 7,660'. Could not of hole and e, set CIPB @ 7,500'
<ul> <li>13. Describe proposed or completed operations. (Constraints any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fist</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> <li>12-05-16 Cont to mill plug.</li> <li>12-06-16 Milled up plug and TIH to bottom. Circ I</li> </ul>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac I down to 7,564' & 32' & POOH w/fish. d fish broke off, POI to P&A well. PU CII hole clean. POH LD	ent details, and r Multiple Com POH. MU ext RIH w/wash H w/ fish. Insp BP. 2-7/8" AOH t	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out bg. MIRU JSI Wirelin	ore diagram of wash pipe. o 7,660'. Could not of hole and e, set CIPB @ 7,500'
<ul> <li>13. Describe proposed or completed operations. (Constraints any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fist</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> <li>12-05-16 Cont to mill plug.</li> <li>12-06-16 Milled up plug and TIH to bottom. Circ I&amp; pressure test casing to 500# for 30 mins. ND BC</li> </ul>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac down to 7,564' & 32' & POOH w/fish. d fish broke off, POI to P&A well. PU CII hole clean. POH LD DP & release equipn	ent details, and r Multiple Com POH. MU ext RIH w/wash H w/ fish. Insp BP. 2-7/8" AOH th nent. Wait for	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out bg. MIRU JSI Wirelin Basic Energy to plug	ore diagram of wash pipe. o 7,660'. Could not of hole and e, set CIPB @ 7,500'
<ul> <li>13. Describe proposed or completed operations. (Constraints any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fist</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> <li>12-05-16 Cont to mill plug.</li> <li>12-06-16 Milled up plug and TIH to bottom. Circ I</li> </ul>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac I down to 7,564' & 32' & POOH w/fish. d fish broke off, POI to P&A well. PU CII hole clean. POH LD	ent details, and r Multiple Com POH. MU ext RIH w/wash H w/ fish. Insp BP. 2-7/8" AOH th nent. Wait for	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out bg. MIRU JSI Wirelin	ore diagram of wash pipe. o 7,660'. Could not of hole and e, set CIPB @ 7,500'
<ul> <li>13. Describe proposed or completed operations. (Constraints any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fist</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> <li>12-05-16 Cont to mill plug.</li> <li>12-06-16 Milled up plug and TIH to bottom. Circ I&amp; pressure test casing to 500# for 30 mins. ND BC</li> </ul>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac down to 7,564' & 32' & POOH w/fish. d fish broke off, POI to P&A well. PU CII hole clean. POH LD DP & release equipn	ent details, and r Multiple Com POH. MU ext RIH w/wash H w/ fish. Insp BP. 2-7/8" AOH th nent. Wait for	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out bg. MIRU JSI Wirelin Basic Energy to plug	ore diagram of wash pipe. o 7,660'. Could not of hole and e, set CIPB @ 7,500'
<ul> <li>13. Describe proposed or completed operations. (Constraints any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fist</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> <li>12-05-16 Cont to mill plug.</li> <li>12-06-16 Milled up plug and TIH to bottom. Circ I&amp; pressure test casing to 500# for 30 mins. ND BC</li> </ul>	Clearly state all pertine D.15.7.14 NMAC. For BOP. h @ 7,323'. Displac down to 7,564' & 32' & POOH w/fish. d fish broke off, POI to P&A well. PU CII hole clean. POH LD DP & release equipn Rig Release Date:	ent details, and r Multiple Com POH. MU ext RIH w/wash H w/ fish. Insp BP. 2-7/8" AOH ti nent. Wait for 10/1	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out bg. MIRU JSI Wirelin Basic Energy to plug	ore diagram of wash pipe. o 7,660'. Could not of hole and e, set CIPB @ 7,500'
<ul> <li>13. Describe proposed or completed operations. (Constraining any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fis</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> <li>12-05-16 Cont to mill plug.</li> <li>12-06-16 Milled up plug and TIH to bottom. Circ I &amp; pressure test casing to 500# for 30 mins. ND BC</li> <li>Spud Date: 07/27/10</li> </ul>	Clearly state all pertine D.15.7.14 NMAC. For BOP. h @ 7,323'. Displac down to 7,564' & 32' & POOH w/fish. d fish broke off, POI to P&A well. PU CII hole clean. POH LD DP & release equipn Rig Release Date:	ent details, and r Multiple Com POH. MU ext RIH w/wash H w/ fish. Insp BP. 2-7/8" AOH ti nent. Wait for 10/1	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out bg. MIRU JSI Wirelin Basic Energy to plug	ore diagram of wash pipe. o 7,660'. Could not of hole and e, set CIPB @ 7,500'
<ul> <li>13. Describe proposed or completed operations. (Constraining any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fis</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> <li>12-05-16 Cont to mill plug.</li> <li>12-06-16 Milled up plug and TIH to bottom. Circ I &amp; pressure test casing to 500# for 30 mins. ND BC</li> <li>Spud Date: 07/27/10</li> </ul>	Clearly state all pertine 0.15.7.14 NMAC. For BOP. h @ 7,323'. Displac down to 7,564' & 32' & POOH w/fish. d fish broke off, POI to P&A well. PU CII hole clean. POH LD DP & release equipn Rig Release Date:	ent details, and r Multiple Com POH. MU ext RIH w/wash H w/ fish. Insp BP. 2-7/8" AOH ti nent. Wait for 10/1	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out bg. MIRU JSI Wirelin Basic Energy to plug 7/10	ore diagram of wash pipe. o 7,660'. Could not of hole and e, set CIPB @ 7,500'
<ul> <li>13. Describe proposed or completed operations. (Constraining any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fis</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> <li>12-05-16 Cont to mill plug.</li> <li>12-06-16 Milled up plug and TIH to bottom. Circ I &amp; pressure test casing to 500# for 30 mins. ND BC</li> <li>Spud Date: 07/27/10</li> </ul>	Clearly state all pertine D.15.7.14 NMAC. For BOP. h @ 7,323'. Displac I down to 7,564' & 32' & POOH w/fish. d fish broke off, POI to P&A well. PU CII hole clean. POH LD DP & release equipn Rig Release Date: omplete to the best of 	ent details, and r Multiple Com POH. MU ext RIH w/wash H w/ fish. Insp BP. 2-7/8" AOH ti nent. Wait for 10/1 my knowledge ions Manag	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out bg. MIRU JSI Wirelin Basic Energy to plug 7/10	ore diagram of wash pipe. o 7,660'. Could not of hole and e, set CIPB @ 7,500' ; well.
<ul> <li>13. Describe proposed or completed operations. (Constraining any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fist</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> <li>12-05-16 Cont to mill plug.</li> <li>12-06-16 Milled up plug and TIH to bottom. Circ I &amp; pressure test casing to 500# for 30 mins. ND BC</li> <li>Spud Date: 07/27/10</li> </ul>	Clearly state all pertine D.15.7.14 NMAC. For BOP. h @ 7,323'. Displac down to 7,564' & 32' & POOH w/fish. d fish broke off, POI to P&A well. PU Clf hole clean. POH LD DP & release equipn Rig Release Date: 	ent details, and r Multiple Com POH. MU extr RIH w/wash H w/ fish. Insp BP. 2-7/8" AOH th nent. Wait for 10/1 my knowledge ions Manag assmore@ma	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out bg. MIRU JSI Wirelin Basic Energy to plug 7/10 and belief. erDATE	ore diagram of wash pipe. o 7,660'. Could not of hole and e, set CIPB @ 7,500' ; well. <u>12/08/16</u> E: <u>432–684–6373</u>
<ul> <li>13. Describe proposed or completed operations. (Constraining any proposed work). SEE RULE 19 proposed completion or recompletion.</li> <li>11-29-16 MIRU TEC workover rig. Set tanks &amp; NU</li> <li>11-30-16 PU 2-7/8" AOH tbg w/ 6-1/8" bit, tag fis</li> <li>12-01-16 RIH w/wash pipe, tag up 7,323', washed</li> <li>12-02-16 RIH w/external cutters, made cut @ 7,55</li> <li>wash pass 7,660'. Circ well clean.</li> <li>12-03-16 RIH w/jars. Jarred pipe for 4.5 hours and determined casing was collapsed. Made decision</li> <li>12-04-16 CIBP preset at 60'. Mill out plug.</li> <li>12-05-16 Cont to mill plug.</li> <li>12-06-16 Milled up plug and TIH to bottom. Circ I &amp; pressure test casing to 500# for 30 mins. ND BC</li> <li>Spud Date: 07/27/10</li> </ul>	Clearly state all pertine D.15.7.14 NMAC. For BOP. h @ 7,323'. Displac I down to 7,564' & 32' & POOH w/fish. d fish broke off, POI to P&A well. PU CII hole clean. POH LD DP & release equipn Rig Release Date: omplete to the best of 	ent details, and r Multiple Com POH. MU extr RIH w/wash H w/ fish. Insp BP. 2-7/8" AOH th nent. Wait for 10/1 my knowledge ions Manag assmore@ma	give pertinent dates, in pletions: Attach wellb e water & POH. PU v ernal cutters. pipe & wash down to pected fish once out bg. MIRU JSI Wirelin Basic Energy to plug 7/10 and belief. erDATE	ore diagram of wash pipe. o 7,660'. Could not of hole and e, set CIPB @ 7,500' ; well.

APPROVEL	BA:	mar	
Conditions of	of Approv	al (if any	y):