## State of New Mexico Energy, Minerals and Natural Resources Departmen



Form C-103 Revised 5-27-2004

FILE IN TRIPLICATE OH, CONSERVATION DIVISIO

DISTRICT I 1220 South St. Francis Dr.	
1625 N. French Dr., Hobbs, NM 88240 Santa Fe, NM 87505	WELL API NO. 30-025-12504
DISTRICT II	5. Indicate Type of Lease
1301 W. Grand Ave, Artesia, NM 88210	STATE X FEE
DISTRICT III	6. State Oil & Gas Lease No.
1000 Rio Brazos Rd, Aztec, NM 87410	
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name 19520
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (Form C-101) for such proposals.)	NORTH HOBBS:(G/SA) UNIT Section 32
Oil Well X Gas Well Other	8. Well No. 532 ½
Name of Operator     Occidental Permian Ltd.	9. OGRID No. 157984
3. Address of Operator	10. Pool name or Wildcat HOBBS (G/SA)
1017 W. Stanolind Rd., HOBBS, NM 88240 505/397-8200	
4. Well Location  Unit Letter G 2310 Feet From The NORTH 1650 Feet	From The EAST Line
Section 32 Township 18-S Range 38-E	
11. Elevation (Show whether DF, RKB, RT GR, etc.)	
Pit or Below-grade Tank Application or Closure	
Pit Type Depth of Ground Water Distance from nearest fresh water well Distance from nearest surface water	
Pit Liner Thickness mil Below-Grade Tank: Volume bbls; Construction Material	
12. Check Appropriate Box to Indicate Nature of Notice, Report, or O	ther Data
	EQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK	X ALTERING CASING
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPN	IS. PLUG & ABANDONMENT
PULL OR ALTER CASING Multiple Completion CASING TEST AND CEMENT	T.IOB
ı	, , , ,
OTHER: OTHER:	
OTHER:  OTHER:  OTHER:  OTHER:  13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completed operations.	including estimated date of starting any
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates,	including estimated date of starting any
<ol> <li>Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completions.</li> <li>RUPU. Pull production equipment.</li> <li>Drill out CIBP @3750'. Sqz open hole from 3850-4050' w/550 sx P+ cmt w/3% CaCl.</li> </ol>	including estimated date of starting any
<ol> <li>Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completions.</li> <li>RUPU. Pull production equipment.</li> <li>Drill out CIBP @3750'. Sqz open hole from 3850-4050' w/550 sx P+ cmt w/3% CaCl.</li> <li>Run 5" 13# L-80 ULT FJ partial liner from 4052' to 2614'. (31 jts).</li> </ol>	including estimated date of starting any
<ol> <li>Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completions: Attach wellbore diagram of proposed completions.</li> <li>RUPU. Pull production equipment.</li> <li>Drill out CIBP @3750'. Sqz open hole from 3850-4050' w/550 sx P+ cmt w/3% CaCl.</li> <li>Run 5" 13# L-80 ULT FJ partial liner from 4052' to 2614'. (31 jts).</li> <li>Perforate the following intervals 3884-94 and 3924-34 using 4 spf, 90 deg ph. (82 holes).</li> </ol>	including estimated date of starting any
<ol> <li>Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completions.</li> <li>RUPU. Pull production equipment.</li> <li>Drill out CIBP @3750'. Sqz open hole from 3850-4050' w/550 sx P+ cmt w/3% CaCl.</li> <li>Run 5" 13# L-80 ULT FJ partial liner from 4052' to 2614'. (31 jts).</li> </ol>	including estimated date of starting any
<ol> <li>Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completions: Attach wellbore diagram of proposed completions.</li> <li>RUPU. Pull production equipment.</li> <li>Drill out CIBP @3750'. Sqz open hole from 3850-4050' w/550 sx P+ cmt w/3% CaCl.</li> <li>Run 5" 13# L-80 ULT FJ partial liner from 4052' to 2614'. (31 jts).</li> <li>Perforate the following intervals 3884-94 and 3924-34 using 4 spf, 90 deg ph. (82 holes).</li> <li>Stimulate perfs 3884-94 w/1550 g 15% NEFE HCL acid.</li> <li>Frac with 45,000# sand using 33000 g gel. Clean out to 4050'. Run post job tracer survey.</li> <li>RIH w/5" G-6 pkr, XL on/off tool w/1.875 "F" nipple, 122 jts 2-3/8" tbg. Set pkr @3831'.</li> </ol>	including estimated date of starting any
<ol> <li>Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completions: Attach wellbore diagram of proposed completions.</li> <li>RUPU. Pull production equipment.</li> <li>Drill out CIBP @3750'. Sqz open hole from 3850-4050' w/550 sx P+ cmt w/3% CaCl.</li> <li>Run 5" 13# L-80 ULT FJ partial liner from 4052' to 2614'. (31 jts).</li> <li>Perforate the following intervals 3884-94 and 3924-34 using 4 spf, 90 deg ph. (82 holes).</li> <li>Stimulate perfs 3884-94 w/1550 g 15% NEFE HCL acid.</li> <li>Frac with 45,000# sand using 33000 g gel. Clean out to 4050'. Run post job tracer survey.</li> <li>RIH w/5" G-6 pkr, XL on/off tool w/1.875 "F" nipple, 122 jts 2-3/8" tbg. Set pkr @3831'.</li> <li>RDPU. Clean Location.</li> </ol>	including estimated date of starting any
<ol> <li>Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completions: Attach wellbore diagram of proposed completions: Attach wellbore diagram of proposed completions.</li> <li>RUPU. Pull production equipment.</li> <li>Drill out CIBP @3750'. Sqz open hole from 3850-4050' w/550 sx P+ cmt w/3% CaCl.</li> <li>Run 5" 13# L-80 ULT FJ partial liner from 4052' to 2614'. (31 jts).</li> <li>Perforate the following intervals 3884-94 and 3924-34 using 4 spf, 90 deg ph. (82 holes).</li> <li>Stimulate perfs 3884-94 w/1550 g 15% NEFE HCL acid.</li> <li>Frac with 45,000# sand using 33000 g gel. Clean out to 4050'. Run post job tracer survey.</li> <li>RIH w/5" G-6 pkr, XL on/off tool w/1.875 "F" nipple, 122 jts 2-3/8" tbg. Set pkr @3831'.</li> <li>RDPU. Clean Location.</li> <li>Rig Up Date: 06/06/2005</li> </ol>	including estimated date of starting any
<ol> <li>Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completions: Attach wellbore diagram of proposed completions.</li> <li>RUPU. Pull production equipment.</li> <li>Drill out CIBP @3750'. Sqz open hole from 3850-4050' w/550 sx P+ cmt w/3% CaCl.</li> <li>Run 5" 13# L-80 ULT FJ partial liner from 4052' to 2614'. (31 jts).</li> <li>Perforate the following intervals 3884-94 and 3924-34 using 4 spf, 90 deg ph. (82 holes).</li> <li>Stimulate perfs 3884-94 w/1550 g 15% NEFE HCL acid.</li> <li>Frac with 45,000# sand using 33000 g gel. Clean out to 4050'. Run post job tracer survey.</li> <li>RIH w/5" G-6 pkr, XL on/off tool w/1.875 "F" nipple, 122 jts 2-3/8" tbg. Set pkr @3831'.</li> <li>RDPU. Clean Location.</li> </ol>	including estimated date of starting any
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completions: Attach wellbore di	including estimated date of starting any ompletion or recompletion.
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed of the completion of the complete of the completion of the complete of the	including estimated date of starting any ompletion or recompletion.
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completions: Attach wellbore di	including estimated date of starting any ompletion or recompletion.  hat any pit or below-grade tank has been/will be
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed complete to the best of my knowledge and belief. I further certify to a general permit workover Complete SIGNATURE  1. RUPU. Pull production equipment. 2. Drill out CIBP @3750'. Sqz open hole from 3850-4050' w/550 sx P+ cmt w/3% CaCl. 3. Run 5" 13# L-80 ULT FJ partial liner from 4052' to 2614'. (31 jts). 4. Perforate the following intervals 3884-94 and 3924-34 using 4 spf, 90 deg ph. (82 holes). 5. Stimulate perfs 3884-94 w/1550 g 15% NEFE HCL acid. 6. Frac with 45,000# sand using 33000 g gel. Clean out to 4050'. Run post job tracer survey. 7. RIH w/5" G-6 pkr, XL on/off tool w/1.875 "F" nipple, 122 jts 2-3/8" tbg. Set pkr @3831'. 8. RDPU. Clean Location. Rig Up Date: 06/06/2005 Rig Down Date: 06/27/2005  1 hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify the constructed or closed according to NMOCD guidelines	including estimated date of starting any ompletion or recompletion.  hat any pit or below-grade tank has been/will be  OCD-approved  pletion Specialist  DATE 07/04/2005
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed complete to the best of my knowledge and belief. I further certify to constructed or closed according to NMOCD guidelines TITLE Workover Complete SIGNATURE  1. RUPU. Pull production equipment. 2. Drill out CIBP @3750'. Sqz open hole from 3850-4050' w/550 sx P+ cmt w/3% CaCl. 3. Run 5" 13# L-80 ULT FJ partial liner from 4052' to 2614'. (31 jts). 4. Perforate the following intervals 3884-94 and 3924-34 using 4 spf, 90 deg ph. (82 holes). 5. Stimulate perfs 3884-94 w/1550 g 15% NEFE HCL acid. 6. Frac with 45,000# sand using 33000 g gel. Clean out to 4050'. Run post job tracer survey. 7. RIH w/5" G-6 pkr, XL on/off tool w/1.875 "F" nipple, 122 jts 2-3/8" tbg. Set pkr @3831'. 8. RDPU. Clean Location. Rig Up Date: 06/06/2005 Rig Down Date: 06/07/2005  1 hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify to constructed or closed according to NMOCD guidelines	including estimated date of starting any ompletion or recompletion.  hat any pit or below-grade tank has been/will be COCD-approved pletion Specialist  DATE 07/04/2005
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completed operations (Clearly state all pertinent details, and give pertinent dates, proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed complete work of the proposed complete to the set of the proposed of the proposed complete to the set of the proposed of the propos	including estimated date of starting any ompletion or recompletion.  hat any pit or below-grade tank has been/will be  OCD-approved  pletion Specialist  DATE 07/04/2005

