

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-40169
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Big Brave State
8. Well Number 1
9. OGRID Number 281085
10. Pool name or Wildcat Comanche Stateline Tansill-Yates
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 2943' GL

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	HOBBS OCD
2. Name of Operator RMR Operating, LLC	AUG 2 0 2018
3. Address of Operator 14282 Gillis Rd, Farmers Branch, TX 75244	RECEIVED
4. Well Location Unit Letter A : 330 feet from the North line and 330 feet from the East line Section 33 Township 26-S Range 36-E NMPM County Lea	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 2943' GL	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO PERFORM REMEDIAL WORK <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> DOWNHOLE COMMINGLE <input type="checkbox"/> CLOSED-LOOP SYSTEM <input type="checkbox"/> OTHER: <input type="checkbox"/>	INT TO PA P&A NR <u>PM</u> P&A R	SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> P AND A <input checked="" type="checkbox"/> CASING/CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>
---	---	--

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Approved for Plugging of wellbore only. Liability under bond is retained pending restoration and completion of the 03. See for Subsequent Report of Well Plugging, which may be found on the OCD web page under forms.
Restoration Due By **6-13-2019**

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Alan W Barksdale TITLE President DATE 8/17/18

Type or print name Alan W Barksdale E-mail address: alan@redmountainresources.com PHONE: 501-412-4097
For State Use Only

APPROVED BY: Mark W Pitzer TITLE P.E.S. DATE 08/20/2018
Conditions of Approval (if any):

mw

BIG BRAVE STATE #1 (LEA COUNTY, NEW MEXICO)

06/08/18	DROVE PORTION OF P&A EQUIPMENT TO LOCATION. CALLED IN & SPOKE TO MARK WHITAKER W/ NMOC D & ADVISED HIM OF MOVE IN & P&A JOB. SDFD.
06/09/18	MOVED RIG & BACKHOE TO LOCATION. HELD A TAILGATE SAFETY MEETING & JSA. SPOT BEAM & RU PULLING UNIT DISASSEMBLED PUMP JACK HEAD. RU WORK FLOOR & ROD TONGS. UNSET PUMP & POOH W/ 145 RODS & PUMP & LD. CWI & SDFN.
06/10/18	ARRIVE ON LOCATION, HELD JSA & TAILGATE SAFETY MEETING ON WORKING IN HEAT. RD ROD TONGS & FLOOR & CHANGED EQUIP OVER TO TBG. DIG OUT CELLAR TO FIND SURF VALVE. ND WH & NU BOP. PULL ON TBG – TBG FREE. POOH W/ 119 JTS TBG. 9 JTS HAD HOLES & TBG WAS IN ROUGH SHAPE. RBIH W/ TBG TO 3,198' CWI. SPOKE W/ NMOC D, THEY REVISED PROCEDURE TO SPOT 30 SX @ 3,198' & WOC & TAG INSTEAD OF SETTING CIBP AND ALSO WOC PLUG @ 1,478' WILL PUMP PLUG IN AM. SDFD
06/11/18	DROVE TO LOC & WAITED ON TRUCK UNTIL 8:00 AM. PUMPED 60 BBLS WATER DOWN HOLE. SPOTTED 30 SXS CMT W/ CACL2 @ 3,198'. POOH & WOC FROM 9:00 AM TO 12:30 PM. RIH W/ SLICKLINE TO TAG – NO TAG. SPOKE W/ MARK WHITAKER W/ OCD – INSTRUCTED US TO RESPOT PLUG. RIH W/ TBG TO 3,198', PUMPED 15 BBLS WATER & PUMPED 50 SXS CMT W/ CACL2. POOH & WOC. @ 4:30 PM RIH W/ SLICKLINE & TAGGED TOC @ 3,430'. SPOKE W/ MARK WHITAKER W/ OCD – INSTRUCTED US TO SPOT ADDT'L PLUG @ 3,198'. RIH W/ TBG TO 3,198', PUMPED 20 BBLS WATER & SPOTTED A 50 SXS CMT PLUG. POOH. CWI. SDFN @ 7:30 PM.
06/12/18	ARRIVED ON LOC – HELD TAILGATE SAFETY MEETING & JSA ON H2S, PINCH POINTS & COMMUNICATIONS. @ 7:00 AM OPEN WELL – NO PRESS. RU SLICKLINE, RIH & TAGGED TOC @ 3,252'. SPOKE W/ JEFF W/ RWS – INSTRUCTED US TO SPOT AN ADDT'L 50 SXS CMT PLUG. @ 7:45 AM SPOKE W/ MARK W/ OCD – ALSO INSTRUCTED TO SPOT 50 ADDT'L SXS CMT TO BRING PLUG HEIGHT UP. @ 9:00 AM RIH TO 3,252' & SPOTTED A 50 SXS CMT PLUG W/ 2% CACL2. POOH & WOC. @ 1:00 PM RU SLICKLINE, RIH & TAGGED TOC @ 2,870' – NOTIFIED MARK W/ OCD – OK'D PLUG AND TO MOVE ON WITH PROCEDURE. POOH W/ SLICKLINE. RIH W/ TBG TO 2,870' & MUD UP HOLE. LD TBG TO 1,478' & SPOTTED A 25 SXS CMT PLUG. POOH & WOC. @ 5:30 PM CWI. SDFN.
06/13/18	ARRIVED ON LOC – HELD TAILGATE SAFETY MEETING & JSA ON H2S, RD, CUTTING OFF WH & MOVING EQUIP. @ 7:00 AM OPEN WELL – NO PRESS. RIH W/ TBG & TAGGED TOC @ 1,194'. POOH & LD TBG. RD FLOOR & ND BOP. RU FLOOR & RIH W/ TBG TO 250'. @ 8:05 AM SPOKE W/ MARK W/ OCD – INFORMED HIM OF TAG. @ 9:45 AM CIRC CMT TO SURF FROM 250'

BIG BRAVE STATE #1 (LEA COUNTY, NEW MEXICO)

	W/ 25 SXS CMT. LD TBG. RD TONGS, FLOOR & RIG. DUG OUT CELLAR & CUT OFF WH. WELDED ½' PLATE & SUB FOR DRY HOLE MARKER SIGN. REMOVED ANCHORS & CLEANED LOC. WELL COMPLETE.
--	--