Submit 1 Copy To Appropriate District State of New Mexico				Form C-103		
District I - (575) 393-6161	Energy, Minerals and Natural Resources			Revised August 1, 2011		
1625 N. French Dr., Hobbs, NM 88240 District II - (575) 748-1283	IM 88240			WELL API	NU.	
811 S. First St., Artesia, NM 88210				30-005-20272		
<u>District III</u> - (505) 334-6178	1220 South St. Francis Dr.			5. Indicate Type of Lease		
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460	Santa Fe, NM 87505			STATE FEE X		
1220 S. St. Francis Dr., Santa Fe, NM				6. State Oil & Gas Lease No.		
87505						
SUNDRY NOTICES AND REPORTS ON WELLS				7. Lease N	ame or Unit Agreement Name	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A						
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-10) FOR SUCH PROPOSALS.)				Cato San Andres Unit		
,	Type of Well: Oil Well X Gas Well Other				8. Well Number 195	
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-10) FOR SUCH PROPOSALS.) 1. Type of Well: Oil Well X Gas Well Other 2. Name of Operator State of New Mexico for Cano Petro of NM. Inc.				9. OGRID Number		
3. Address of Operator				10. Pool name or Wildcat		
811 S. First Street Artesia, NM 88210				Cato; San Andres		
4. Well Location						
Unit LetterK:	1980feet from the	Southli	ne and	1980 <u>f</u>	eet from theWestline	
Section 5	Township 9	S Range	30E	NMPM	County Chaves	
	11. Elevation (Show wh	ether DR, RKB, RT	r, GR, etc.)			
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPL DOWNHOLE COMMINGLE MULTIPLE COMPL OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion. SEE ATTACHED						
jj	rrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrrr	· · · · · · · · · · · · · · · · · · ·				
SIGNATURE	TITL	.Е			DATE	
Type or print name	F-ma	il address:			PHONE:	
For State Use Only	=					
APPROVED BY: <u>Yeary</u> Conditions of Approval (if an 5):	Jute TITLI	ECO	A	. .	DATE 6-18-20	
		•				

Plugging Report Cato San Andres Unit #195 API 30-005-20272

5/19/2020 Worked on the road and cleared the location. Moved in rig and rigged up. Moved in remaining equipment. Dug out cellar and plumbed surface head to the pit. 4 ½" casing will have to be repaired before installing wellhead and BOP.

5/20/2020 Pumped 15 bbls fresh down the wellbore and repaired 4 ½" casing. Installed wellhead and the BOP. Made scraper run to 3204' with minimal issues. POOH and set CIBP at 3182'. Circulated MLF. Casing did not test. Spot 25 sx Class C cement on top of CIBP. POOH and SION. Will tag in the morning.

5/21/2020 Tagged cement at 2970'. Established circulation and tested casing. Casing still had a leak. POOH and pick up packer. Isolated holes from 951' to 1015'. Called OCD. Perforated 4 ½" casing at 1420'. Set packer at 1078' and squeezed perfs with 40 sx cement. No communication with the surface. ISIP 1100#. Shut in and shut down.

5/22/2020 Tagged cement at 1244'. POOH and set packer at 602'. Could not establish rate in to holes in casing from 951' to 1015'. Held 750#. Called OCD. Pulled packer and spotted 25 sx cement with CaCl from 1078'. WOC and tagged cement at 722'. Perforated casing at 325'. Set packer on 1 joint of tubing and worked to break down perfs with up to 1200#. Could not establish rate. Called OCD. RIH with tubing to 380' and circulated cement to surface inside 4 ½" casing. Took 30 sx to get good cement to the pit.

5/25/2020 Rigged down, dug out and cut off wellhead. Filled up 4 ½" casing with 5 sx cement and 1 inched 4 ½" X 8 5/8" annulus from 100' with 20 sx cement. Installed marker, removed anchors, and cleaned the pit.