

Submit 1 Copy To Appropriate District Office

District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised July 18, 2013

WELL API NO. 30-025-22122
5. Indicate Type of Lease STATE [X] FEE []
6. State Oil & Gas Lease No. K-119
7. Lease Name or Unit Agreement Name Sohio "B"
8. Well Number 1
9. OGRID Number 247692
10. Pool name or Wildcat Undes. N. Bagley M. Penn
4. Well Location Unit Letter P : 660 feet from the South line and 660 feet from the East line
Section 5 Township 11 S Range 33 E NMPM County Lea
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 4312.5 KB

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:
PERFORM REMEDIAL WORK [] PLUG AND ABANDON []
TEMPORARILY ABANDON [] CHANGE PLANS []
PULL OR ALTER CASING [] MULTIPLE COMPL []
DOWNHOLE COMMINGLE []
CLOSED-LOOP SYSTEM []
OTHER: []
SUBSEQUENT REPORT OF:
REMEDIAL WORK [] ALTERING CASING []
COMMENCE DRILLING OPNS. [] P AND A [X]
CASING/CEMENT JOB []
OTHER: []

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 06/11/20 Attempt to pull tubing. Fail. Pressure test casing to 500 psi. Pass. Call OCD for instruction.
06/12/20 Free point tubing @ 5460' and Spot a balance plug @ 5460' w/ 25 sx Class "C" cmt (Per Kerry w/ OCD). WOC.
06/13/20 Tag plug @ 5195'.
06/14/20 Pref @ 5000' (Per Kerry w/ OCD). Attempt to Sqz. Fail. Call OCD for instruction.
Spot a balance plug @ 5050' w/ 25 sx cmt (Per Kerry w/ OCD). Perf @ 3800'. Attempt to Sqz. Fail. Call OCD for instruction.
Spot a balance plug @ 3850' w/ 25 sx cmt (Per Kerry w/OCD). WOC. Tag plug @ 3606'. Perf 2420'.
Attempt to Sqz. Fail. Call OCD for instruction. Spot a balance plug @ 2470' w/ 25 sx cmt. WOC.
06/15/20 Tag plug @ 2136'. Perf @ 1750'. Sqz w/ 65 sx cmt. WOC. Tag plug @ 1125'. Perf @ 395'. Circulate cement to surface.
06/16/20 Cut off wellhead 3' below ground level. Verify cement to surface. Install dry hole marker.

Spud Date: 06/11/2020 Rig Release Date: 06/16/2020

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Production Analyst DATE 08/19/2020
Type or print name Nhi Le E-mail address: nle@jaymgt.com PHONE: 713-621-6785
APPROVED BY: Kerry Fortner TITLE C O A DATE 9-11-20
Conditions of Approval (if any):