

Submit 1 Copy To Appropriate District Office
 District I - (575) 393-6161
 1625 N. French Dr., Hobbs, NM 88240
 District II - (575) 748-1283
 811 S. First St., Artesia, NM 88210
 District III - (505) 334-6178
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV - (505) 476-3460
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised July 18, 2013

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-35828
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator Legacy Reserves Operating LP		6. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 10848, Midland, TX 79702		7. Lease Name or Unit Agreement Name Ruby
4. Well Location Unit Letter K : 2310 feet from the S line and 1650 feet from the W line Section 24 Township 19S Range 38E NMPM County Lea		8. Well Number #2
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3587' GR		9. OGRID Number 240974
10. Pool name or Wildcat Nadine; Drinkard-Abo		

HOBBBS OGD
 SEP 29 2020
RECEIVED

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input checked="" type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPL <input type="checkbox"/> DOWNHOLE COMMINGLE <input type="checkbox"/> CLOSED-LOOP SYSTEM <input type="checkbox"/> OTHER: <input type="checkbox"/>		SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> P AND A <input type="checkbox"/> CASING/CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>	
---	--	---	--

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Set 5 1/2" CIBP @ 7020'. Circ hole w/ MLF. Pressure test csg. Spot 25 sx class C cmt @ 7020-6820'.
2. Spot 25 sx cmt @ 4360-4160'. (San Andres)
3. Spot 25 sx cmt @ 2700-2500'. WOC & Tag (B/Salt)
4. Perf & Sqz 50 sx cmt @ 1770-1570'. WOC & Tag (8 5/8" Shoe & T/Salt)
5. Spot 25 sx cmt @ 200' to surface.
6. Cut off well head, verify cmt to surface, weld on Dry Hole Marker.

**See Attached
 Conditions of Approval**

Spud Date: Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *Melanie Reyes* TITLE Compliance Coordinator DATE 09/25/2020

Type or print name Melanie Reyes E-mail address: mreyes@legacyreserves.com PHONE: (432) 221-6358
For State Use Only


APPROVED BY: *Kenny Fath* TITLE COA DATE 9-29-20
 Conditions of Approval (if any):

Wellbore Schematic

Printed: 9/23/2020

Page 1

RUBY # 2	BOLO ID: 300651.02	API # 3002535828
RUBY # 2, 9/23/2020	2310 FSL & 1650 FWL	GL Elev: 3,587.00
	Section 24, Township 19S, Range 38E	KOP:
	County, State: LEA, NM	EOC:
	Aux ID: 203280	Fill Depth:
	'KB' correction: ; All Depths Corr To:	PBTD:
		TD: 7,800.00
		BOP:

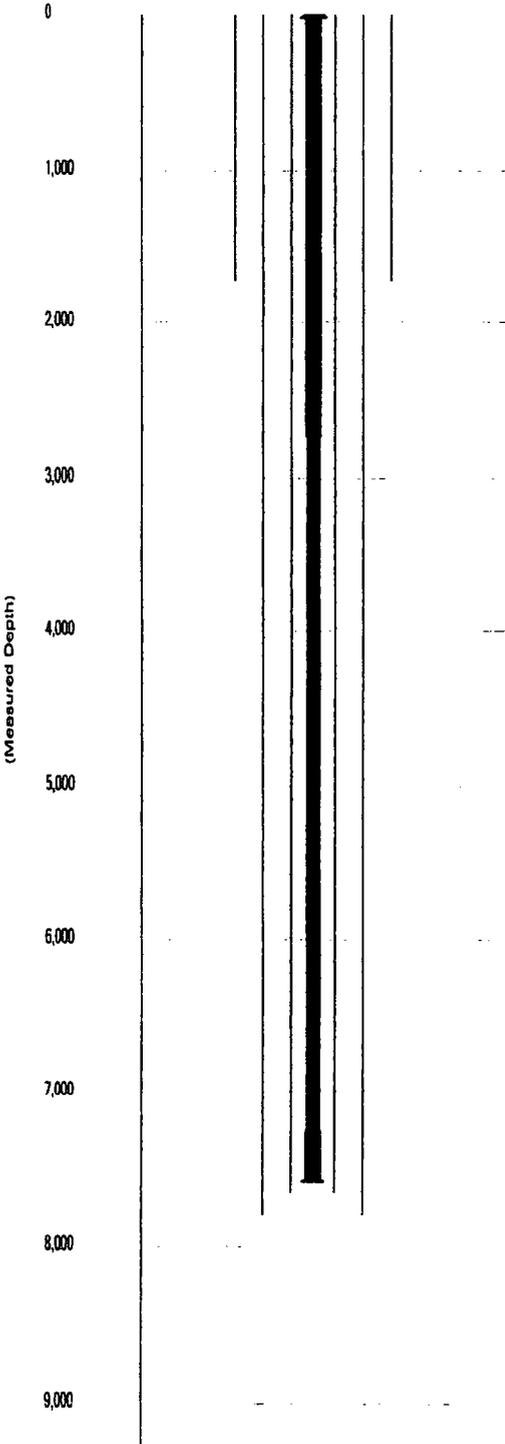

Surface Casing Date Ran: 3/31/2002

Description	#	Diameter	Weight	Grade	Length	Top At	Btm At
Casing		8.6250			1,720.00	0.00	1,720.00

Production Casing Date Ran: 3/31/2002

Description	#	Diameter	Weight	Grade	Length	Top At	Btm At
Casing		5.5000			7,800.00	0.00	7,800.00

Zone and Perfs

DRINKARD

Comments / Completion Summary

STEVENS TULL

Perforations

Top	Bottom	Formation	Status	Opened	Closed	# / Ft	Ttl #
7,080.00	7,140.00	DRINKARD	A				
7,428.00	7,585.00	ABO	A				

Tubing Date Ran: 1/24/2006

Description	#	Diameter	Weight	Grade	Length	Top At	Btm At
Tubing	221	2.3750	4.70	J55	6,946.00	0.00	6,946.00
Tubing Anchor	1	5.5000			3.00	6,946.00	6,949.00
Tubing	21	2.3750	4.70	J55	659.00	6,949.00	7,608.00
Seat Nipple	1	2.3750			1.10	7,608.00	7,609.10
Perf Nipple	1	2.3750			4.00	7,609.10	7,613.10
Mud Anchor	1	2.3750	4.70	J55	32.00	7,613.10	7,645.10

Rods Date Ran: 3/21/2018


Description	#	Diameter	Rod Box	Grade	Length	Top At	Btm At
Polish Rod	1	1.2500			26.00	0.00	26.00
Polish Rod Liner	1	1.5000			10.00	16.00	26.00
Pony Rods	2	0.8750			8.00	26.00	34.00
Rods	108	0.8750			2,700.00	34.00	2,734.00
Rods	181	0.7500			4,525.00	2,734.00	7,259.00
Rods	12	0.8750			300.00	7,259.00	7,559.00
Pump	1	1.2500			16.00	7,559.00	7,575.00

2 x 1.25 x 16 RHBC

Legacy

Author:	Abby-BCM & Associates, Inc	Well No.:	#2
Well Name:	Ruby	API #:	30-025-35828
Field/Pool:	Dadino, Drinkard-Abo	Location:	Sec 24, T19S, R33E
County:	Lea		2310 FSL, 1650 FWL
State:	New Mexico	GL:	3587
Spud Date:	3/4/2002		

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8 5/8		24#	1,720	12 1/4	800	0
Prod Csg	5 1/2		17#	7,800	7 7/8	1,790	0

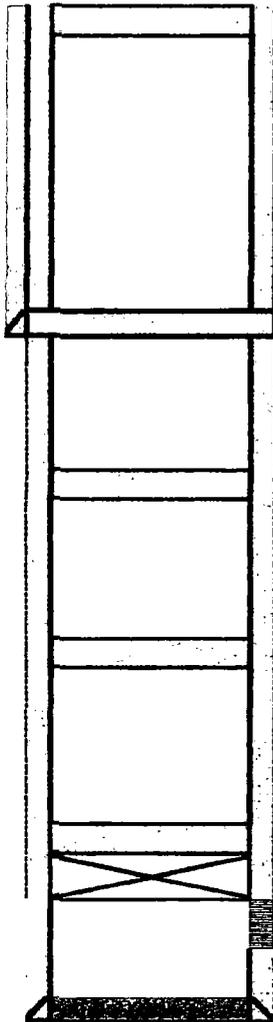

5. Spot 25 sx cmt @ 200' to surface.

8 5/8 24# CSG @ 1,720
Hole Size: 12 1/4

4. Perf & Sqz 50 sx cmt @ 1770-1570'. WOC & Tag (8 5/8" Shoe & T/Salt)

3. Spot 25 sx cmt @ 2700-2500'. WOC & Tag (B/Salt)

2. Spot 25 sx cmt @ 4360-4160'. (San Andres)

1. Set 5 1/2" CIBP @ 7020'. Circ hole w/ MLF. Pressure test csg. Spot 25 sx class C cmt @ 7020-6820'.

Perfs @ 7080-7140
Perfs @ 7428-7686

5 1/2 17# CSG @ 7,800
Hole Size: 7 7/8

**CONDITIONS OF APPROVAL
FOR PLUGGING AND ABANDONMENT
OCD - Southern District**

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify **NMOCD District Office I (Hobbs) at (575)-263-6633** at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
3. Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
8. Produced water will not be used during any part of the plugging operation.
9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
11. Class 'C' cement will be used above 7500 feet.
12. Class 'H' cement will be used below 7500 feet.
13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) **Fusselman**
 - B) **Devonian**
 - C) **Morrow**
 - D) **Wolfcamp**
 - E) **Bone Springs**
 - F) **Delaware**
 - G) **Any salt sections**
 - H) **Abo**
 - I) **Glorieta**
 - J) **Yates.**
 - K) **Potash---(In the R-111-P Area (Potash Mine Area),**

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least 1/4" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name
2. Lease and Well Number
3. API Number
4. Unit letter
5. Quarter Section (feet from the North, South, East or West)
6. Section, Township and Range
7. Plugging Date
8. County

SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION