Conditions of Approval, if any:



State A A/C-2 #39 Jalmat Field Lea County, NM

May 15, 2006

Plug and Abandonment Procedure

- 1. MIRU plugging rig. Dump 35' cement on top of CIBP at 3650'.
- 2. TIH with open ended workstring to PBTD and load hole with 10 ppg gelled brine.
- 3. Perforate 5-1/2" casing at 3010'. Mix 200' bottom of salt cement plug (70 sx class A). Pump through perfs at 3010' leaving top of cement inside casing at 2810'.
- 4. Perforate 5-1/2" casing at 1680'. Mix 200' top of salt cement plug (70 sx class A). Pump through perfs at 1680' leaving top of cement inside casing at 1480'.
 - 5. Perforate 5-1/2" casing @ 275'. Mix surface plug (95 sx class A). Squeeze through perfs at 275', attempting to circulate cement to surface. Leave top of cement inside casing at surface.
 - 6. Cut off wellhead, cap well and install P&A marker.
 - 7. Clean location for OCD inspection.

WOC4 TAG 344



